

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22009527/AWY3E2**Date:** 13/02/2023REFERENCEHandling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00109072102

**Claimant Vehicle
No :** SGC3333X**Insured
Vehicle No :** YP8424C

Date of Loss: 26/09/2022

Nature of Claim: TP

Claim
No: SNM22D206883/C02/KHONGLHDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SGC3333X**

Make & Model: MERCEDES-BENZ E200 AVG, 2.0 (R18 LED) (A) Engine No: HIDDEN

Reg. Date: 01/02/2017 (Man. Year: 2017) Chassis No: WDD2130422A159763

Colour: Black Odometer: 87720 km

Engine Capacity: 1991 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/45 R18 Rear Tyre Size: 245/45 R18

Front Left Side: Pirelli 6 mm Rear Left Side: Pirelli 6 mm

Front Right Side: Pirelli 6 mm Rear Right Side: Pirelli 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	26,836.00	23,135.00	3,701.00	13.79
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,630.00	4,540.00	2,090.00	31.52
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	33,466.00	27,675.00	5,791.00	17.30
Approved Total (Overridden) (S\$)		22,100.00		
(S\$)	33,466.00	22,100.00	11,366.00	33.96
+ GST 8.00/8.00% (S\$)	2,677.28	1,768.00	909.28	33.96
Nett Amount (S\$)	36,143.28	23,868.00	12,275.28	33.96

INSPECTION

Date of Assignment: 27/09/2022

Date Inspected: 27/09/2022 Inspected At: Modern Automotive Pte Ltd (HQ)
Blk 3023A Ubi Road 1, #01-61 & #01-58
Singapore 408717

Estimated Period of Repair: 10.0 days

Adjuster: ADRIAN LING**Manager:** XinYu

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 13 Feb 2023)
Parts:	143	MERCEDES-BENZ E200 AVG 2.0 (R18 LED) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SGC3333X)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
1	2	*REAR NUMBER PLATE LAMP - LH & RH	Cracked	150.00 FL	*150.00 FL
2	1	*REAR NUMBER PLATE LAMP GARNISH	Cracked	68.00 FL	*68.00 FL
3	1	*REAR BUMPER	Distorted	1,874.00 FL	*1,874.00 FL
4	2	*REAR BUMPER SIDE HOLDER - LH & RH	Necessary	384.00 FL	*384.00 FL
5	1	*REAR BUMPER REFLECTOR - LH / RH	O/S Cut	138.00 FL	*69.00 FL
6	1	*REAR BUMPER REINFORCEMENT	Dented	846.00 FL	*846.00 FL
7	1	*REAR BUMPER LOWER GARNISH	Distorted	485.00 FL	*485.00 FL
8	1	*REAR BUMPER LOWER GARNISH CHROME MOULDING	Cracked	291.00 FL	*291.00 FL
9	2	*REAR BUMPER EXHAUST CHROME - LH & RH	Not Necessary	462.00 FL	*- FL
10	1	*REAR BUMPER TOW COVER	Deformed	59.00 FL	*59.00 FL
11	1	*REAR BUMPER CENTRE GUIDE	Damaged	275.00 FL	*275.00 FL
12	1	*REAR BUMPER LOWER KICK SENSOR	Damaged	316.00 FL	*316.00 FL
13	2	*REAR BUMPER LOWER KICK SENSOR BRACKET - LH / RH	Not Necessary	124.00 FL	*- FL
14	1	*REAR BUMPER REVERSE SENSOR (4PCS)	Damaged (3Pcs Only)	1,072.00 FL	*804.00 FL
15	4	*REAR BUMPER REVERSE SENSOR HOLDER	Necessary	100.00 FL	*100.00 FL
16	1	*REAR BUMPER REVERSE SENSOR WIRE HARNESS	Not Necessary	622.00 FL	*- FL
17	1	*REAR END PANEL	Distorted	1,302.00 FL	*1,302.00 FL
18	1	*REAR END PANEL TOP COVER	Deformed	229.00 FL	*229.00 FL
19	2	*TAILLAMP - LH & RH	Cracked	1,570.00 FL	*1,570.00 FL
20	1	*TAILLAMP PANEL - LH & RH	O/S Dented	584.00 FL	*292.00 FL
21	2	*TAILLAMP LOWER BRACKET - LH & RH	Cracked	134.00 FL	*134.00 FL
22	1	*BOOTLID	Distorted	2,399.00 FL	*2,399.00 FL
23	1	*BOOTLID LOCK	Jammed	294.00 FL	*294.00 FL
24	1	*BOOTLID LOCK ACTUATOR	Damaged	489.00 FL	*489.00 FL
25	1	*BOOTLID WEATHERSTRIPE	Cut	292.00 FL	*292.00 FL
26	2	*BOOTLID HINGE - LH & RH	Bent	570.00 FL	*570.00 FL
27	2	*BOOTLID HINGE COVER - LH & RH	Deformed	116.00 FL	*116.00 FL
28	1	*BOOTLID INNER TRIM BOARD	Deformed	525.00 FL	*525.00 FL
29	1	*BOOTLID INNER GARNISH COVER	Not Necessary	275.00 FL	*- FL
30	1	*BOOTLID OUTER CHROME MOULDING	Cracked	267.00 FL	*267.00 FL
31	1	*BOOTLID OPENER SWITCH	Damaged	198.00 FL	*198.00 FL
32	1	*BOOTLID CAMERA	Damaged	859.00 FL	*859.00 FL
33	1	*MERCEDES BENZ LOGO	Necessary	70.00 FL	*70.00 FL
34	1	*E200 WORDING	Necessary	93.00 FL	*93.00 FL
35	1	*9G TRONIC WORDING	Necessary	97.00 FL	*97.00 FL
36	1	*REAR FENDER - LH	Distorted	1,849.00 FL	*1,849.00 FL
37	1	*REAR FENDER INNER TRIM BOARD - LH & RH	O/S Deformed	910.00 FL	*455.00 FL
38	2	*REAR FENDER TOP GARNISH - LH & RH	N/S Cracked / O/S Cut	104.00 FL	*104.00 FL
39	1	*REAR WINDSCREEN	Cut	1,281.00 FL	*1,281.00 FL
40	1	*REAR WINDSCREEN MOULDING	Necessary	254.00 FL	*254.00 FL
41	1	*SPARE TRYE PANEL (FIBRE)	Not Necessary	498.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No. Particulars	Condition	Repairer's	Amount
42	1	*SPARE TYRE PANEL TOP BOARD	Deformed	710.00 FL	*710.00 FL
43	1	*SPARE TYRE PANEL CARPET	Deformed	595.00 FL	*595.00 FL
44	1	*SPARE TYRE PANEL SPONGE TRAY	Not Necessary	158.00 FL	*- FL
45	1	*FRONT DRIVER SEAT BELT	Activated	868.00 FL	*868.00 FL
46	1	*FRONT PASSENGER SEAT BELT	Activated	868.00 FL	*868.00 FL
47	1	*REAR PASSENGER SEAT BELT (3PCS)	Activated (2Pcs Only)	2,001.00 FL	*1,334.00 FL
48	1	*AIR BAG ECU	Activated	915.00 FL	*915.00 FL
49	1	*SET REAR END PANEL TOP GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
50	1	*REAR END PANEL SEALANT	Necessary	60.00 FS	*60.00 FS
51	1	*REAR NUMBER PLATE	Bent	30.00 FS	*30.00 FS
52	1	*REAR NUMBER PLATE HOLDER	Deformed	30.00 FS	*30.00 FS
53	1	*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*50.00 FS
54	1	*SET REAR BUMPER LOWER GARNISH CLIPS	Necessary	20.00 FS	*20.00 FS
55	1	*SET BOOTLID INNER TRIM BOARD CLIPS	Necessary	30.00 FS	*30.00 FS
56	1	*SET BOOTLID INNER GARNISH COVER CLIPS	Necessary	20.00 FS	*20.00 FS
57	1	*SET BOOTLID OUTER CHROME MOULDING CLIPS	Necessary	20.00 FS	*20.00 FS
58	1	*SET REAR FENDER INNER TRIM BOARD CLIPS	Necessary	100.00 FS	*30.00 FS
59	1	*SET REAR FENDER TOP GARNISH CLIPS	Necessary	40.00 FS	*40.00 FS
60	1	*REAR WINDSCREEN SEALANT	Necessary	60.00 FS	*60.00 FS
61	1	*REAR WINDSCREEN SOLAR FILM	Necessary	300.00 FS	*250.00 FS
62	1	*SET HAZARD SIGN	Damaged	280.00 FS	*200.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	29,700.00	25,610.00
- List Item Discount on L Items 10.00/10.00% (\$\$)	2,864.00	2,475.00
Total Parts (\$\$)	26,836.00	23,135.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO KNOCKING OUT REAR PORTION & RENEW ABOVE PARTS	New	2,200.00	1,700.00
2	TO PUTTY & SPRAY UP PAINT WORKS	New	2,000.00	1,400.00
3	TO CHECK WIRING	New	100.00	50.00
4	TO APPLY TUFF COAT	New	150.00	100.00
5	TO REMOVE REVERSE SENSOR	New	100.00	60.00
6	TO REMOVE REAR CAMERA	New	100.00	60.00
7	TO REMOVE REAR VIDEO RECORDER	New	100.00	60.00
8	TO REMOVE UPHOLSTERY	New	150.00	80.00
9	TO TRANSFER BOOTLID FITTINGS	New	150.00	80.00
10	TO REMOVE REAR WINDSCREEN	New	180.00	120.00
11	TO REMOVE FRONT AND REAR SEAT BELTS	New	500.00	350.00
12	TO RESET AIR BAG SETTINGS	New	500.00	280.00
13	TO PERFORM DIAGNOSTIC TEST	New	400.00	200.00
Gross Labour Cost (\$\$)			6,630.00	4,540.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >