

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/MSG22009536/AGQY3M4**Date:** 14/02/2023REFERENCE

Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	1001961318
Claimant Vehicle No :	SLZ501S	Insured Vehicle No :	SLM260E
Date of Loss:	26/09/2022	Nature of Claim:	TP
		Claim No:	286052

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLZ501S	Engine No:	CYG016337
Make & Model:	AUDI A6, 1.8 TFSI Ultra (PI) (NAV) (A)	Chassis No:	WAUZZZ4G2HN032906
Reg. Date:	30/11/2016 (Man. Year: 2016)	Odometer:	138565 km
Colour:	Red		
Engine Capacity:	1798 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	245/40 R19	Rear Tyre Size:	245/40 R19
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	20,603.30	14,652.36	5,950.94	28.88
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,680.00	1,050.00	1,630.00	60.82
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	23,283.30	15,702.36	7,580.94	32.56
Approved Total (Overridden) (S\$)		12,500.00		
(S\$)	23,283.30	12,500.00	10,783.30	46.31
+ GST 8.00/8.00% (S\$)	1,862.66	1,000.00	862.66	46.31
Nett Amount (S\$)	25,145.96	13,500.00	11,645.96	46.31

INSPECTION

Date of Assignment:	27/09/2022		
Date Inspected:	27/09/2022	Inspected At:	H S AUTOMOTIVE SERVICES 2 KAKI BUKIT AVE 2 #01-15 KAKI BUKIT AUTOHUB SINGAPORE 417921
Estimated Period of Repair:	4.0 days		

Adjuster: XING GUO QIANG**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 07 Feb 2023)
Parts:	143	AUDI A6 1.8 TFSI Ultra (PI) (NAV) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLZ501S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*LH FRONT HEAD LAMP	Cracked	10,147.00 F	*10,147.00 FL
2	1		*LH FRONT HEAD LAMP LOWER BRACKET	Not Necessary	131.50 F	*- FL
3	1		*LH FRONT FENDER	Buckled	1,560.00 F	*1,560.00 FL
4	1		*LH FRONT FENDER INNER SHIELD	Not Necessary	310.00 F	*- FL
5	1		*SET LH FRONT FENDER SHIELD CLIP	Not Necessary	195.00 F	*- FL
6	1		*FRONT BUMPER	Deformed	3,475.00 F	*3,475.00 FL
7	1		*SET FRONT BUMPER CLIP	Necessary	170.00 F	*50.00 FL
8	1		*LH FRONT BUMPER WASHER CAP	Missing	63.90 F	*63.90 FL
9	1		*LH FRONT HEAD LAMP NOZZLE	Cracked	259.00 F	*259.00 FL
10	1		*LH FRONT BUMPER GARNISH	Cut	355.00 F	*355.00 FL
11	1		*FRONT RADIATOR GRILLE	Not Necessary	2,140.00 F	*- FL
12	1		*LH FRONT PARKING SENSOR	Damaged	265.50 F	*265.50 FL
13	1		*FRONT SUPPORT PANEL	Not Necessary	1,385.00 F	*- FL
14	1		*LH FRONT BUMPER RETAINER	Not Necessary	41.40 F	*- FL
15	1		*LH FRONT BUMPER BRACKET	Damaged	105.00 F	*105.00 FL
					F=Franchise part. L=ListItemDisc.	
					Sub Total (S\$)	20,603.30 16,280.40
					- List Item Discount on L Items 0.00/10.00% (S\$)	0.00 1,628.04
					Total Parts (S\$)	20,603.30 14,652.36

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEAT	New	1,200.00	500.00
2	SPRAY PAINT	New	1,200.00	400.00
3	CHECK WIRING	New	100.00	30.00
4	REPROGRAME PDA SYSTEM	New	180.00	120.00
5	RUST PROOF (NPA)	New	0.00	0.00
Gross Labour Cost (S\$)			2,680.00	1,050.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >