

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22009569/AWY3Q2**Date:** 13/01/2023REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNA00094352201

Claimant Vehicle No : SKT1433S **Insured Vehicle No :** YN822A

Date of Loss: 26/09/2022 Nature of Claim: TP Claim No: SNM22D206887/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SKT1433S**

Make & Model: MERCEDES-BENZ GLC43 AMG, 3.0 4MATIC (A) Engine No: 27682330780815

Reg. Date: 01/06/2018 (Man. Year: 2017) Chassis No: WDC2533642F381369

Colour: White Odometer: 56736 km

Engine Capacity: 2996 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 265/40 R21 Rear Tyre Size: 265/40 R21

Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm

Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	600.00	400.00	200.00	33.33
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	600.00	400.00	200.00	33.33
+ GST 8.00/8.00% (S\$)	48.00	32.00	16.00	33.33
Nett Amount (S\$)	648.00	432.00	216.00	33.33

INSPECTION

Date of Assignment: 28/09/2022

Date Inspected: 30/09/2022 Inspected At: Success United Pte Ltd (HQ)
2 Kaki Bukit Ave 2 #01-33, Kaki Bukit AutoHub
Singapore 417921

Estimated Period of Repair: 2.0 days

Adjuster: ADRIAN LING**Manager:** XinYu*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 13 Jan 2023)

Parts: 143 MERCEDES-BENZ GLC43 AMG 3.0 4MATIC (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SKT1433S)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO REPAIR & RESPRAY PAINTING ON REAR FENDER GUARD RH AND REAR BUMPER GUARD RH	New	600.00	400.00
			Gross Labour Cost (\$\$)	400.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >