

## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLP 6261Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BOOT	BENT	1,702.00	1,702.00
1	REAR BOOT EMBLEM	NECESSARY	37.00	37.00
1	REAR BOOT 'STEPWGN' DESIGNATION }	NOT NECESSARY	146.00	-
1	REAR BOOT 'SPADA' DESIGNATION }		-	-
2	REAR BOOT PROTECTOR @\$657.00	O/S MTG CRACKED	1,314.00	641.50
2	REAR BOOT PROTECTOR TRIM COVER @\$80.00	SERVICEABLE	160.00	-
1	REAR BOOT LOCK	TO REPAIR SEE LABOUR	289.00	-
1	REAR BOOT CATCH	TO REPAIR SEE LABOUR	81.00	-
1	REAR BOOT PULL HANDLE	DENTED	35.00	35.00
1	REAR BOOT RUBBER	DENTED	207.00	207.00
1	REAR BOOT SIDE DOOR	BENT	1,459.00	1,459.00
1	REAR BOOT SIDE DOOR WEATHERSTRIP	SERVICEABLE	158.00	-
2	REAR BOOT SIDE DOOR HINGE @\$134.00	TO REPAIR SEE LABOUR	268.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	792.00	-
1	REAR END PANEL GARNISH	DENTED	195.00	195.00
1	REAR END PANEL MOULDING	SERVICEABLE	206.00	-
2	REAR BUMPER @\$365.00	SERVICEABLE	730.00	-
2	REAR BUMPER REFLECTOR @\$86.00	SERVICEABLE	172.00	-
2	REAR BUMPER SIDE RETAINER @\$82.00	SERVICEABLE	164.00	-
	LESS 20% DISCOUNT		-1,623.00	-855.30
			6,492.00	3,421.20
1	REAR RECEIVER SENSOR (SN)	SCRATCHED	438.00	200.00
	LESS 20% DISCOUNT		-87.60	-
			350.40	200.00
	SPECIAL NETT ITEMS			
1	REAR LICENSE SMART PLATE & CASING (SN)	SERVICEABLE	40.00	-

Report Ref No. CS/SMR22009647/Kny3e2



## **LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	SET REAR BUMPER PARKING SENSOR KIT (SN)	NOT NECESSARY	200.00	-
			240.00	-
	<u>LABOUR</u>			
	HEAT / WELD / CUT / RENEW REAR END PANEL, HEAT / WELD / BEATING / PULL / STRAIGHTEN / ALIGN REAR CHASSIS FRAME BY CHASSIS ALIGNMENT JACK. INCLUSIVE OF THE REPAIR OF REAR BOOT LOCK, REAR BOOT CATCH, REAR BOOT SIDE DOOR HINGE AND REAR END PANEL. }		1,500.00	600.00
	REMOVE AND TRANSFER REAR BOOT NECESSARY ATTACHMENT SPART PART ITEMS. }		-	-
	REMOVE AND TRANSFER REAR BUMPER NECESSARY ATTACHMENT SPART PART ITEMS. }		-	-
	REMOVE AND REFIT REAR BOOT, REAR BOOT EMBLEM, REAR BOOT 'STEPWGN' DESIGNATION, REAR BOT 'SPADA' DESIGNATION, REAR BOOT PROTECTORS, REAR BOOT PROTECTOR TRIM COVERS, REAR BOOT LOCK, REAR BOOT CATCH, REAR BOOT PULL HANDLE, REAR BOOT RUBBER, REAR BOOT SIDE DOOR, REAR BOOT SIDE DOOR WEATHERSTRIP, REAR BOOT SIDE DOOR HINGES, REAR END PANEL TOP GARNISH, REAR END PANEL MOULDING, REAR BUMPER, REAR BUMPER PARKING SENSORS, REAR BUMPER REFLECTORS, REAR RECEIVER SENSOR, REAR BUMPER SIDE RETAINERS. }		-	-
	DIAGNOSTIC AND RESET REAR BUMPER PARKING SENSOR FAULT ERROR BY HHT.		100.00	50.00
	TO CHECK AND REFIT REAR TAIL LAMP WIRING HARNESS.		80.00	20.00
	UNDER COATING ON REAR DAMAGED PORTION.		200.00	60.00
	PUTTY / PRIMER APPLICATION, SPRAY PAINTING REAR BOOT, REAR BOOT PROTECTORS, REAR BOOT SIDE DOOR, REAR BOOT SIDE DOOR HINGES, REAR END PANEL, REAR BUMPERS, REAR BUMPER PARKING SENSORS.		1,800.00	800.00
			3,680.00	1,530.00
	GRAND TOTAL		10,762.40	5,151.20



Page No.:3 of 3

RECOMMENDED COST OF LUMP SUM REPAIRS		4,100.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS/SMR22009647/Kny3e2

KONG SENG CHEONG

**Licensed Appraiser**