

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG22009667/KYA3Q2**Date:** 14/06/2023REFERENCE

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	2100453281
Claimant Vehicle No :	SNC3002T	Insured Vehicle No :	SKZ6608R
Date of Loss:	29/09/2022	Nature of Claim:	TP
		Claim No:	5502259509SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SNC3002T	Engine No:	G4LCKU190572
Make & Model:	HYUNDAI ACCENT (RB), 1.4 CVT (A)	Chassis No:	KMHCU41BT KU470245
Reg. Date:	28/08/2019 (Man. Year: 2019)	Odometer:	50874 km
Colour:	Metallic Grey		
Engine Capacity:	1368 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/60 R15	Rear Tyre Size:	195/60 R15
Front Left Side:	Michelin 8 mm	Rear Left Side:	Michelin 8 mm
Front Right Side:	Michelin 8 mm	Rear Right Side:	Michelin 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	7,788.16	4,173.84	3,614.32	46.41
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,610.00	2,410.00	200.00	7.66
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	10,398.16	6,583.84	3,814.32	36.68
Approved Total (Overridden) (S\$)		5,250.00		
(S\$)	10,398.16	5,250.00	5,148.16	49.51
+ GST 7.00/7.00% (S\$)	727.87	367.50	360.37	49.51
Nett Amount (S\$)	11,126.03	5,617.50	5,508.53	49.51
+ Loss of Use (10.0 x S\$60.00/day) (S\$)		600.00		
+ Doc/Search Fee (S\$)		2.00		
Nett Liability (S\$)		6,219.50		

INSPECTION

Date of Assignment:	30/09/2022		
Date Inspected:	30/09/2022	Inspected At:	Cheng Hoe Motor Pte Ltd (Yishun) Blk 1019 #01-374/382, Yishun Industrial Park A Singapore 768761
Estimated Period of Repair:	9.0 days		

Adjuster: KENNETH KONG**Manager:** Ezlyna

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR BUMPER	Bent	4,430.00 FL	*443.00 FL
2	1		*REAR BUMPER RETAINER LH	Distorted	23.20 FL	*23.20 FL
3	1		*REAR BUMPER RETAINER RH	Distorted	23.20 FL	*23.20 FL
4	6		*REAR BUMPER CLIP	Necessary	21.00 FL	*21.00 FL
5	1		*REAR BUMPER REINFORCEMENT BRACKET	Bent	376.50 FL	*376.50 FL
6	3		*REAR BUMPER UPPER BRACKET	Serviceable	25.50 FL	*- FL
7	1		*REAR BUMPER LOWER BRACKET	O/S Cracked	17.00 FL	*8.50 FL
8	6		*REAR UNDER LOWER COVER CLIP	Necessary	21.00 FL	*21.00 FL
9	1		*REAR BOOT	Bent	1,301.30 FL	*1,301.30 FL
10	1		*REAR BOOT RUBBER	Dented	79.50 FL	*79.50 FL
11	1		*REAR BOOT UPPER LOCK	Dented	166.80 FL	*166.80 FL
12	1		*REAR BOOT HINGE LH	Repair	99.00 FL	*- FL
13	1		*REAR BOOT HINGE RH	Repair	99.00 FL	*- FL
14	1		*REAR BOOT EMBLEM -ACCENT	Necessary	31.20 FL	*31.20 FL
15	1		*REAR BOOT CENTRE EMBLEM	Necessary	27.60 FL	*27.60 FL
16	1		*REAR BOOT INSULATOR	Serviceable	84.80 FL	*- FL
17	8		*REAR BOOT INSULATOR CLIP	Necessary	28.00 FL	*28.00 FL
18	1		*REAR END PANEL	Bent	499.30 FL	*499.30 FL
19	1		*REAR END PANEL INNER TRIM	Mtg Distorted	115.10 FL	*115.10 FL
20	4		*REAR END PANEL INNER TRIM CLIP	Necessary	14.00 FL	*14.00 FL
21	1		*REAR FLOORBOARD PANEL	Bent	433.90 FL	*433.90 FL
22	1		*REAR FLOOR LH TOOL TRAY	Serviceable	86.00 FL	*- FL
23	1		*REAR SPARE TYRE TRAY	Distorted	296.20 FL	*296.20 FL
24	1		*REAR SPARE TYRE HOLD DOWN BOLT	Serviceable	23.10 FL	*- FL
25	2		*REAR PDC SENSOR	Shorted	391.80 FL	*391.80 FL
26	1		*SET REAR PDC SENSOR WIRE HARNESS	Serviceable	105.00 FL	*- FL
27	1		*ANTENA SENSOR	Cracked	80.20 FL	*80.20 FL
28	2		*TAILLAMPS	Cut	653.00 FL	*653.00 FL
29	1		*REAR BOOT CHROME MOULDING	Dented	183.00 FL	*183.00 FL

F=Franchise part. L=ListItemDisc.

Sub Total (\$)	9,735.20	5,217.30
- List Item Discount on L Items 20.00/20.00% (\$)	1,947.04	1,043.46
Total Parts (\$)	7,788.16	4,173.84

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE REAR SEATS ,TRIMS ,COVERING ,BOOT INTERIOR PARTS ,REAR END DAMAGED BODY PARTS ,PANEL BEAT & REPAIR RR FENDERS ,CHASSIS MEMBER CUT ,WELD AND REPLACE DAMAGED PARTS	New	1,300.00	1,200.00
2	TO TRANSFER REVERSE CAMERA AND INSTALL REAR PDC SENSOR	New	50.00	50.00
3	TO RESPRAY PAINTING ON REAR BUMPER ,BOOTLID ,REAR END PANEL ,FLOOR PANEL ,SIDE EXTENSION PANEL,BOTH REAR FENDERS AND ALL ACCIDENT AFFECTED	New	1,200.00	1,100.00
4	RUSTPROOFING	New	60.00	60.00
Gross Labour Cost (\$\$)			2,610.00	2,410.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >