



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

CHINA TAIPING INSURANCE (S) PTE LTD

INV No. AC2304644

3 ANSON ROAD #16-00
SPRINGLEAF TOWER
SINGAPORE 079909

INV Date 19/07/2023
Reference CC6/CTI22009745/Kpa3q2
Code CTI

PROFESSIONAL SERVICE FEE

Vehicle No. SLH 7000U
Insured Veh. YQ 3662J
Claim No. SNM22D206995/C02
Policy No. DMCVSNW00041142201
Accident Date 29/09/2022
Inspection Date 04/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
CHINA TAIPING INSURANCE (S) PTE LTD 3 ANSON ROAD #16-00 SPRINGLEAF TOWERSINGAPORE 079909			Ref: CC6/CTI22009745/Kpa3q2 Date: 19/07/2023 Code: CTI	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	YQ 3662J	Veh. Inspected	SLH 7000U	
Policy No.	DMCVSNW00041142201	Coverage (\$)	0.00	
Claim No.	SNM22D206995/C02	Excess (\$)	0.00	
Assign From		Assign Date	04/10/2022	
2. Vehicle Particulars & Condition				
Make & Model	MERCEDES BENZ GLC 250 (A)	c.c	1991	
Engine No.	HIDDEN	Year of Reg.	2016	
Chassis No.	WDC2539462F099267	Colour	METALLIC BLACK	
Odometer	77727 KM	Steering	IN ORDER	
Brakes	IN ORDER	Modification	STANDARD ALLOY RIM	
General	GOOD			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	235/55 R19	PIRELLI	8 mm	
L/H Front Tyre	235/55 R19	PIRELLI	8 mm	
R/H Rear Tyre	235/55 R19	PIRELLI	8 mm	
L/H Rear Tyre	235/55 R19	PIRELLI	8 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE REAR & FRONT PORTION. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	29/09/2022	Inspection Date	04/10/2022	
Survey held at	OPTIMA WERKZ PTE LTD 10 ANG MO KIO INDUSTRIAL PARK 2A #01-05 AMK AUTOPOINT SINGAPORE 568047			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:			6 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLH 7000U

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	REAR TAILGATE	BENT	2,945.00	2,525.00
1	REAR TAILGATE "GLC250" EMBLEM	NECESSARY	120.00	98.00
1	REAR TAILGATE "4 MATIC" EMBLEM	NECESSARY	150.00	98.00
1	REAR TAILGATE LOGO EMBLEM	NECESSARY	80.00	80.00
1	REAR TAILGATE INNER TRIM BOARD	SERVICEABLE	450.00	-
1	REAR TAILGATE INNER LOCK	DENTED	320.00	320.00
1	REAR TAILGATE WEATHERSTRIP	DISTORTED / DENTED	510.00	383.00
1	REAR TAILGATE LAMP LH	MTG CRACKED	580.00	580.00
1	REAR TAILGATE LAMP RH	MTG CRACKED	580.00	580.00
1	REAR TAIL LAMP LH	SERVICEABLE	580.00	-
1	REAR TAIL LAMP RH	SERVICEABLE	580.00	-
1	REAR BUMPER	BUCKLED	1,100.00	940.00
1	REAR BUMPER LOWER DIFFUSER	BENT	760.00	650.00
1	REAR BUMPER LOWER CHROME MOULDING	CRACKED	500.00	407.00
1	REAR BUMPER TOWING COVER	SERVICEABLE	80.00	-
1	REAR BUMPER SIDE RETAINER LH	CRACKED	190.00	190.00
1	REAR BUMPER SIDE RETAINER RH	DISTORTED	190.00	190.00
1	REAR BUMPER REFLECTOR LH	SERVICEABLE	60.00	-
1	REAR BUMPER REFLECTOR RH	SERVICEABLE	60.00	-
1	REAR BUMPER INNER BRACKET	CRACKED	220.00	220.00
1	REAR EXHAUST CHROME TIP LH	SERVICEABLE	460.00	-
1	REAR EXHAUST CHROME TIP RH	SERVICEABLE	460.00	-
1	REAR END PANEL	TO REPAIR SEE LABOUR	1,500.00	-
1	REAR END PANEL UPPER COVER	SERVICEABLE	380.00	-
1	FRONT BONNET	BENT	2,200.00	1,840.00
1	FRONT BONNET LOGO EMBLEM	NECESSARY	90.00	90.00
1	FRONT GRILLE BASE	CRACKED	280.00	280.00
1	FRONT GRILLE OUTER GARNISH COVER	CRACKED	280.00	280.00
1	FRONT BUMPER	MTG CRACKED	1,900.00	1,359.00

Report Ref No. CC6/CTI22009745/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT BUMPER REINFORCEMENT	TO REPAIR SEE LABOUR	490.00	-
1	FRONT BUMPER ABSORBER FOAM	CRACKED	230.00	171.00
1	FRONT BUMPER NUMBER PLATE GARNISH HOLDER	DENTED	175.00	175.00
1	FRONT BUMPER LOWER GRILLE	SERVICEABLE	190.00	-
1	REAR BUMPER REINFORCEMENT (ADDITIONAL)	BENT	850.00	764.50
1	REAR LOWER DIFFUSER BRACKET LH (ADDITIONAL)	CRACKED	90.00	90.00
1	REAR LOWER DIFFUSER BRACKET RH (ADDITIONAL)	CRACKED	90.00	90.00
2	REAR BUMPER PARKING SENSOR @\$200.00 (ADDITIONAL)	SHORTED	400.00	400.00
	LESS 10% DISCOUNT		-2,012.00	-1,280.05
			18,108.00	11,520.45
	<u>SPECIAL NETT ITEMS</u>			
1	REAR WINDSCREEN SEALANT (SN)	NECESSARY	80.00	40.00
1	REAR TAILGATE INNER TRIM BOARD CLIPS (SN)	NECESSARY	50.00	50.00
1	REAR BUMPER CLIPS (SN)	NECESSARY	60.00	60.00
1	REAR END PANEL JOINT SEALANT (SN)	NOT NECESSARY	80.00	-
1	REAR END PANEL UPPER COVER CLIPS (SN)	NOT NECESSARY	40.00	-
1	REAR NUMBER PLATE & HOLDER (SN)	DENTED	50.00	45.00
1	FRONT BUMPER CLIPS (SN)	NECESSARY	50.00	50.00
1	FRONT NUMBER PLATE & HOLDER (SN)	DENTED	50.00	45.00
1	FRONT GRILLE BASE CLIPS (SN)	NECESSARY	40.00	40.00
			500.00	330.00
	<u>LABOUR</u>			
	LABOUR CHARGES TO REMOVE, REPLACE, REFIX, REPAIR & READJUST REAR ACCIDENT AREAS & ETC. INCLUSIVE OF THE REPAIR OF REAR END PANEL AND FRONT BUMPER REINFORCEMENT.		1,200.00	700.00
	LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR TAILGATE, REAR BUMPER, REAR END PANEL, FRONT BONNET, FRONT BUMPER & ETC.		1,200.00	1,000.00
	LABOUR CHARGES TO REMOVE & REFIX REAR WINDSCREEN GLASS, REAR WINDSCREEN SEALANT & ETC.		150.00	120.00



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR CHARGES TO REMOVE & REINSTALLED REAR TAILGATE INNER MECHANISM & ETC. TO EFFECT REPLACE OF REAR TAILGATE.		120.00	60.00
	TO TUFF KOTE & UNDERSEAL MATERIALS.		120.00	30.00
	TO DIAGNOSIS FAULT CODE & RESET MEMORY.		150.00	100.00
	TO CHECK WIRING & ELECTRICAL SYSTEM.		120.00	40.00
			3,060.00	2,050.00
GRAND TOTAL			21,668.00	13,900.45
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				11,100.00

Report Ref No. CC6/CTI22009745/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLH 7000U

INSPECTION






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

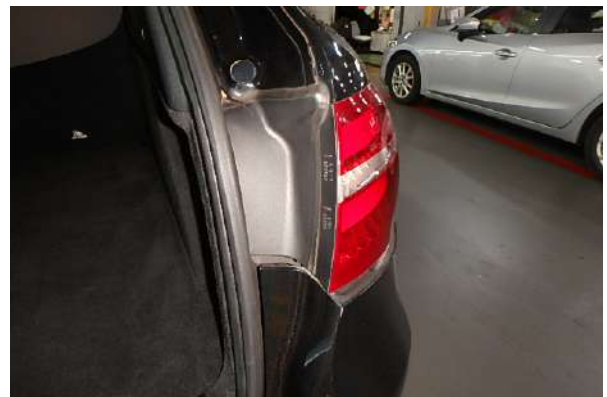



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLH 7000U

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SLH 7000U

RE-INSPECTION

