



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SML 8706C

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
4	REAR REVERSE SENSOR @\$328.20(CONSISTENT)	SHORTED (1 PCS ONLY)	1,312.80	291.60
1	BLIND SPOT SENSOR (CONSISTENT)	SERVICEABLE	434.04	-
1	REAR TAIL LAMP LH (CONSISTENT)	SERVICEABLE	612.00	-
1	REAR TAIL GATE LAMP LH(CONSISTENT)	SERVICEABLE	612.00	-
1	REAR BUMPER LOWER REFLECTOR LH (CONSISTENT)	SERVICEABLE	415.20	-
1	REAR TAILGATE MOULDING (CONSISTENT)	DENTED	484.56	484.56
1	TAILGATE ASSY (CONSISTENT)	TO REPAIR SEE LABOUR	2,618.04	-
1	LETTERING 'RENAULT' REAR M4S(CONSISTENT)	NECESSARY	127.20	127.20
1	EMBLEM 'DIAMOND'(CONSISTENT)	NECESSARY	194.52	194.52
1	LETTERING 'SCENIC'(CONSISTENT)	NECESSARY	161.64	161.64
1	BUMPER REAR GS4 BOSS(CONSISTENT)	BUCKLED	1,200.12	1,200.12
1	REAR BUMPER PAD LOWER (BLACK)(CONSISTENT)	DENTED	714.24	666.36
1	REAR BUMPER LOWER (SIVER)(CONSISTENT)	SERVICEABLE	738.48	-
1	REAR BUMPER REINFORCEMENT (CONSISTENT)	TO REPAIR SEE LABOUR	944.64	-
1	REAR BUMPER SENSOR HARNESS (CONSISTENT)	SERVICEABLE	231.64	-
	LESS 10% DISCOUNT		-	-312.60
			10,801.12	2,813.40
<b><u>SPECIAL NETT ITEMS</u></b>				
1	LICENSE PLATE WITH CASING (SN) (CONSISTENT)	SERVICEABLE	45.00	-
7	BUMPER CLIP @\$7.00 (SN) (CONSISTENT)	NECESSARY	49.00	49.00
10	SET TAILGATE TRIMBOARD CLIP @\$7.00 (SN) (CONSISTENT)	NOT NECESSARY	70.00	-
1	WINDSCREEN SEALANT (SN) (CONSISTENT)	NOT NECESSARY	45.00	-
			209.00	49.00
<b><u>LABOUR</u></b>				
	TO DISMANTLE & REFIX REAR ACCIDENT PORTION ,REAR BUMPER ,TAILGATE ,REAR BUMPER REINFORCEMENT ,REAR END PANEL ,AND ALL THE EFFECTED AREAS .INCLUSIVE OF THE REPAIR OF TAILGATE ASSY AND REAR BUMPER REINFORCEMENT .		1,500.00	400.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO APPLY RUST PROOFING.	NOT NECESSARY	120.00	-
	TO REMOVE & REFIX REVERSE SENSOR & BLINDSPOT SENSOR .		120.00	60.00
	TO CHECK ELECTRIC WIRING FOR PROPER FUNCTION INCLUDING ADJUST OF TAIL LAMP .		120.00	20.00
	TO REMOVE & REFIX REAR WINDSCREEN .	NOT NECESSARY	120.00	-
	TO RESRPAY REAR ACCIDENT PORTION ,REAR BUMPER ,TAILGATE ,REAR END PANEL,AND ALL THE EFFECTED AREAS .		1,200.00	440.00
			3,180.00	920.00
<b>GRAND TOTAL</b>			<b>14,190.12</b>	<b>3,782.40</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>3,000.00</b>

Report Ref No. CC4/ASM22009858/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.