

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/CTI22009979/GQY3M4**Date:** 03/11/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00080052200	
<b>Claimant Vehicle No :</b>	GBE1316H	<b>Insured Vehicle No :</b>	YQ4057A	
Date of Loss:	04/10/2022	Nature of Claim:	TP	Claim No: SNM22D207134/C02/TANCHC

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>GBE1316H</b>		Engine No:	D4CBF763618
Make & Model:	KIA K2500 6M/T, 2.5 D (M)		Chassis No:	KNCSJX76LG7986160
Reg. Date:	04/09/2015 (Man. Year: 2015)		Odometer:	95166 km
Colour:	Blue			
Engine Capacity:	2497 cc			
Market Value/New Car Price:	N/A			
Sum Insured (S\$):	<b>Market Value/New Car Price</b>			

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	195 R15	Rear Tyre Size:	195 R15
Front Left Side:	BLACK ARROW 6 mm	Rear Left Side:	BLACK ARROW 6 mm
Front Right Side:	BLACK ARROW 6 mm	Rear Right Side:	BLACK ARROW 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

**INSPECTION**

Date of Assignment:	10/10/2022	
Date Inspected:	10/10/2022 Inspected At:	Garage 13 Pte Ltd (HQ) 8 Kaki Bukit Ave 4, Premier @ Kaki Bukit, #03-46 Singapore 415875
Estimated Period of Repair:	3.0 days	

**Adjuster:** XING GUO QIANG**Manager:** SHIAU CHAN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,500.00  
-\$2,500.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 03 Nov 2022)	
Parts:	N/A	KIA K2500 6M/T 2.5 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBE1316H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.
---

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >