



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

TAX INVOICE

LONPAC INSURANCE BHD
300 BEACH ROAD
#17-04/07 THE CONCOURSE
SINGAPORE 199555

INV No. AC2302790
INV Date 04/05/2023
Reference CC4/LPC22010153/Kpa3q2
Code LPC2

PROFESSIONAL SERVICE FEE

Vehicle No. SJM 728Y
Insured Veh. GBC 6363Z
Claim No. 21/22/22/VC05/026415
Policy No. Z22VC05014407
Accident Date 13/10/2022
Inspection Date 14/10/2022

Description	Total
Third Party Express Settlement	400.00
Subtotal	400.00
GST (8%)	32.00
Grand Total	432.00

We shall be glad if you could forward the payment at your early convenience.

Cheque should be crossed and made payable to **'LKK Auto Consultants Pte Ltd'**

LKK Auto Consultants Pte Ltd

LKM



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

LONPAC INSURANCE BHD

300 BEACH ROAD

#17-04/07 THE CONCOURSESINGAPORE 199555

Ref: CC4/LPC22010153/Kpa3q2

Date: 04/05/2023

Code: LPC2

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBC 6363Z	Veh. Inspected	SJM 728Y
Policy No.	Z22VC05014407	Coverage (\$)	0.00
Claim No.	21/22/22/VC05/026415	Excess (\$)	0.00
Assign From	GERALD	Assign Date	13/10/2022

2. Vehicle Particulars & Condition

Make & Model	TOYOTA NOAH (A)	c.c	1797
Engine No.	HIDDEN	Year of Reg.	2017
Chassis No.	ZWR800272512	Colour	METALLIC WHITE/BLACK
Odometer	109599 KM	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	205/55 R16	MICHELIN	8 mm
L/H Front Tyre	205/55 R16	MICHELIN	8 mm
R/H Rear Tyre	205/55 R16	MICHELIN	8 mm
L/H Rear Tyre	205/55 R16	MICHELIN	8 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.
DAMAGES SEE DETAILS.

5. General Information

Accident Date	13/10/2022	Inspection Date	14/10/2022
Survey held at	ALAN'S UNITED AUTO PTE LTD BLK 7 SIN MING INDUSTRIAL ESTATE #01-76 SINGAPORE 575642		

5a. Remarks

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **16 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 4

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJM 728Y

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	FRONT WINDSCREEN GLASS	CRACKED	2,159.30	2,159.30
1	FRONT W/S GLASS TOP MOULDING	NECESSARY	85.90	85.90
2	FRONT W/S PILLAR SIDE MOULDING @\$128.70	N/S MTG CRACKED	257.40	128.70
10	W/S PILLAR SIDE MOULDING CLIP @\$11.80	NECESSARY	118.00	118.00
1	FRONT N/S WIPER BLADE	CUT	108.80	108.80
1	FRONT WIPER GARNISH	DENTED	699.10	699.10
2	WIPER GARNISH SIDE COVER @\$88.20	O/S SERVICEABLE / N/S DENTED	176.40	88.20
1	FRT WIPER GARNISH LOWER PANEL	DENTED	689.90	689.90
1	FRONT DASHBOARD	MTG CRACKED	1,980.90	1,980.90
2	FRONT FENDER @\$1138.50	O/S BUCKLED / N/S BENY	2,277.00	2,277.00
2	FRONT FENDER GLASS MOULDING @\$243.50	MLDG NECESSARY	487.00	487.00
2	FRONT FENDER SIDE RETAINER @\$120.50	N/S CRACKED	241.00	120.50
2	FRONT FENDER "HYBRID" EMBLEM @\$68.70	NECESSARY	137.40	137.40
1	FRONT N/S FENDER INNER SHIELD	CRACKED	186.00	186.00
1	BONNET	BENT	944.10	944.10
2	BONNET HINGE @\$68.70	BENT	137.40	137.40
1	BONNET INSULATOR	TORN	375.10	375.10
5	BONNET INSULATOR CLIP @\$3.80	NECESSARY	19.00	19.00
1	BONNET FRONT RUBBER	TORN	34.70	34.70
1	BONNET CHROME	MISSING	538.00	538.00
1	BONNET NOZZLE HOSE	SERVICEABLE	45.10	-
1	BONNET NOZZLE HOSE CLIP	CRACKED	34.80	34.80
1	BONNET STAND CLIP	MISSING	24.50	24.50
1	BONNET INNER LOCK	DISTORTED	131.80	131.80
1	FRONT BUMPER FASCIA	TORN	676.60	676.60
1	FRONT BUMPER SIDE BRACKET	BENT	105.50	105.50
1	FRONT GRILLE - UPPER	CRACKED	1,296.30	1,116.30
1	FRONT GRILLE LOGO	NECESSARY	226.60	226.60
1	FRONT CENTRE GRILLE ASSY	CRACKED	1,221.80	655.10

Report Ref No. CC4/LPC22010153/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	FRONT LOWER GRILLE	SERVICEABLE	183.90	-
1	FRONT BUMPER REINFORCEMENT	BENT	330.20	330.20
1	FRONT BUMPER SPONGE	CRACKED	85.90	85.90
1	FRONT N/S FOGLAMP	BROKEN	516.00	516.00
1	FRONT N/S FOGLAMP COVER	DENTED	188.20	188.20
1	FRONT N/S FOGLAMP BRACKET	BENT	77.80	77.80
2	HEADLAMP ASSY @\$3680.80	O/S MTG CRACKED / N/S BROKEN	7,361.60	7,330.20
2	HEADLAMP GARNISH @\$67.40	N/S MISSING	134.80	67.40
1	N/S HEADLAMP SOCKET HOLDER	SERVICEABLE	368.80	-
1	FRONT SUPPORT PANEL	BENT	1,908.40	1,908.40
2	FRONT SUPPORT SIDE GUIDE @\$54.30	N/S CRACKED	108.60	54.30
1	BRACE PANEL	TO REPAIR SEE LABOUR	101.20	-
1	FRONT N/S WHEEL HOUSING	BENT	1,160.60	1,052.60
1	WHEEL HOUSING PANEL BRACKET (F)	BENT	51.10	51.10
1	RADIATOR ASSY	TWISTED / PUNCTURE	2,469.60	2,469.60
1	N/S RADIATOR STOPPER	MISSING	23.30	23.30
1	RADIATOR FAN COWLING	CRACKED	321.40	321.40
1	RADIATOR FAN MOTOR	SERVICEABLE	794.30	-
1	RADIATOR FAN BLADE	CRACKED	294.70	294.70
1	RADIATOR SPARE TANK	SERVICEABLE	205.90	-
1	RADIATOR TOP HOSE	SERVICEABLE	55.80	-
1	RADIATOR LOWER HOSE	SERVICEABLE	96.80	-
1	AIR CON CONDENSER	TWISTED	1,463.80	1,463.80
1	AIR CON FAN MOTOR	SERVICEABLE	794.30	-
1	AIR CON FAN BLADE	SERVICEABLE	236.20	-
1	INVERTER COOLER	PUNCTURE	1,003.80	1,003.80
1	INVERTER COOLER HOSE	SERVICEABLE	82.50	-
1	INVERTER ASSY	BENT / JAMMED	5,694.00	5,694.00
1	INVERTER COOLANT TANK	DENTED	398.80	398.80
1	INVERTER BRACKET	BENT	121.40	121.40
1	INVERTER COOLANT TANK HOSE	SERVICEABLE	85.30	-



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
1	INVERTER TOP WIRE COVER	DISTORTED	222.30	222.30
1	N/S HORN	DENTED	145.20	145.20
1	N/S FUSE BOX TOP COVER	DENTED	118.50	118.50
1	N/S FUSE ASSY	CRACKED	271.30	271.30
1	N/S FUSE HOLDER	CRACKED	324.70	324.70
1	N/S FUSE LOWER COVER	CRACKED	107.60	107.60
1	RESONATOR TANK	SERVICEABLE	174.50	-
1	AIR CLEANER HOUSING ASSY	CRACKED	1,559.70	1,559.70
	LESS 25% DISCOUNT		-11,264.55	-10,122.10
			33,793.65	30,366.30
	<u>SPECIAL NETT ITEMS</u>			
1	FRONT W/S GLASS SEALANT (SN)	NECESSARY	60.00	40.00
1	ERP BRACKET (SN)	NECESSARY	25.00	25.00
1	FRONT W/S GLASS SOLAR FILM (SN)	NECESSARY	350.00	200.00
1	SET FRONT BUMPER CLIP (SN)	NECESSARY	25.00	25.00
1	RADIATOR COOLANT (SN)	NECESSARY	30.00	30.00
1	INVERTER COOLANT (SN)	NECESSARY	15.00	15.00
1	COOLER OIL (SN)	NECESSARY	10.00	10.00
			515.00	345.00
	<u>LABOUR</u>			
	TO TOWING.		60.00	60.00
	TO REWIRE DAMAGED PARTS AND REFOCUS HEADLAMP BEAM.		120.00	80.00
	TO REMOVE & RENEW FRONT WINDSCREEN GLASS AND CONDUCT WATER LEAK TEST.		150.00	120.00
	TO REMOVE AIR CON CONDENSER, PIPES AND DRIER, VACUUM AND TO RECHARGE GAS.		120.00	100.00
	TO APPLY UNDERSEALING.		100.00	90.00
	TO REMOVE AND RENEW FRONT INSTRUMENT PANEL ASSY, TO REWIRING AND TRANSFER INSTRUMENT FITTINGS.		220.00	220.00
	TO DISMANTLE AND LOWER FRONT UNDERCARRIAGE.		300.00	180.00
	TO CHECK AND ADJUST WHEEL ALIGNMENT.		65.00	60.00
	TO REMOVE AND LIFT UP ENGINE ASSY.		400.00	280.00

Report Ref No. CC4/LPC22010153/Kpa3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:4 of 4

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PUTTY AND SPRAY REPLACED PARTS.		1,800.00	1,400.00
	TO REMOVE, CUT-OUT DAMAGED PARTS, PANEL BEATING, WELDING, ALIGN, REFIX AND TO RENEW ABOVE PARTS. INCLUSIVE OF THE REPAIR OF BRACE PANEL.		2,200.00	1,800.00
	TO REWIRE, DIAGNOSTIC, PROGRAMME, RESET INVERTER SYSTEM.		200.00	200.00
			5,735.00	4,590.00
	GRAND TOTAL		40,043.65	35,301.30
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			28,200.00

Report Ref No. CC4/LPC22010153/Kpa3q2

KONG SENG CHEONG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 728Y

INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

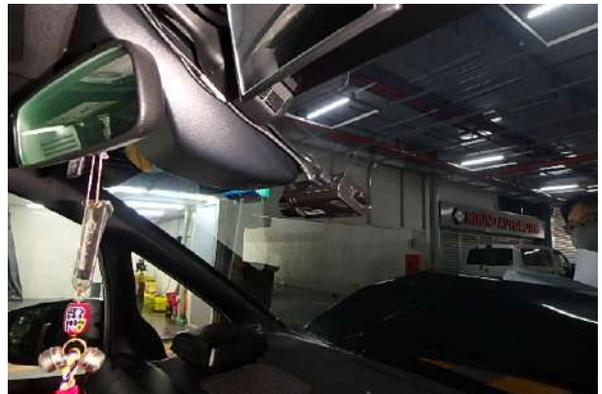



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd


51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 728Y

RE-INSPECTION

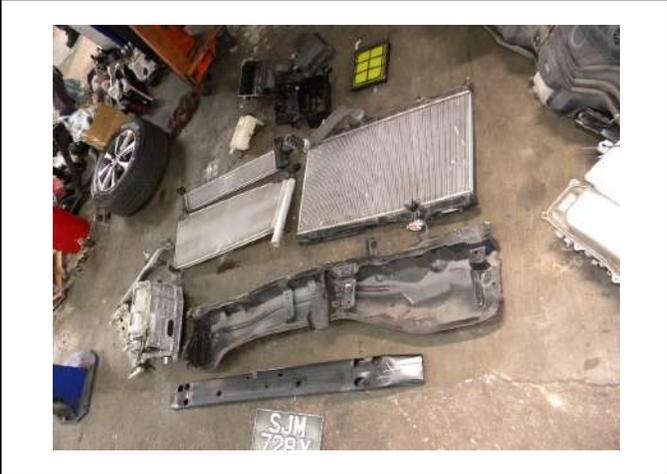



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R






LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

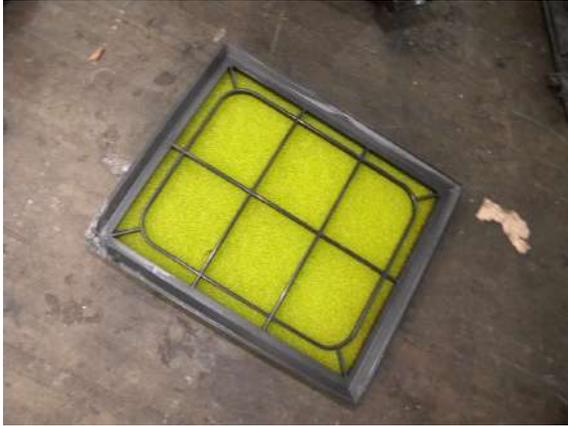



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 728Y

RE-INSPECTION





LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

PHOTOGRAPHS FOR VEHICLE NO. SJM 728Y

RE-INSPECTION

