1/17/23, 11:01 AM Adjuster Report

### LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

## **VEHICLE DAMAGE INSPECTION REPORT**

Our File No:

CS/CTI22010240/KQY3Q2

China Taiping Insurance (Singapore) Pte. Ltd.

3 Anson Road, #16-00 Springleaf Tower

17/01/2023 Date: Singapore 079909

**REFERENCE** 

Insured/Claimant: SSL LIMOUSINE PTE LTD Policy No: DMCVSNW00138232101

Nature of Claim: OD Date of Loss: 10/10/2022 Claim No: SNM22D207316/C01/TOHHS

**DESCRIPTION & IDENTIFICATION OF VEHICLE** 

Reg No: **GBK7775U** 

TOYOTA HIACE, 2.8 D DX (A) 1GD8613892 Make & Model: Engine No: Reg. Date: 30/11/2020 (Man. Year: 2020) Chassis No: GDH2012014363

Colour: Silver Odometer: 0 km

2754 cc **Engine Capacity:** Market Value/New Car Price: S\$87,000.00

Sum Insured (S\$): **Market Value/New Car Price** 

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Footbrake (Serviceable): Yes Yes

**Engine Modification:** Pre-accident Condition: Handbrake (Serviceable): Yes No

CONDITION OF TYRES

Front Tyre Size: 245/40Z R18 Rear Tyre Size: 245/40Z R18 Front Left Side: KAPSEN 6 mm Rear Left Side: KAPSEN 4 mm Front Right Side: KAPSEN 6 mm Rear Right Side: KAPSEN 4 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,730.00	5,245.00	3,485.00	39.92
Miscellaneous Items	0.00	0.00	0.00	
Labour	327.60	163.80	163.80	50.00
Paintwork Labour	422.83	193.58	229.25	54.22
Towing	0.00	0.00	0.00	
Calculated Gross Total (S	\$) 9,480.43	5,602.38	3,878.05	40.91
Approved Total (Overridden) (S	\$)	4,450.00		
- Excess (S	\$) 0.00	1,500.00	-1,500.00	
(S	\$) 9,480.43	2,950.00	6,530.43	68.88
+ GST 7.00/7.00% (S	<b>\$)</b> 663.63	206.50	457.13	68.88
Nett Amount (S	\$) 10,144.06	3,156.50	6,987.56	68.88

INSPECTION

Date of Assignment: 14/10/2022 Present Location: Ding Auto Pte Ltd (HQ)

BLK 10 #01-20 SIN MING IND EST SEC C

SINGAPORE 575645 Date Inspected: 17/10/2022 Inspected At:

Repairer: Ding Auto Pte Ltd (HQ)

Estimated Period of Repair: 6.0 days

SHIAU CHAN Adjuster: KENNETH KONG Manager:

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

### **REPAIR DETAILS**

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 16 Jan 2023)

Parts: 213 TOYOTA HIACE 2.8 D DX (A) (Catalogue:Merimen Singapore 1.0)

**Labour:** Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for GBK7775U)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the

END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk \*.

#### **Recommended Parts**

No. Qty Part No.	Particulars	Condition	Repairer's	Amount
1 1 F=Franchise part.	*TOTAL PARTS		8,730.00 F	*5,245.00 F
r – ranoniso part.		Total Parts (S\$)	8,730.00	5,245.00
	Report was	unsubmitted during this print-out.		

# Recommended Miscellaneous Items

There are no new miscellaneous items selected.

# Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Pair</u>	ntwork Labour			
1	Total Paint Labour	New	310.80	130.20
2	Total Paint Materials	New	112.03	63.38
Lab	our Items			
3	3 Total Panel/Mechanical Labour	New	327.60	163.80
		Gross Labour Cost (S\$)	750.43	357.38
	Report v	was unsubmitted during this print-out.		

< END OF ESTIMATES >