12/6/22, 2:03 PM Adjuster Report

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG22010241/UVY3E2

Date: 06/12/2022

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: 30001929237

Claimant Vehicle COVIDED COVIDE

No: Insured Vehicle No: GBH4883B

Date of Loss: 20/04/2022 Nature of Claim: TP Claim No: 273172

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: SGY8220P

 Make & Model:
 MERCEDES-BENZ E200, 2.0 (A)
 Engine No:
 27186030467369

 Reg. Date:
 13/09/2012 (Man. Year: 2012)
 Chassis No:
 WDD2120482A618331

Colour: Grey Odometer: 40853 km

Engine Capacity: 1796 cc Market Value/New Car Price: N/A

Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 245/40Z R18 Rear Tyre Size: 245/40Z R18
Front Left Side: Michelin 6 mm Rear Left Side: Michelin 6 mm
Front Right Side: Michelin 6 mm Rear Right Side: Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS		Repairer's	Adjuster's	Difference	Diff %
Parts		1,200.50	927.90	272.60	22.71
Miscellaneous Items		0.00	0.00	0.00	
Labour		400.00	300.00	100.00	25.00
Paintwork Labour		0.00	0.00	0.00	
Towing		0.00	0.00	0.00	
	Calculated Gross Total (S\$)	1,600.50	1,227.90	372.60	23.28
	Approved Total (Overridden) (S\$)		950.00		
	Nett Amount (S\$)	1,600.50	950.00	650.50	40.64

INSPECTION

Date of Assignment: 17/10/2022

Date Inspected:

Sin Hwee Motor Pte Ltd (HQ)

Blk 3023A, Ubi Road 1, #01-59

Singapore 408717

Estimated Period of Repair: 2.0 days

Adjuster: MARCUS CHUA Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 27 Oct 2022)

Parts: 143 MERCEDES-BENZ E200 2.0 (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: (Unsubmitted, no print-code for SGY8220P)

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the

END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT CENTER GRILLE	Cracked	1,080.00 FL	*1,031.00 FL
2	1		*NUMBER PLATE GARNISH	Not Necessary	165.00 FL	*-FL
3 F=Fra	1 anchise	part. S=Spci	*NUMBER PLATE AND HOLDER (BENT) Nett. L=ListItemDisc.	Not Consistent With The Impact	80.00 FS	*- FS
		,		Sub Total (S\$)	1,325.00	1,031.00
	- List Item Discount on L Items 10.00/10.00% (S\$)			124.50	103.10	
				Total Parts (S\$)	1,200.50	927.90
			Report was unsubmi	tted during this print-out.		

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount				
Lab	<u>Labour Items</u>							
1	SPRAY PAINT FRONT BUMPER & REPLACED PARTS	New	400.00	300.00				
		Gross Labour Cost (S\$)	400.00	300.00				
Report was unsubmitted during this print-out.								

< END OF ESTIMATES >