

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Allianz Insurance Singapore Pte. Ltd.
79 Robinson Road #09-01
Singapore 068897

Our File No: CS/AIS22010398/UQY3Q2**Date:** 16/11/2022**REFERENCE****Insured/Claimant:** NUR HAFIZAH BTE ABDUL FATTAH**Policy No:** P000010884**Date of Loss:** 14/10/2022**Nature of Claim:** OD**Claim No:** 202222007498**DESCRIPTION & IDENTIFICATION OF VEHICLE****Reg No:** SJY1726H**Make & Model:** TOYOTA WISH, 1.8 (A)**Engine No:** 2ZR0557450**Reg. Date:** 06/08/2010 (Man. Year: 2010)**Chassis No:** ZGE200052591**Colour:** Blue**Odometer:** 205732 km**Engine Capacity:** 1797 cc**Market Value/New Car Price:** S\$60,000.00**Sum Insured (S\$):** **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY****General Condition:** Steering (Serviceable):

Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes**Engine Modification:**

No Pre-accident Condition:

CONDITION OF TYRES**Front Tyre Size:** 205/55 R16**Rear Tyre Size:** 205/55 R16**Front Left Side:** Bridgestone 6 mm**Rear Left Side:** Bridgestone 6 mm**Front Right Side:** Bridgestone 6 mm**Rear Right Side:** Bridgestone 6 mm*The above values represent the remaining tyre treads depth*

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,158.00	3,239.50	918.50	22.09
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,760.00	1,440.00	320.00	18.18
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	5,918.00	4,679.50	1,238.50	20.93
Approved Total (Overridden) (S\$)		3,250.00		
- Excess (S\$)	0.00	2,000.00	-2,000.00	
(S\$)	5,918.00	1,250.00	4,668.00	78.88
+ GST 7.00/7.00% (S\$)	414.26	87.50	326.76	78.88
Nett Amount (S\$)	6,332.26	1,337.50	4,994.76	78.88

INSPECTION**Date of Assignment:** 19/10/2022 **Present Location:**

SME Motor Pte Ltd (Kaki Bukit)

Date Inspected: 20/10/2022 **Inspected At:**

SME Motor Pte Ltd (Kaki Bukit)

1 Kaki Bukit Ave 6 #02-15, AutoBay @ Kaki Bukit

Estimated Period of Repair: 5.0 days

Singapore 417883

Adjuster: MARCUS CHUA**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but*

any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 16 Nov 2022)
Parts:	M1-MPV	TOYOTA WISH 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJY1726H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BUMPER	Distorted	275.00 F	*275.00 F
2	1		*FRT BUMPER RETAINER RH	Cracked	35.00 F	*35.00 F
3	10		*FRT BUMPER CLIP	Necessary	20.00 F	*20.00 F
4	1		*RH HEADLAMP	Cracked	360.00 F	*360.00 F
5	1		*FRT RH FENDER	Distorted	295.00 F	*295.00 F
6	1		*FRT RH FENDER INNER COWLING	Distorted	95.00 F	*95.00 F
7	10		*INNER COWLING CLIP	Necessary	20.00 F	*20.00 F
8	1		*WASHER TANK	Deformed	60.00 F	*60.00 F
9	1		*WASHER TANK MOTOR	Not Necessary	85.00 F	*- F
10	1		*FRT RH SHOCK ABSORBER	Bent	195.00 F	*195.00 F
11	1		*FRT RH LOWER ARM	Bent	145.00 F	*145.00 F
12	1		*FRT RH LOWER ARM BALL JOINT	Twisted	85.00 F	*85.00 F
13	1		*FRT RH KNUCKLE ARM	Bent	210.00 F	*210.00 F
14	1		*FRT RH KNUCKLE BEARING	Damaged	65.00 F	*65.00 F
15	1		*STEERING RACK ASSY (NO STOCK)	Bent / Jammed	800.00 F	*800.00 F
16	1		*STEERING CROSSMEMBER	Serviceable	750.00 F	*- F
17	1		*ANTI ROLL BAR LINK RH	Twisted	75.00 F	*75.00 F
Supplementary #1						
18	1		*FOG LAMP GARNISH RH	Missing	65.00 F	*65.00 F
19	1		*FRT BUMPER INNER SPONGE	Torn	85.00 F	*85.00 F
20	2		*ANTI ROLL BAR BUSH	Torn	60.00 F	*60.00 F

F=Franchise part.

Sub Total (\$\$)	3,780.00	2,945.00
+ Margin on L,N Items 10.00/10.00% (\$\$)	378.00	294.50
Total Parts (\$\$)	4,158.00	3,239.50

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	WIRE CHECKING	New	30.00	20.00
2	REMOVE & REFIX FRT UNDERCARRIAGE (WITH RACK AND CROSSMEMBER)	New	350.00	300.00
3	4 WHEEL ALIGNMENT	New	80.00	70.00
4	LABOUR CHARGE	New	600.00	450.00
5	SPRAY PAINTING	New	700.00	600.00
Gross Labour Cost (\$\$)			1,760.00	1,440.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >