


REC BY: Tauja REF: CC4/111220435/Tp13

ASSIGNMENT

From: _____ Date: _____
Estimated cost: _____
OD / TP / VS / TP RES / OD RES / EVA / INV / MV
To inspect Vehicle No: _____
at Workshop no: _____
of _____
Insured: _____
Policy No: _____
Claims No: _____
Sum Insured: _____ Excess: _____
(Client's Record)
Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

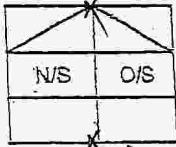

Bal. or Market Value: \$125K
IDAC Accident Report _____ Consistent? : Yes or No
GIA / PR Seen: _____ Consistent? : Yes or No
Est. Repairs: _____ days Res.: Yes or No
Turn Sum: _____ % 3 Val.: Yes or No
CA / REV / REP. / 24 HRS
Date: _____ Person Contacted: _____
Vehicle: IN / OUT

Veh No: SMW 986019 Yr Regn: 2020 / Dec
Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or _____
Make: Mini One 5DR HB C.C. 1499
Colour: White A/C: Insured / Std / Nil / NA
Sp. Reading: 22882 T/Radio: Insured / Std / Nil / NA
Eng/No: _____
C/No: WMWX4520002N70937
Gen. Cond: Good / Fair / Poor / Burnt
Steering: In order / Jammed / Leaked / Burnt or _____
Brake: In order / Jammed / Leaked / Burnt or _____
Modi: Nil / S/Rim / STD A/Rim or _____
Tyre Size: F: 145/55 R16
R: 145/55 R16
BS / DUN / EXNOVA / GY / FS / LZA / MIC / DHTSU / PR / SUMI /
TOYO / YOKO, or Handwash
Front: R/Bal. 6 mm L/Bal. 6 mm D.O.A. _____
Rear: R/Bal. 6 mm L/Bal. 6 mm D.O.L. 21/10/22
Survey held at Eurokars Tg Perum
Des. of Damages: Front / Rear / O/S / N/S / U/C / Rooftop or _____
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction

Date/Time, File Pass to? ☐ : Prel. Report
1) ☐ : Final Report
Date/Time, File Return to?

Days Of Repair: _____
Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$ _____)
☐ : Interview (\$ _____)
☐ : Tech. Invs (\$ _____)
☐ : Weekend (\$ _____)

Survey Fee: _____
Transportation: _____
S + RS. \$ _____
Photos _____
Others _____

Rep. Form: _____
Lump. Sum / L.E.R. /



EUROKARS HABITAT PTE LTD
27A TANJONG PENJURU, SINGAPORE 609042
ESTIMATE COST OF REPAIRS



India International Insurance Pte Ltd 64 Cecil Street #04-05 IOB Building Singapore 04971 ATTN.: MOTOR CLAIMS FAX :	NAME : ADDRESS : TEL :	WIP : 59824 EXCESS : DATE: 18-Oct-22
--	------------------------------	--

VEH NO : SMW9860A	DATE IN :	CONTACT PERSON :	DEREK	63310684
CHASSIS NO : WMWXU520002N78937	MILEAGE :	TYPE OF CLAIM :	THIRD PARTY	
MODEL : MINI One 5 Door RHD	DATE REG. : 21-Dec-20	POLICY NO. :		

NATURE OF WORKS

S/NO	Parts Description	QTY	1ST	SUPP	REVISED	PRICES
1	TAILGATE	1			bt	\$ 1,422.01
2	TAILO GATE WEATHERSTRIP	1			tw	\$ 181.22
3	TAILGATE LOCK	1			X	\$ 151.97
4	COVER LOCK	1		X	X	\$ 24.31
5	STRIKER	1		WM	X	\$ 79.23
6	TRUNK LID GR "NEW LOGO" W/CAM CHROME	1			X	\$ 258.83
7	SUPPORTING LEDGE	1			del	\$ 30.36
8	BLIND RIVET	3			del	\$ 15.21
9	MOUNT RAIL LH	1			del	\$ 28.41
10	MOUNT RAIL RH	1			del	\$ 28.41
11	NUT	2			del	\$ 2.60
12	TAILGATE CHOME MOULDING	1			X un	\$ 108.22
13	EMBLEM "ONE"	1			del	\$ 72.47
14	TAILGATE INNER TRIM	1			del	\$ 187.46
15	REAR BUMPER	1			del	\$ 999.31
16	COVER, TOW LH	1			X un	\$ 50.77
17	COVER, TOW RH	1			del	\$ 50.77
18	REAR BUMPER LOWER SPOILER	1			del	\$ 290.29
19	COVER FOR POWER SOCKET	1			X un	\$ 17.88
20	PDC HOLDER LH	1			del	\$ 56.42
21	PDC HOLDER RH	1			del	\$ 56.42
22	REAR BUMPER CHROME GARNISH	1			del	\$ 117.58
23	BREATHER COVER	1			del	\$ 103.87
24	GUIDE FOR BUMPER LH	1			del	\$ 191.43
25	GUIDE FOR BUMER RH	1			del	\$ 191.43
26	C-CLIP	6			del	\$ 8.58
27	CLIP	4			del	\$ 7.04
28	BLIND RIVET	4			del	\$ 15.60
29	REAR BUMPER REINFORCEMENT	1			del	\$ 609.18

30	WASHER-GASKET FOR REINFORCEMENT	2	B51.12.7.300.789	/		2x1	\$	29.12
31	REAR END PANEL OUTER	1	M41.00.7.387.866	/		2x1	\$	462.35
32	BLINDNIET N3	34	M83.19.0.301.421	/		? 2x1	\$	24.48
33	ADHESIVE K5B 195ML	2	B83.19.5.A59.935	/		? 2x1	\$	919.10
34	MINI CAVITY WAX REMOVER 500ML	2	B83.12.0.390.086	/		? 2x1	\$	47.98
35	CLEANER R1	2	M83.19.2.211.217	/		? 2x1	\$	68.00
36	PUNCH RIVET	53	B83.19.2.457.307	/		? 2x1	\$	38.16
37	BOLT	14	M83.19.0.301.639	/		? 2x1	\$	10.92
38	SEALANT D2	2	B83.42.5.A54.789	/		? 2x1	\$	83.46
39	REAR END PANEL INNER	1	M41.00.7.402.473	/		2x1	\$	315.25
40	REAR VENTILATION	1	M64.22.9.303.806	/		2x1	\$	44.13
41	ULTRASONIC SENSOR OUTER	2	M66.20.9.302.548	/		2x1	\$	1,003.60
42	ULTRASONIC SENSOR INNER	2	B66.20.9.274.428	/		2x1	\$	660.54
43	SENSOR GASKET	4	B66.20.9.283.203	/		2x1	\$	27.56
44	TAIL LIGHT LH	1	M63.21.7.435.133	/		2x1	\$	526.04
45	TAIL LIGHT RH	1	M63.21.7.435.134	/		2x1	\$	526.04
46	CHROME RING LH	1	M63.21.8.495.331	/		2x1	\$	60.32
47	CHROME RING RH	1	M63.21.8.495.332	/		2x1	\$	60.32
48	HEAT INSULATION FOR REAR BUMPER	1	M51.48.7.375.659	/		2x1	\$	91.72
49	REAR FENDER ARCH LH	1	M51.77.7.318.829	/		2x1	\$	153.59
50	REAR FENDER ARCH RH	1	M51.77.7.318.830	/		2x1	\$	153.59
51	BONNET	1	M41.00.8.499.868	/		2x1	\$	1,433.70
52	HINGE RH	1	M41.00.7.370.302	/		2x1	\$	108.42
53	BONNET DAMPER	1	M51.23.7.300.567	/		2x1	\$	138.84
54	CATCH BRACKET	2	M51.23.7.247.080	/	LHX	2x1	\$ 35.13	70.46
55	TWIST PROTECTION	2	M51.23.7.300.579	/	LHX	2x1	\$ 8.52	17.04
56	TRIM RING, HEADLIGHT LH	1	M51.13.7.300.631	/		2x1	\$	92.89
57	TRIM RING, HEADLIGHT RH	1	M51.13.7.300.632	/		2x1	\$	92.89
58	TRIM RING CLIPS	12	M51.13.2.752.145	/		2x1	\$	48.36
59	FRONT BUMPER	1	M51.11.7.379.432	/		2x1	\$	830.96
60	SUPPORT, FOGLAMP LH	1	M51.11.7.302.507	/		2x1	\$	72.73
61	SUPPORT, FOGLAMP RH	1	M51.11.7.302.508	/		2x1	\$	72.73
62	FRONT BUMPER REINFORCEMENT	1	M51.11.7.301.577	/		2x1	\$	457.99
63	FRONT BUMPER SPONGE	1	M51.64.7.301.589	/		2x1	\$	64.61
64	SUPPORT FOR BUMPER	1	M51.11.7.337.802	/		2x1	\$ 27.50	55.00
65	FRONT BUMPER LOWER REINFORCEMENT	1	M51.11.7.301.578	/		2x1	\$	178.29
66	LOWER REINFORCEMENT BRACKET LH	1	M51.11.7.301.587	/		2x1	\$	104.72
67	LOWER REINFORCEMENT BRACKET RH	1	M51.11.7.301.588	/		2x1	\$	104.72
68	REINFORCEMENT BRACKET LH	1	M51.11.7.406.389	/		2x1	\$	123.31
69	REINFORCEMENT BRACKET RH	1	M51.11.7.406.390	/		2x1	\$	123.31
70	FRONT GRILLE	1	M51.13.7.335.529	/		2x1	\$	284.57
71	FRAME FOR GRILLE CHROME	1	M51.13.7.300.589	/		2x1	\$	153.66
72	BUMPER CENTER COVER	1	M51.11.7.337.790	/		2x1	\$	148.07
73	TOWING COVER	1	M51.11.7.302.479	/		2x1	\$	42.64
74	CHROME FRAME LOWER	1	M51.11.7.355.238	/		2x1	\$	136.82
75	AIR INLET FINISHER LH	1	M51.11.7.355.239	/		2x1	\$	91.45

76	FRONT BUMPER LOWER SPOILER	1	M51.11.7.301.622			cut	\$	228.34
77	FRONT BUMPER LOWER GRILLE	1	M51.11.7.337.793			cut	\$	116.42
78	HEADLIGHT, LH	1	M63.11.8.737.595			x	\$	2,728.96
79	HEADLIGHT RH	1	M63.11.8.737.596			x	\$	2,728.96
80	FOGLAMP LH	1	M63.11.7.497.767			x	\$	580.84
81	FOGLAMP RH	1	M63.11.7.497.768			x	\$	580.84
82	CROSSLINK, FRONT	1	B51.64.7.434.544			3+	\$	168.35
83	SUPPORT LEFT	1	M51.64.7.307.873			? x	\$	168.74
84	SUPPORT RIGHT	1	M51.64.7.307.874			? x	\$	168.74
85	V-BRACE BAR	1	M51.64.7.435.400			3+	\$	164.02
86	MINI EMBLEM	1	M51.14.9.447.805			nu	\$	80.53
87	MINI BADGE REAR	1	M51.14.7.481.902			nu	\$	80.14
88	LABEL, COOLANT	1	M71.23.6.992.810			nu	\$	32.50
89		0	0				\$	
TOTAL PARTS							\$	23,539.11
TOTAL PARTS COST							\$	23,539.11

SUPPLEMENTARY

NO	DESCRIPTION	QTY	PARTS NO	1st	Supp	REVISED	PRICES
1							
2							
3							
Labour Description							
1	TO REMOVE & REPLACE TAILGATE, REAR BUMPER, REAR END PANEL & ALL ACCIDENT DAMAGE AREAS ON REAR PORTION. TO REPAIR ALL AREAS AFFECTED BY THE ACCIDENT.	840				4200	\$ 5,880.00
2	TO REMOVE & REPLACE BONNET, FRONT BUMPER, REINFORCEMENT & ALL ACCIDENT DAMAGE AREAS ON FRONT PORTION. TO REPAIR ALL AREAS AFFECTED BY THE ACCIDENT.					3360.	\$ 3,360.00
3	TO RESPRAY DAMAGE AREAS ON REAR PORTION: TAILGATE, REAR BUMPER, REAR END PANEL	800				2400.	\$ 2,600.00
4	TO REPSRAY DAMAGE AREAS ON FRONT PORTION: BONNET, FRT BUMPER					1600.	\$ 1,800.00
5	TO SUPPLY SPRAY TEROSTAT SEALANT ON THE CUTTING AREAS.					250.	\$ 350.00
6	TO CARRY-OUT BODY CAVITY PRESERVATION.					150.	\$ 250.00
7	TO TRANSFER THE TAILGATE MECHANISM.					NETT ✓	\$ 420.00
8	TO REMOVE & REFIT THE REAR WINDSCREEN GLASS.					NETT ✓	\$ 560.00
9	TO SUPPLY SEALER ON THE REAR WINDSCREEN GLASS.					NETT ✓	\$ 120.00

10	TO SUPPLY & INSTALL THE TAILGATE, REAR FENDER LH, BONNET STICKER.		NETT ✓	\$ 375.00
11	TO TRANSFER THE REVERSE SENSORS.		150.	\$ 300.00
12	TO SUPPLY 2 PC NUMBER PLATE WITH CASING.	Front 61	NETT 70	\$ 140.00
13	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		150.	\$ 250.00
14	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		250.	\$ 350.00
15	SUNDRIES.		NETT 30.	\$ 50.00

TOTAL LABOUR	\$ -	\$ 16,805.00
TOTAL PARTS	\$ -	\$ 23,539.11
TOTAL	\$ -	\$ 40,344.11
LESS EXCESS	\$ -	\$ -
TOTAL AFTER EXCESS	\$ -	\$ -
GST 7%	\$ -	\$ -
GRAND TOTAL	\$ -	\$ -

REMARKS:

THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT.

TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A QUOTATION FEE OF \$400.00 WILL BE APPLY AS ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.

Tanpin 92425719 / 62563561 / 67423197
 WP. 21/10/21 @ 1040 14-15 days.
 * P/P Resurvey before paint
 tanpin@lkhauto.com.

- LKK Auto Consultants hence notify the Repairer of the following:
- To resurvey before/after spray painting
 - To display damaged part(s) during resurvey
 - Parts prices are subject to confirmation
 - Third party survey is on a "Without Prejudice" basis
 - No illegal modification(s) is allowed
 - Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

India International Insurance Pte Ltd 64 Cecil Street #04-05 IOB Building Singapore 049711 ATTN. : MOTOR CLAIMS FAX :		NAME : ADDRESS : TEL :		WIP : 59824 EXCESS : DATE: 25-Nov-22	
VEH NO :	SMW9860A	DATE IN :		CONTACT PERSON :	DEREK 63310684
CHASSIS NO :	WMWXU520002N78937	MILEAGE :		TYPE OF CLAIM :	THIRD PARTY
MODEL :	MINI One 5 Door RHD	DATE REG.:	21-Dec-20	POLICY NO. :	
NATURE OF WORKS					
S/NO	Parts Description			REVISED	PRICES
		QTY			
1	CONDENSER AIRCON bt ✓	1	M64.50.9.271.204		\$ 1,271.07
2	AIR DUCT, RIGHT de ✓	1	M51.74.7.301.610		\$ 54.93
3	UPPER FILLER NECK cm ✓	1	M61.66.7.414.868		\$ 41.66
4	NUT nm ✓	4	M51.12.7.046.911		\$ 5.96
5	REAR BUMPER FGOLAMP cm ✓	1	M63.24.6.946.904		\$ 174.13
6		0	0		\$ -
TOTAL PARTS					\$ 1,547.75
TOTAL PARTS COST					\$ 1,547.75
Labour Description					
TOTAL LABOUR				\$ -	\$ -
TOTAL PARTS				\$ -	\$ 1,547.75
TOTAL				\$ -	\$ 1,547.75
LESS EXCESS				\$ -	\$ -
TOTAL AFTER EXCESS				\$ -	\$ -
GST 7%				\$ -	\$ -
GRAND TOTAL				\$ -	\$ -

REMARKS:

THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT.

TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A QUOTATION FEE OF \$400.00 WILL BE APPLY AS ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.