

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22010474/UWY3E2**Date:** 08/11/2022REFERENCEHandling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00003422202

**Claimant Vehicle
No :** SLE2023C**Insured Vehicle
No :** GBJ1074D

Date of Loss: 19/10/2022

Nature of Claim: TP

Claim
No: SNM22D207531/C02/TANCHCDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SLE2023C**

Make & Model: MERCEDES-BENZ CLA180, 1.6 (R18 BI) (A)

Engine No: 27091030941627

Reg. Date: 16/09/2016 (Man. Year: 2016)

Chassis No: WDD1173422N354422

Colour: Silver

Odometer: 86463 km

Engine Capacity: 1595 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 255/40 R18

Rear Tyre Size: 255/40 R18

Front Left Side: Continental 6 mm

Rear Left Side: Continental 6 mm

Front Right Side: Continental 6 mm

Rear Right Side: Continental 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	27,052.10	12,792.10	14,260.00	52.71
Miscellaneous Items	0.00	0.00	0.00	
Labour	5,740.00	2,990.00	2,750.00	47.91
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	32,792.10	15,782.10	17,010.00	51.87
Approved Total (Overridden) (S\$)		12,500.00		
Nett Amount (S\$)	32,792.10	12,500.00	20,292.10	61.88

INSPECTION

Date of Assignment: 26/10/2022

Date Inspected: 21/10/2022 Inspected At:

PROMPT AUTO SOLUTIONS PTE LTD (Premier)
8 KAKI BUKIT AVE 4, #02-37 PREMIER@KAKI BUKIT
Singapore 415875

Estimated Period of Repair: 8.0 days

Adjuster: MARCUS CHUA**Manager:** XinYu*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 08 Nov 2022)
Parts:	143	MERCEDES-BENZ CLA180 1.6 (R18 BI) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLE2023C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BOOTLID	Dented / Buckled	1,532.00 FL	*1,532.00 FL
2	1		*BOOTLID CENTRE EMBLEM	Necessary	78.00 FL	*78.00 FL
3	1		*BOOTLID COROLLA EMBLEM	Necessary	91.00 FL	*91.00 FL
4	1		*BOOTLID LOCK	Bent / Jammed	316.00 FL	*316.00 FL
5	1		*BOOTLID LOCK CATCH	Not Necessary	56.00 FL	*- FL
6	1		*BOOTLID RH HINGE (GARNISH)	Torn	189.00 FL	*145.00 FL
7	1		*BOOTLID LH HINGE (GARNISH)	Torn	189.00 FL	*145.00 FL
8	1		*BOOTLID WEATHERSTRIP	Twisted	389.00 FL	*288.00 FL
9	1		*BOOTLID INNER TRIM	Torn	366.00 FL	*366.00 FL
10	1		*BOOTLID RH NUMBER PLATE LAMP	Not Necessary	78.00 FL	*- FL
11	1		*BOOTLID LH NUMBER PLATE LAMP	Not Necessary	78.00 FL	*- FL
12	1		*REAR BUMPER	Distorted	1,219.00 FL	*1,219.00 FL
			}			
13	1		*REAR BUMPER TOWING COVER }		36.00 FL	*- FL
14	1		*REAR BUMPER LOWER GARNISH	Distorted	313.00 FL	*313.00 FL
15	1		*REAR BUMPER RH CORNER REVERSE SENSOR	Shorted	257.00 FL	*212.00 FL
16	1		*REAR BUMPER RH SIDE REVERSE SENSOR	Shorted	257.00 FL	*212.00 FL
17	1		*REAR BUMPER RH CENTRE REVERSE SENSOR	Shorted	257.00 FL	*212.00 FL
18	1		*REAR BUMPER LH CENTRE REVERSE SENSOR	Shorted	257.00 FL	*212.00 FL
19	1		*REAR BUMPER LH SIDE REVERSE SENSOR	Not Necessary	257.00 FL	*- FL
20	1		*REAR BUMPER LH CORNER REVERSE SENSOR	Not Necessary	257.00 FL	*- FL
21	1		*REAR BUMPER REVERSE SENSOR RUBBER SEAL (6 PCS)	Necessary	41.00 FL	*41.00 FL
22	1		*REAR BUMPER REVERSE SENSOR WIRE HARNESS	Not Necessary	118.00 FL	*- FL
23	1		*REAR BUMPER LOWER TRIM CHROME MOULDING	Cracked	421.00 FL	*421.00 FL
24	1		*REAR BUMPER RH BRACKET	Bent	56.00 FL	*56.00 FL
25	1		*REAR BUMPER LH BRACKET	Bent	56.00 FL	*56.00 FL
26	1		*REAR BUMPER RH SIDE HOLDER	Necessary	43.00 FL	*43.00 FL
27	1		*REAR BUMPER LH SIDE HOLDER	Necessary	43.00 FL	*43.00 FL
28	1		*REAR BUMPER CENTRE BRACKET	Cracked	116.00 FL	*116.00 FL
29	1		*REAR BUMPER RH LOWER BRACKET	Cracked	39.00 FL	*39.00 FL
30	1		*REAR BUMPER LH LOWER BRACKET	Cracked	39.00 FL	*39.00 FL
31	1		*REAR BUMPER RH EXHAUST CHROME COVER	Not Necessary	289.00 FL	*- FL
32	1		*REAR BUMPER LH EXHAUST CHROME COVER	Bent	289.00 FL	*289.00 FL
33	1		*REAR BUMPER REINFORCEMENT	Distorted	790.00 FL	*680.00 FL
34	1		*RH TAILLAMP ASSY	Cracked	832.00 FL	*832.00 FL
35	1		*RH TAILLAMP PANEL	Repair	198.00 FL	*- FL
36	1		*SET RH TAILLAMP LOCK CLIPS	Not Necessary	48.00 FL	*- FL
37	1		*RH TAILLAMP LOWER BRACKET	Not Necessary	46.00 FL	*- FL
38	1		*RH HEADLAMP FRAME SEALING	Not Necessary	69.00 FL	*- FL
39	1		*LH TAILLAMP ASSY	Cracked	832.00 FL	*832.00 FL
40	1		*LH TAILLAMP PANEL	Repair	198.00 FL	*- FL
41	1		*SET LH TAILLAMP LOCK CLIPS	Not Necessary	48.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
42	1		*LH TAILLAMP LOWER BRACKET	Not Necessary	46.00 FL	*- FL
43	1		*LH HEADLAMP FRAME SEALING	Not Necessary	69.00 FL	*- FL
44	1		*END PANEL	Badly Dented	1,012.00 FL	*1,012.00 FL
45	1		*END PANEL INNER GARNISH	Twisted	184.00 FL	*184.00 FL
46	1		*REAR WINDSCREEN GLASS WITH RUBBER SEAL	Not Necessary	1,372.00 FL	*- FL
47	1		*REAR RH FENDER	Repair	2,996.00 FL	*- FL
48	1		*REAR RH FENDER INNER TRIM	Torn	694.00 FL	*694.00 FL
49	1		*REAR RH FENDER SPLASH SHIELD	Not Necessary	189.00 FL	*- FL
50	1		*REAR LH FENDER	Repair	2,996.00 FL	*- FL
51	1		*REAR LH FENDER INNER TRIM	Torn	694.00 FL	*694.00 FL
52	1		*REAR LH FENDER SPLASH SHIELD	Not Necessary	189.00 FL	*- FL
53	1		*REAR SPARE TYRE PANEL	Repair	1,874.00 FL	*- FL
54	1		*REAR SPARE TYRE PANEL INSULATOR	Not Necessary	296.00 FL	*- FL
55	1		*REAR SPARE TYRE TOP COVER BOARD	Warped	567.00 FL	*567.00 FL
56	1		*EXHAUST SILENCER	Not Necessary	1,393.00 FL	*- FL
57	1		*EXHAUST SILENCER GASKET	Not Necessary	73.00 FL	*- FL
58	2		*EXHAUST SILENCER RUBBER MOUNTINGS	Not Necessary	86.00 FL	*- FL
59	1		*DRIVE SEAT BELT	Activated	733.00 FL	*665.00 FL
60	1		*DRIVE SEAT BELT BUCKLE	Not Necessary	156.00 FL	*- FL
61	1		*FRONT LH PASSENGER SEAT BELT	Activated	733.00 FL	*665.00 FL
62	1		*FRONT LH PASSENGER SEAT BELT BUCKLE	Not Necessary	156.00 FL	*- FL
63	1		*REAR RH PASSENGER SEAT BELT	Activated	733.00 FL	*430.00 FL
64	1		*REAR RH PASSENGER SEAT BELT BUCKLE	Not Necessary	156.00 FL	*- FL
65	1		*REAR LH PASSENGER SEAT BELT	Activated	733.00 FL	*430.00 FL
66	1		*REAR LH PASSENGER SEAT BELT BUCKLE	Not Necessary	156.00 FL	*- FL
67	1		*BOOTLID C&C EMBLEM	Necessary	80.00 FS	*40.00 FS
68	1		*SET BOOTLID INNER TRIM CLIPS	Not Necessary	80.00 FS	*- FS
69	1		*REAR WINDSCREEN GLASS SEALANT	Not Necessary	70.00 FS	*- FS
70	1		*REAR WINDSCREEN GLASS INNER SEAL	Not Necessary	50.00 FS	*- FS
71	1		*SET REAR RH FENDER INNER TRIM CLIPS	Not Necessary	80.00 FS	*- FS
72	1		*SET REAR RH FENDER SPLASH SHIELD CLIPS	Not Necessary	60.00 FS	*- FS
73	1		*SET REAR LH FENDER INNER TRIM CLIPS	Not Necessary	80.00 FS	*- FS
74	1		*SET REAR LH FENDER SPLASH SHIELD CLIPS	Not Necessary	60.00 FS	*- FS
75	1		*SET END PANEL INNER GARNISH CLIPS	Not Necessary	60.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	29,989.00	14,209.00
- List Item Discount on L Items 10.00/10.00% (\$\$)	2,936.90	1,416.90
Total Parts (\$\$)	27,052.10	12,792.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR CHARGE ON AFFECTED AREAS AND REPLACED PARTS AS LISTED	New	1,800.00	1,200.00
2	RE-SPRAY AFFECTED AREAS AND PARTS	New	1,600.00	1,100.00
3	CHECK WIRING AND LIGHTING SYSTEM	New	100.00	30.00
4	APPLY ANTI RUST CHEMICAL COATING	New	180.00	60.00
5	REMOVE AND REPLACE REAR WINDSCREEN GLASS AND SEALANT	New	240.00	0.00
6	REMOVE AND REFIT FUEL TANK PIPES ,HOSES AND SENSOR TO REPAIR	New	200.00	0.00
7	TO REMOVE AND REPLACE REAR BUMPER REVERSE SENSORS TO REPAIR	New	100.00	50.00
8	REMOVE AND REPLACE ROOF LINING ,GARNISH ,TRIMS ,SEAT AND BOARDS TO REPAIR	New	550.00	100.00
9	REMOVE AND REPLACE EXHAUST SILENCER ,GASKET AND RUBBER MOULDING TO REPAIR	New	200.00	0.00
10	REMOVE AND REPLACE FRONT AND REAR SEAT BELTS AND BUCKLES TO REPAIR	New	320.00	250.00
11	CONDUCT DIAGNOSE AND RESET ELECTRONIC CONTROL SYSTEM	New	450.00	200.00
Gross Labour Cost (\$\$)			5,740.00	2,990.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >