

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS/CTI22010554/KNY3Q2**Date:** 05/12/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNA00116502202
<b>Claimant Vehicle No :</b>	SLT4402A	<b>Insured Vehicle No :</b>	GBG4923A
Date of Loss:	21/10/2022	Nature of Claim:	TP
		Claim No:	SNM22D207582/C02/TOHHS

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No:	<b>SLT4402A</b>		
Make & Model:	KIA NIRO, 1.6 HYBRID GDI DCT SUNROOF (A)	Engine No:	G4LEHS158861
Reg. Date:	30/10/2017 (Man. Year: 2017)	Chassis No:	KNACC81CVH5087726
Colour:	Metallic Red	Odometer:	93156 km
Engine Capacity:	1580 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	<b>Market Value/New Car Price</b>		

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Giti 8 mm	Rear Left Side:	Yokohama 4 mm
Front Right Side:	Giti 8 mm	Rear Right Side:	Yokohama 4 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	9,277.40	2,287.00	6,990.40	75.35
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,500.00	810.00	1,690.00	67.60
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (\$\$)</b>	<b>11,777.40</b>	<b>3,097.00</b>	<b>8,680.40</b>	<b>73.70</b>
<b>Approved Total (Overridden) (\$\$)</b>		<b>2,400.00</b>		
<b>(\$\$)</b>	11,777.40	2,400.00	9,377.40	79.62
<b>+ GST 7.00/7.00% (\$\$)</b>	824.42	168.00	656.42	79.62
<b>Nett Amount (\$\$)</b>	<b>12,601.82</b>	<b>2,568.00</b>	<b>10,033.82</b>	<b>79.62</b>

**INSPECTION**

Date of Assignment:	26/10/2022	
Date Inspected:	28/10/2022 Inspected At:	Fulco Autocare Pte Ltd (HQ) 176 SIN MING DRIVE #03-02 SIN MING AUTOCARE Singapore 575721
Estimated Period of Repair:	3.0 days	

**Adjuster:** KENNETH KONG**Manager:** HUEY YON

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

## REPAIR DETAILS

### Reference

<b>Part Source:</b>	(Last Synchronised: 05 Dec 2022)	
<b>Parts:</b>	N/A	KIA NIRO 1.6 HYBRID GDI DCT SUNROOF (A) (Model not available in database)
<b>Labour:</b>	Repairer's	(Price-denominated Standard List)
<b>Print Code:</b>	(Unsubmitted, no print-code for SLT4402A)	
<b>Validity:</b>	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
<b>Further Info:</b>	Items/values not in reference catalogue are prefixed with an asterisk *.	

### Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Repair	1,183.00 FL	*- FL
2	1		*BONNET LOCK	Repair	139.00 FL	*- FL
3	1		*BONNET BOTTOM LOCK ASSY	Repair	58.00 FL	*- FL
4	1		*BONNET LOCK SENSOR	Serviceable	139.00 FL	*- FL
5	1		*FRONT FENDER O/S	Repair	620.00 FL	*- FL
6	1		*FRONT FENDER COWLING O/S	Serviceable	189.00 FL	*- FL
7	1		*HEADLAMP O/S	Cut	2,996.00 FL	*904.00 FL
8	1		*HEADLAMP LOWER BRACKET O/S	Serviceable	168.00 FL	*- FL
9	1		*FRONT BUMPER	Cracked	986.00 FL	*688.00 FL
10	1		*FRONT BUMPER TOP PANEL	Serviceable	475.00 FL	*- FL
11	1		*FRONT BUMPER TOP PANEL KIA EMBLEM	Necessary	76.00 FL	*76.00 FL
12	1		*FRONT BUMPER SIDE RETAINER	O/S Distorted	96.00 FL	*48.00 FL
13	2		*FRONT BUMPER BRACKET	Repair	88.00 FL	*- FL
14	1		*FRONT BUMPER GRILLE	Serviceable	457.00 FL	*- FL
15	1		*FRONT BUMPER GRILLE CHROME MOULDING	Serviceable	189.00 FL	*- FL
16	1		*FRONT BUMPER LOWER GRILLE	Buckled	294.00 FL	*131.00 FL
17	1		*FRONT BUMPER SIDE VENT O/S	Serviceable	193.00 FL	*- FL
18	1		*FOG LAMP O/S	Mtg Cracked	412.00 FL	*388.00 FL
19	1		*FOG LAMP SILVER MOULDING O/S	Dented	232.00 FL	*121.00 FL
20	1		*FRONT BUMPER TOWING CAP	Serviceable	68.00 FL	*- FL
21	1		*FRONT BUMPER SPONGE	Cracked	118.00 FL	*68.00 FL
22	1		*FRONT BUMPER REINFORCEMENT	Repair	389.00 FL	*- FL
23	1		*FRONT BUMPER LOWER SKIRT	Serviceable	280.00 FL	*- FL
24	1		*FOG LAMP COVER O/S	Mtg Distorted	121.00 FL	*56.00 FL
25	10		*BONNET INSULATOR CLIPS	Not Necessary	55.00 FS	*- FS
26	8		*FRONT FENDER COWLING CLIPS O/S	Not Necessary	44.00 FS	*- FS
27	10		*FRONT BUMPER CLIPS	Necessary	55.00 FS	*55.00 FS
28	8		*ENGINE UNDER COWLING CLIPS	Not Necessary	44.00 FS	*- FS
29	1		*RADIATOR COOLANT	Not Necessary	60.00 FS	*- FS
30	1		*SUNDRIES	Not Necessary	50.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

<b>Sub Total (\$\$)</b>	<b>10,274.00</b>	<b>2,535.00</b>
<b>- List Item Discount on L Items 10.00/10.00% (\$\$)</b>	996.60	248.00
<b>Total Parts (\$\$)</b>	<b>9,277.40</b>	<b>2,287.00</b>

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b>Labour Items</b>				
1	TO DISMANTLE /RENEW ACCIDENT DAMAGED PORTIONS .TO PANEL BEAT ,RESHAPE ,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS	New	1,200.00	350.00
2	TO DISCONNECT FRONT WIRE HARNES OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS ,RECONNECT AND CHECK FUNCTIONS INCLUDING FOCUSING HEADLAMPS	New	50.00	20.00
3	TO REMOVE AND REFIT RADIATOR TO FACILITATE REPAIR .TO PERFORM PRESSURE TEST AND CHECK COOLING SYSTEM FUNCTIONALITY	New	150.00	0.00
4	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA /PANEL	New	1,000.00	440.00
5	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR	New	100.00	0.00
<b>Gross Labour Cost (\$)</b>			<b>2,500.00</b>	<b>810.00</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >