WG APPRAISAL SERVICES

Blk 224B, Compassvalve Walk, #07-647, Singapore 542224 Email: winsongkk@hotmail.com Contact: 9747 0063 Company Register No. 53326249J

ACCIDENT DAMAGED VEHICLE INSPECTION REPORT

M/S: ONG HOON YONG DESMOND C/O D'S GRAFFITI CONCEPTS

> 50 Serangoon North, Avenue 4, #02-19 First Centre, Singapore 555856

Date Our Ref 22 September 2022

#WG/TP/2022-242

REFERENCE PARTICULARS

Date of Accident : 11 September 2022 Date of Inspection : 12 September 2022 Type of Inspection

Third Party Claim

Date of Re-Inspn

14 September 2022

VEHICLE PARTICULARS

Registration No : SKX171H : HONDA Make

Model

: CIVIC 1.5 TURBO VTIS SR

: 2016

Engine No

£L15B71624843

Chassis No

MRHFC1660GT000103

Odometer

: 165065km

Colour

Red

CONDITION OF VEHICLE (STATIC CHECKS AT TIME OF INSPECTION ONLY)

Engine condition | Good

Foot Brake Hand Brake

Rear off Side

Year

: Serviceable : Serviceable

General Body Work Good

Steering

Thread Balance

: Serviceable Serviceable

Lightings

TYRE CONDITION (Remaining estimated life of tyre in mm)

Make Goodyear Front Near side Goodyear 3 Front Off Side Rear Near Side

Goodyear Goodyear

Size 235/45R17 235/45R17 235/45R17 235/45R17

5 mm 5 mm

> 5 mm 5 mm

GENERAL DESCRIPTION OF DAMAGES

The vehicle sustained damage at the rear portions. For details, refer to assessment for repairs and photographs attached.

ASSESSMENT SUMMARY

Our assessment of the repair costs to pre-accident condition was \$\$5,750.00 nett at lump sum basis.(Subject to GST if applicable)

Under normal circumstances, estimated period required for repairs: Five (05) working days.

Enclosed Eighty-Eight (88) photographs depicting damage to the vehicle,

Inspection conducted at : D'S GRAFFITI CONCEPTS

50 Serangoon North, Avenue 4, #02-19, First Centre, Singapore 555856

In accordance to your instruction, we have not authorise repairs and inspection was conducted strictly on a "WITHOUT PREJUDICE BASIS".

Our Ref : WG/TP/2022-242

4,045.75

4,297.25 \$

VEHICLE NO: SKX171H

MODEL : CIVIC 1.5 TURBO VTIS SR

ASSESSMENT OF REPAIRS AND SPARE PARTS COSTS

DESCRIPTION OF PARTS AND NATURE OF REPAIRS

DUO		QTY	ASSESSED		ORIGINAL		REVISED
A)	SPARE PARTS	PC/SET	CONDITION		QUOTATION	Q	UOTATION
01	REAR BUMPER	1	CRACKED		\$ 717.00	\$	717.00
02	REAR BUMPER REINFORCEMENT	1	DENTED		\$ 368.00	\$	368.00
03	REAR BUMPER RETAINER LH	1	CRACKED		\$ 48.00	\$	48.00
04	REAR BUMPER RETAINER RH	1	CRACKED		\$ 48.00	\$	48.00
05	REAR BUMPER BRACKET LH	1	CRACKED		\$ 58.00	\$	58.00
06	REAR BUMPER BRACKET RH	1	CRACKED		\$ 58.00	\$	58.00
07	REAR REFLECTOR WITH COVER LH	1	NOT NECESSARY		\$ 165.00	\$:#0
08	REAR REFLECTOR WITH COVER RH	1	CRACKED		\$ 165.00	\$	165.00
09	REAR BUMPER INNER GRILLE LH	1	NOT NECESSARY		\$ 117.00	\$	1.00
10	REAR BUMPER INNER GRILLE RH	1	CRACKED		\$ 117.00	\$	117.00
11	REAR BUMPER FIN LH	1	CRACKED		\$ 85.00	\$	85.00
12	REAR BUMPER FIN RH	1	CRACKED		\$ 85.00	\$	85.00
13	BOOTLID LOCK	1	JAMMED		\$ 185.00	\$	185,00
14	REAR LOCK SENSOR	1	CRACKED		\$ 255.00	\$	255.00
15	ANTHENA SENSOR	1	MALFUNCTION		\$ 290.00	\$	290.00
16	REAR DISTANCE SENSOR	4	MALFUNCTION		\$ 900.00	\$	900.00
17	SENSOR COVER	1	NECESSARY		\$ 120.00	\$	120.00
18	BOOTLID WEATHERSTRIP	1	DEFORMED		\$ 85_00	\$	85.00
19	END PANEL	1	DENTED		\$ 514.00	\$	514.00
20	END PANEL TOP GANRISH	1	DEFORMED		\$ 119,00	\$	119.00
21	REAR TAILLAMP LH	1	CRACKED		\$ 482.00	\$	482.00
22	REAR TAILLAMP RH	1	CRACKED		\$ 482.00	\$	482.00
					\$ 5,463.00	\$	5,181.00
				Less 25%	\$ 1,365.75	\$	1,295.25
					\$ 4,097.25	\$	3,885.75
B)	S/NETT ITEM REAR BUMPER CLIP	1 SET	NECESSARY		\$ 50.00	\$	40.00
23 24	JOINT SEALANT	1	NECESSARY		\$ 150,00	\$	120.00
24	JOINI SEALAINI	1	1120255121	[P	\$ 200.00	\$	160.00
				9			

Parts Total:

	Total Parts and Laboure:	\$	7,837.25	\$	7,185.75
	Labour Total:		5,5 10100		
APPLY ANTI RUST ON AFFECTED AREAS	Lobour Total		3,540,00	S	3,140.00
		\$	120.00	\$	100.00
	MUNOTIMED	\$	1,500.00	\$	1,400.00
			1,400.00	\$	1,200.00
		\$	150.00	\$	130.00
		\$	120.00	\$	100.00
		\$	150.00	\$	120.00
		\$	100.00	\$	90.00
	LABOUR CHARGES & MISC CHECK REAR WIRING AND LIGHTNING SYSTEM REMOVE, REFIT REAR LINING, TIRM AND GARNISH REMOVE AND RENEW REAR REVERSE SENSOR REMOVE AND STRAIGHTEN REAR EXHAUST PANEL BEATING ON AFFECTED AREAS AND RENEW DA SPRAY PAINTING ON AFFECTED AREAS APPLY ANTI RUST ON AFFECTED AREAS	CHECK REAR WIRING AND LIGHTNING SYSTEM REMOVE, REFIT REAR LINING, TIRM AND GARNISH REMOVE AND RENEW REAR REVERSE SENSOR REMOVE AND STRAIGHTEN REAR EXHAUST PANEL BEATING ON AFFECTED AREAS AND RENEW DAMAGE PARTS SPRAY PAINTING ON AFFECTED AREAS APPLY ANTI RUST ON AFFECTED AREAS Labour Total:	CHECK REAR WIRING AND LIGHTNING SYSTEM REMOVE, REFIT REAR LINING, TIRM AND GARNISH REMOVE AND RENEW REAR REVERSE SENSOR REMOVE AND STRAIGHTEN REAR EXHAUST PANEL BEATING ON AFFECTED AREAS AND RENEW DAMAGE PARTS SPRAY PAINTING ON AFFECTED AREAS APPLY ANTI RUST ON AFFECTED AREAS Labour Total: \$	CHECK REAR WIRING AND LIGHTNING SYSTEM REMOVE, REFIT REAR LINING, TIRM AND GARNISH REMOVE AND RENEW REAR REVERSE SENSOR REMOVE AND STRAIGHTEN REAR EXHAUST PANEL BEATING ON AFFECTED AREAS AND RENEW DAMAGE PARTS SPRAY PAINTING ON AFFECTED AREAS APPLY ANTI RUST ON AFFECTED AREAS Labour Total: \$ 100.00 \$ 120.00 \$ 1400.00 \$ 120.00 \$ 120.00 \$ 120.00	CHECK REAR WIRING AND LIGHTNING SYSTEM REMOVE, REFIT REAR LINING, TIRM AND GARNISH REMOVE AND RENEW REAR REVERSE SENSOR REMOVE AND STRAIGHTEN REAR EXHAUST PANEL BEATING ON AFFECTED AREAS AND RENEW DAMAGE PARTS SPRAY PAINTING ON AFFECTED AREAS APPLY ANTI RUST ON AFFECTED AREAS Labour Total: \$ 100.00 \$ \$ 120.00 \$ \$ 1,400.00 \$ \$ 1,500.00 \$ \$ 2,000 \$ \$ 3,540.00 \$ \$ 3,540.00 \$

POINT OF IMPACT

The impact was confined to the rear portion of the vehicle.

FINAL LUMP SUM ADJUSTMENT

The damages appeared to be consistent as per the accident report statement.

Please refer the attached schedule and photographs for details.

ADJUSTMENT/RECOMMENDATIONS

We have thoroughly inspected each and every item on the repairer's estimates against the actual damaged found on the vehicle. We have listed the breakdown of our findings and recommendations as per assessment above.


CONCLUSION

The repairer has agreed to undertake repair the vehicle at a lump sum basis of \$\$5,750.00 nett corresponding to replacement of parts, spray painting and labour charges. We now revert for your decision on the above claim.

Yours faithfully WG APPRAISAL SER

Winson Gon Automotive Appraiser



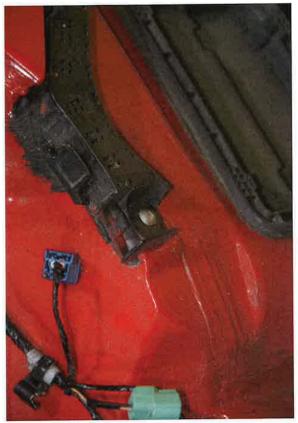





Section of the













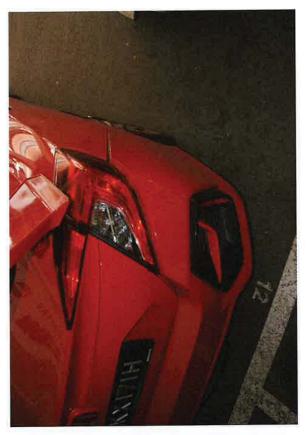






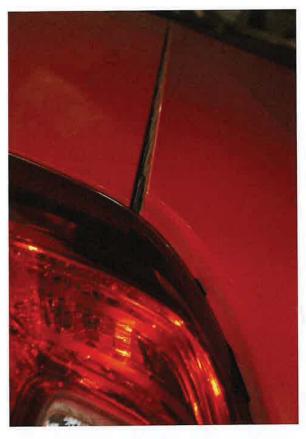



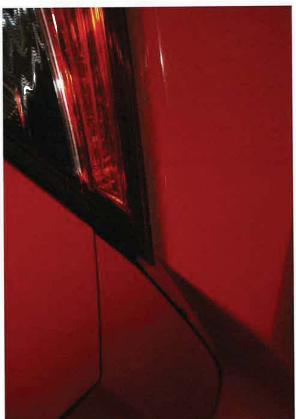






B. 17. 14. 1





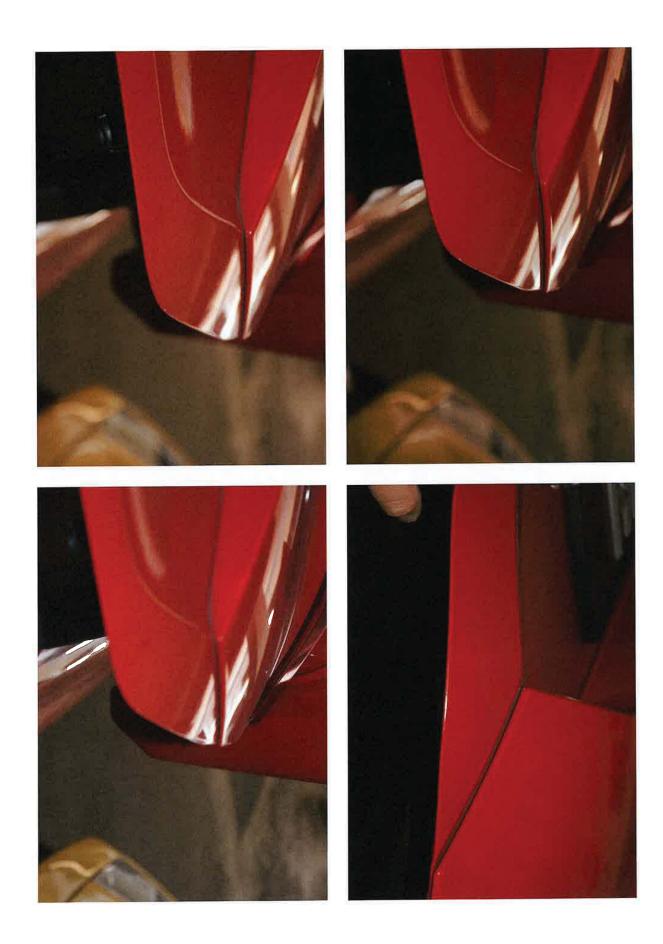













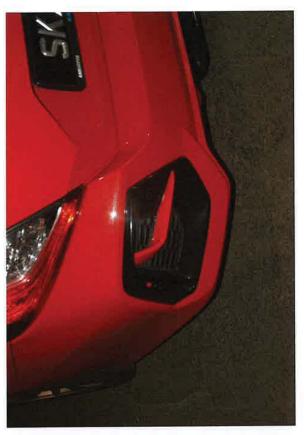


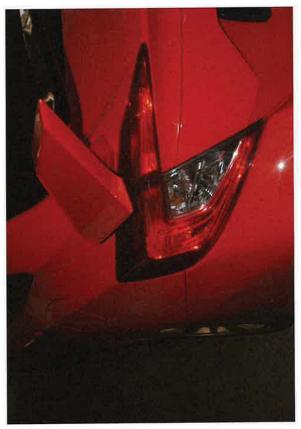

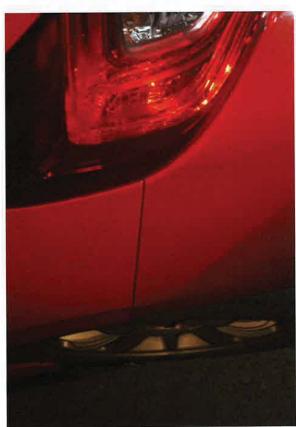

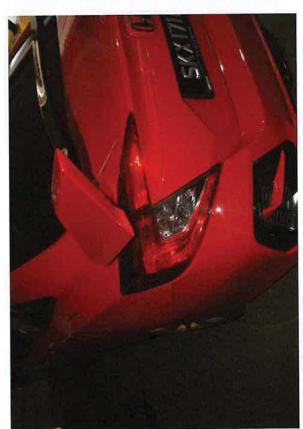

The state of the s

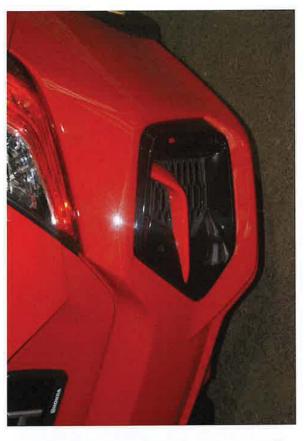















ì





相同を

















