

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

AIG Asia Pacific Insurance Pte. Ltd.
AIG Building, 78 Shenton Way, #09-16
Singapore 079120

Our File No: CC3/AIG22010756/AVCM4**Date:** 01/03/2023**REFERENCE**

Insured/Claimant:	CHIANG FOCK PONG	Policy No:	1700086735	
Date of Loss:	27/10/2022	Nature of Claim:	OD	Claim No: 2743566694SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLU5988P		
Make & Model:	AUDI Q2, 999cc 1.0 TFSI S TRONIC (A)	Engine No:	CHZ594541
Reg. Date:	07/12/2017 (Man. Year: 2017)	Chassis No:	WAUZZZGA6JA040009
Colour:	White	Odometer:	109603 km
Engine Capacity:	999 cc		
Market Value/New Car Price:	S\$87,000.00		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/60 R16	Rear Tyre Size:	215/60 R16
Front Left Side:	Bridgestone 6 mm	Rear Left Side:	Bridgestone 6 mm
Front Right Side:	Bridgestone 6 mm	Rear Right Side:	Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,552.00	4,882.40	9,669.60	66.45
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,152.00	2,152.00	2,000.00	48.17
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	18,704.00	7,034.40	11,669.60	62.39
- Excess (\$\$)	500.00	500.00	0.00	0.00
(\$\$)	18,204.00	6,534.40	11,669.60	64.10
+ GST 8.00/8.00% (\$\$)	1,456.32	522.75	933.57	64.10
Nett Amount (\$\$)	19,660.32	7,057.15	12,603.17	64.10

INSPECTION

Date of Assignment:	31/10/2022	
Date Inspected:	28/10/2022	Inspected At: Premium Automobiles Pte Ltd (UBI) 55 Ubi Road 1 Singapore 408699
Estimated Period of Repair:	4.0 days	

Adjuster: ADRIAN LING**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	2,430.00 FS	*1,654.00 FS
2	1		*FRONT BUMPER GRILLE - CENTER	Deformed	220.00 FS	*175.60 FS
3	1		*FRONT BUMPER AIR GUIDE GRILLE - LH / RH	O/s Cut	378.00 FS	*151.20 FS
4	2		*FRONT BUMPER END CAP - LH / RH	Not Necessary	132.00 FS	*- FS
5	1		*FRONT BUMPER SPOILER	Deformed	332.00 FS	*265.60 FS
6	1		*FRONT BUMPER CLOSING ELEMENT	Not Necessary	174.00 FS	*- FS
7	2		*FRONT WHEEL SPOILER - LH / RH	Not Necessary	76.00 FS	*- FS
8	2		*FRONT BUMPER ADAPTER - LH / RH	Not Necessary	88.00 FS	*- FS
9	1		*RADIATOR GRILLE	Cracked	1,561.00 FS	*1,248.80 FS
10	1		*RADIATOR GRILLE STRIKER PLATE	Not Necessary	138.00 FS	*- FS
11	1		*FRONT BUMPER REINFORCEMENT BEAM	Dented	769.00 FS	*614.80 FS
12	1		*FRONT BUMPER FOAM FILLER PIECE	Not Necessary	87.00 FS	*- FS
13	1		*FRONT BUMPER TOP COVER	Deformed	112.00 FS	*89.60 FS
14	2		*FRONT BUMPER GUIDE SECTION - LH / RH	Not Necessary	80.00 FS	*- FS
15	1		*FRONT BUMPER DISTANCE PIECE	Not Necessary	16.00 FS	*- FS
16	1		*CAUTION SIGN STICKER	Necessary	16.00 FS	*12.40 FS
17	1		*AIR CONDITIONER STICKER	Necessary	9.00 FS	*6.64 FS
18	1		*FRONT WHEEL HOUSING LINER - RH	Not Necessary	213.00 FS	*- FS
19	1		*HORN HIGH TONE - RH	Not Necessary	181.00 FS	*- FS
20	1		*HORN BRACKET - RH	Not Necessary	35.00 FS	*- FS
21	1		*HEADLIGHT MOUNTING	Not Necessary	132.00 FS	*- FS
22	1		*HEADLIGHT - RH	Not Necessary	5,245.00 FS	*- FS
23	1		*HEADLIGHT MOUNTING	Not Necessary	132.00 FS	*- FS
24	1		*LIFT CYLINDER - RH	Not Necessary	156.00 FS	*- FS
25	1		*LIFT CYLINDER HOSE	Not Necessary	204.00 FS	*- FS
26	1		*RADIATOR AIR GUIDE - RH	Torn	35.00 FS	*27.76 FS
27	1		*RADIATOR OUTER SEAL - RH	Not Necessary	8.00 FS	*- FS
28	1		*RADIATOR AIR GUIDE - UPPER CENTRE	Not Necessary	25.00 FS	*- FS
29	1		*RADIATOR AIR GUIDE - LH	Not Necessary	35.00 FS	*- FS
30	1		*NOISE INSULATION	Not Necessary	353.00 FS	*- FS
31	2		*FRONT WHEEL COVER - LH / RH	Necessary	720.00 FS	*576.00 FS
32	1		*FRONT NO PLATE	Dented	60.00 FS	*60.00 FS
33	1		*SUNDRIES	Not Necessary	400.00 FS	*- FS

F=Franchise part. S=SpcNett.

Total Parts (S\$) 14,552.00 4,882.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE, CHECK AND TRANSFER FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY	New	360.00	360.00
2	TO REMOVE AND TRANSFER RHS HEADLIGHTS CONTROL UNIT AND POWER MODULE	New	400.00	0.00
3	TO DISMANTLE AND RENEW FRONT BUMPER AND RHS HEADLIGHT. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED	New	1,200.00	500.00
4	TO RESPRAY FRONT BUMPER AND BONNET	New	2,000.00	1,100.00
5	TO CARRY OUT DIAGNOSTIC CHECK	New	192.00	192.00
Gross Labour Cost (\$\$)			4,152.00	2,152.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >