

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)
 51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
 Singapore 408933
 Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/CTI22010992/SNP3E2
Date: 14/11/2022

REFERENCE

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd.	Policy No: DMPCSNW0012222201	
Claimant Vehicle No : FBS6791L	Insured Vehicle No : SJQ9813D	
Date of Loss: 29/10/2022	Nature of Claim: TP	Claim No: SNM22D207811/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBS6791L		
Make & Model:	YAMAHA NMAX155, 155cc ABS CVT	Engine No:	G3L8E0610029
Reg. Date:	29/06/2021 (Man. Year: 2021)	Chassis No:	MH3SG5680MK087252
Colour:	Black	Odometer:	27242 km
Engine Capacity:	155 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	110/70-13	Rear Tyre Size:	140/70-13
Front Left Side:	Trail Blazer 5 mm	Rear Left Side:	Trail Blazer 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	03/11/2022	
Date Inspected:	03/11/2022	Inspected At: Bikes and Tea Pte Ltd (HQ) 25 Kaki Bukit Road 4 #01-43, Synergy@KB Singapore 417800
Estimated Period of Repair:	5.0 days	

Adjuster: S Mohamed Irfan Bin Mohamed Iqbal

Manager: HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$6,000.00
-\$7,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 14 Nov 2022)	
Parts:	N/A	YAMAHA NMAX155 155cc ABS CVT (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBS6791L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >