

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22011045/KVP3Q2**Date:** 22/11/2022**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMCVSNW00046582201	
Claimant Vehicle No :	GBE1810Y	Insured Vehicle No :	YQ429L	
Date of Loss:	03/11/2022	Nature of Claim:	TP	Claim No: SNM22D207931/C02

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	GBE1810Y		Engine No:	YD25379881A
Make & Model:	NISSAN NV350, 2.5 (A)		Chassis No:	JN1MC2E26Z0005047
Reg. Date:	22/09/2015 (Man. Year: 2015)		Odometer:	207737 km
Colour:	Metallic Grey			
Engine Capacity:	2488 cc			
Market Value/New Car Price:	N/A			
Sum Insured (\$\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195 R15	Rear Tyre Size:	195 R15
Front Left Side:	Michelin 9 mm	Rear Left Side:	Michelin 7 mm
Front Right Side:	Michelin 9 mm	Rear Right Side:	Michelin 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,367.50	8,884.78	4,482.72	33.53
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,240.00	2,450.00	1,790.00	42.22
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	17,607.50	11,334.78	6,272.72	35.63
Approved Total (Overridden) (\$\$)		9,000.00		
Nett Amount (\$\$)	17,607.50	9,000.00	8,607.50	48.89

INSPECTION

Date of Assignment:	04/11/2022	
Date Inspected:	08/11/2022	Inspected At: Massive Trading & Auto Blk 5038 #01-405, Ang Mo Kio Industrial Pk 2 Singapore 569541
Estimated Period of Repair:	8.0 days	

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 22 Nov 2022)	
Parts:	N/A	NISSAN NV350 2.5 (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBE1810Y)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT N/S HEADLAMP ASSY	Cracked	676.00 FL	*616.00 FL
2	1		*FRONT N/S CORNER PANEL	Repair	275.00 FL	*- FL
3	1		*FRONT RADIATOR GRILLE	Mtg Cracked	683.00 FL	*683.00 FL
4	1		*FRONT BUMPER	Buckled / Cracked	688.00 FL	*628.00 FL
5	1		*FRONT N/S BUMPER SIDE RETAINER	Cracked	115.00 FL	*115.00 FL
6	1		*FRONT N/S BUMPER TOW COVER	Serviceable	35.00 FL	*- FL
7	1		*FRONT N/S DOOR	Bent	1,250.00 FL	*1,250.00 FL
8	1		*FRONT N/S DOOR REAR PILLAR	Bent	755.00 FL	*755.00 FL
9	1		*FRONT N/S DOOR VIEW MIRROR	Broken	688.00 FL	*608.00 FL
10	1		*FRONT N/S DOOR GLASS REGULATOR	Distorted	187.00 FL	*187.00 FL
11	1		*FRONT N/S DOOR GLASS REGULATOR MOTOR	Jammed	674.00 FL	*624.00 FL
12	1		*FRONT N/S DOOR INNER TRIM BOARD	Mtg Cracked	785.00 FL	*756.00 FL
13	1		*FRONT N/S DOOR GLASS RUBBER MOULDING	Buckled	165.00 FL	*165.00 FL
14	1		*FRONT N/S DOOR OUTER HANDLE	Scratched	185.00 FL	*185.00 FL
15	1		*FRONT N/S DOOR INNER LOCK	Dented	205.00 FL	*205.00 FL
16	1		*FRONT N/S DOOR RUBBER	Serviceable	155.00 FL	*- FL
17	2		*FRONT N/S DOOR HINGE	Bent	190.00 FL	*190.00 FL
18	1		*FRONT N/S DOOR STEP	Cracked	255.00 FL	*255.00 FL
19	1		*REAR N/S SLIDING DOOR	Bent	1,484.00 FL	*1,474.00 FL
20	1		*REAR N/S SLIDING DOOR OUTER HANDLE	Serviceable	185.00 FL	*- FL
21	1		*REAR N/S SLIDING DOOR RAILING	Serviceable	255.00 FL	*- FL
22	1		*REAR N/S FENDER	Repair	2,260.00 FL	*- FL
23	1		*REAR N/S TAIL-LAMP	Cracked	305.00 FL	*287.00 FL
24	1		*REAR BUMPER	Serviceable	675.00 FL	*- FL
25	1		*FRONT OIL COOLER	Punctured	1,550.00 FL	*716.20 FL
26	1		*FRONT OIL COOLER HOUSING	Cracked	95.00 FL	*95.00 FL
27	1		*FRONT N/S DOOR STICKER	Necessary	30.00 FS	*30.00 FS
28	20		*CLIP	Necessary	40.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	14,845.00	9,864.20
- List Item Discount on L Items 10.00/10.00% (\$)	1,477.50	979.42
Total Parts (\$)	13,367.50	8,884.78

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	REMOVE/RENEW THE ABOVE ACCIDENT PARTS INCLUDING KNOCKING ,WELDING & CUTTING	New	1,800.00	1,000.00
2	TO PUTTY AND SPRAY PAINT	New	1,800.00	1,200.00
3	CHECK & RECONNECT HARNESS WIRING	New	50.00	20.00
4	TO RESPRAY ANTI-RUST PROOFING TREATMENT	New	120.00	90.00
5	REMOVE/REFIT FRONT WINDSCREEN TO FACILITATE REPAIR ON FRONT WINDSCREEN PILLAR	New	120.00	0.00
6	REMOVE/REFIT FRONT CABIN ROOF LINING TO FACILITATE REPAIR	New	200.00	80.00
7	REMOVE/REFIT FRONT N/S DOOR MECHANISM & DOOR GLASS TO NEW DOOR	New	150.00	60.00
Gross Labour Cost (S\$)			4,240.00	2,450.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >