

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

China Taiping Insurance (Singapore) Pte. Ltd.  
3 Anson Road, #16-00 Springleaf Tower  
Singapore 079909

**Our File No:** CS/CTI22011074/UVP3Q2**Date:** 07/12/2022**REFERENCE**

Insured/Claimant: OMEGA AUTO PTE LTD Policy No: DMCVSNW00094472200

Date of Loss: 02/11/2022

Nature of Claim: OD

Claim No: SNM22D207921/C01/CHNGPW

**DESCRIPTION & IDENTIFICATION OF VEHICLE**Reg No: **GBH3720U**

Make &amp; Model: TOYOTA HIACE, 3.0 D TURBO 5DR MT (M)

Engine No: 1KD2802535

Reg. Date: 11/05/2018 (Man. Year: 2018)

Chassis No: JTFHT02P200242722

Colour: Silver

Odometer: 93992 km

Engine Capacity: 2982 cc

Market Value/New Car Price: S\$56,000.00

Price:

Sum Insured (S\$): **Market Value/New Car Price****CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

**CONDITION OF TYRES**

Front Tyre Size: 195 R15

Rear Tyre Size: 195 R15

Front Left Side: Bridgestone 5 mm

Rear Left Side: Yokohama 2 mm

Front Right Side: Bridgestone 5 mm

Rear Right Side: Yokohama 2 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	5,285.00	5,020.00	265.00	5.01
Miscellaneous Items	40.00	40.00	0.00	0.00
Labour	873.60	701.40	172.20	19.71
Paintwork Labour	745.43	745.43	0.00	0.00
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>6,944.03</b>	<b>6,506.83</b>	<b>437.20</b>	<b>6.30</b>
<b>- Excess (S\$)</b>	0.00	450.00	-450.00	
<b>(S\$)</b>	6,944.03	6,056.83	887.20	12.78
<b>+ GST 7.00/7.00% (S\$)</b>	486.08	423.98	62.10	12.78
<b>Nett Amount (S\$)</b>	<b>7,430.11</b>	<b>6,480.81</b>	<b>949.30</b>	<b>12.78</b>

**INSPECTION**

Date of Assignment: 07/11/2022 Present Location: Jin Auto Services Pte Ltd (Defu)  
Jin Auto Services Pte Ltd (Defu)  
Date Inspected: 07/11/2022 Inspected At: Blk 14 Defu Lane 10, #01-410/412  
Singapore 539195  
Estimated Period of Repair: 6.0 days

**Adjuster:** MARCUS CHUA**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 07 Dec 2022)	
Parts:	N/A	TOYOTA HIACE 3.0 D TURBO 5DR MT (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBH3720U)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TOTAL PARTS		5,285.00 F	*5,020.00 F
F=Franchise part.						
Total Parts (S\$)					5,285.00	5,020.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
<u>Miscellaneous Items</u>				
1	1	IU STICKER	15.00	15.00
2	1	SEALANT	25.00	25.00
Sub Total (\$\$)			40.00	40.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	TOTAL PAINT LABOUR CHARGE	New	745.43	745.43
<u>Labour Items</u>				
2	TOTAL LABOUR CHARGE	New	873.60	701.40
Gross Labour Cost (\$\$)			1,619.03	1,446.83

Report was unsubmitted during this print-out.

< END OF ESTIMATES >