

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

China Taiping Insurance (Singapore) Pte. Ltd.  
3 Anson Road, #16-00 Springleaf Tower  
Singapore 079909

**Our File No:** CS/CTI22011153/UVP3Q2**Date:** 16/11/2022REFERENCE

Insured/Claimant: SIN WEI GAS SUPPLY PTE LTD Policy No: DMCVSNW00026062200

Date of Loss: 04/11/2022

Nature of Claim: OD

Claim No: SNM22D207939/C01/KHONGLH

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	<b>GBE6078L</b>	Engine No:	1KD2576422
Make & Model:	TOYOTA DYNA 150, 3.0 D (M)	Chassis No:	JTFAT35Y80K205671
Reg. Date:	25/01/2016 (Man. Year: 2015)	Odometer:	46306 km
Colour:	Silver		
Engine Capacity:	2982 cc		
Market Value/New Car Price:	S\$35,000.00		
Sum Insured (S\$):	<b>Market Value/New Car Price</b>		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195 R15	Rear Tyre Size:	155 R12 (D)
Front Left Side:	Falken 6 mm	Rear Left Side:	Falken 6/6 mm
Front Right Side:	Falken 6 mm	Rear Right Side:	Falken 6/6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	2,262.16	1,610.00	652.16	28.83
Miscellaneous Items	0.00	0.00	0.00	
Labour	886.20	886.20	0.00	0.00
Paintwork Labour	622.72	622.72	0.00	0.00
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (S\$)</b>	<b>3,771.08</b>	<b>3,118.92</b>	<b>652.16</b>	<b>17.29</b>
<b>- Excess (S\$)</b>	0.00	500.00	-500.00	
<b>(S\$)</b>	3,771.08	2,618.92	1,152.16	30.55
<b>+ GST 7.00/7.00% (S\$)</b>	263.98	183.32	80.66	30.56
<b>Nett Amount (S\$)</b>	<b>4,035.06</b>	<b>2,802.24</b>	<b>1,232.82</b>	<b>30.55</b>

INSPECTION

Date of Assignment:	08/11/2022	Present Location:	Jin Auto Services Pte Ltd (Defu)
Date Inspected:	08/11/2022	Inspected At:	Jin Auto Services Pte Ltd (Defu) Blk 14 Defu Lane 10, #01-410/412 Singapore 539195
Estimated Period of Repair:	5.0 days		

**Adjuster:** MARCUS CHUA**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*



Please be informed that insured withdraw OD claim  
(REPAIR COST NOT CONCLUDE)  
(EXCLUDE CHECK ITEMS S\$652.16 NETT)

# REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 16 Nov 2022)	
Parts:	N/A	TOYOTA DYNA 150 3.0 D (M) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for GBE6078L)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

## Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TOTAL PARTS		2,262.16 F	*1,610.00 F
Total Parts (\$\$)					2,262.16	1,610.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Paintwork Labour</u>				
1	TOTAL PAINT LABOUR CHARGE	New	622.72	622.72
<u>Labour Items</u>				
2	TOTAL LABOUR CHARGE	New	886.20	886.20
Gross Labour Cost (\$\$)			1,508.92	1,508.92

Report was unsubmitted during this print-out.

< END OF ESTIMATES >