

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT**

China Taiping Insurance (Singapore) Pte. Ltd.  
3 Anson Road, #16-00 Springleaf Tower  
Singapore 079909

**Our File No:** CS/CTI22011360/KWY3Q2**Date:** 22/12/2022**REFERENCE****Insured/Claimant:** OW MUI KHENG **Policy No:** DMPCSNW00006952200**Date of Loss:** 07/11/2022 **Nature of Claim:** OD **Claim No:** SNM22D208078/C01/TAYHP**DESCRIPTION & IDENTIFICATION OF VEHICLE**

**Reg No:** SMF6803A  
**Make & Model:** TOYOTA COROLLA ALTIS, 1.6 (A) **Engine No:** 3ZZ4826127  
**Reg. Date:** 26/12/2008 (Man. Year: 2008) **Chassis No:** MR053ZEE106127768  
**Colour:** Metallic Silver **Odometer:** 0 km  
**Engine Capacity:** 1598 cc  
**Market Value/New Car Price:** S\$12,000.00  
**Sum Insured (\$\$):** **Market Value/New Car Price**

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

**General Condition:** Steering (Serviceable): Yes **Footbrake (Serviceable):** Yes  
**Handbrake (Serviceable):** Yes **Engine Modification:** No **Pre-accident Condition:**

**CONDITION OF TYRES**

**Front Tyre Size:** 205/55Z R16 **Rear Tyre Size:** 205/55Z R16  
**Front Left Side:** Michelin 6 mm **Rear Left Side:** Michelin 6 mm  
**Front Right Side:** Michelin 6 mm **Rear Right Side:** Michelin 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	8,475.00	5,540.00	2,935.00	34.63
Miscellaneous Items	0.00	0.00	0.00	
Labour	835.80	424.20	411.60	49.25
Paintwork Labour	463.64	425.64	38.00	8.20
Towing	0.00	0.00	0.00	
<b>Calculated Gross Total (\$\$)</b>	<b>9,774.44</b>	<b>6,389.84</b>	<b>3,384.60</b>	<b>34.63</b>
<b>Approved Total (Overridden) (\$\$)</b>		<b>4,950.00</b>		
<b>(\$\$)</b>	9,774.44	4,950.00	4,824.44	49.36
<b>+ GST 7.00/7.00% (\$\$)</b>	684.21	346.50	337.71	49.36
<b>Nett Amount (\$\$)</b>	<b>10,458.65</b>	<b>5,296.50</b>	<b>5,162.15</b>	<b>49.36</b>

**INSPECTION**

**Date of Assignment:** 11/11/2022 **Present Location:** Ding Auto Pte Ltd (HQ)  
Ding Auto Pte Ltd (HQ)  
**Date Inspected:** 14/11/2022 **Inspected At:** 176 Sin Ming Drive #04-06, Sin Ming Autocare  
Singapore 575721  
**Estimated Period of Repair:** 7.0 days

**Adjuster:** KENNETH KONG**Manager:** XinYu

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 22 Dec 2022)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMF6803A)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TOTAL PARTS		8,475.00 F	*5,540.00 F
						F=Franchise part.
Total Parts (S\$)					8,475.00	5,540.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<b><u>Paintwork Labour</u></b>				
1	Total Paint Labour	New	302.40	268.80
2	Total Paint Materials	New	161.24	156.84
<b><u>Labour Items</u></b>				
3	Total Panel/Mechanical Labour	New	835.80	424.20
<b>Gross Labour Cost (\$\$)</b>			<b>1,299.44</b>	<b>849.84</b>

Report was unsubmitted during this print-out.

< END OF ESTIMATES >