

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Allianz Insurance Singapore Pte. Ltd.
79 Robinson Road #09-01
Singapore 068897

Our File No: CS6/AIS22011362/DNY3M4**Date:** 13/06/2023**REFERENCE**

Insured/Claimant: SHREE KARTHIGESAN Policy No: SP2001987245
Date of Loss: 07/11/2022 Nature of Claim: OD Claim No: 202222007985

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SNF4151Z**
Make & Model: TOYOTA ALPHARD, 2.4 MR CVT (A) Engine No: 2AZJ033497
Reg. Date: 13/11/2013 (Man. Year: 2013) Chassis No: JTEGD21H608302408
Colour: Silver Odometer: 128985 km
Engine Capacity: 2362 cc
Market Value/New Car Price: S\$47,000.00
Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 215/60R17 Rear Tyre Size: 215/60R17
Front Left Side: Falken 5 mm Rear Left Side: Falken 5 mm
Front Right Side: Falken 5 mm Rear Right Side: Falken 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,339.60	3,795.20	1,544.40	28.92
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,880.00	1,300.00	580.00	30.85
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	7,219.60	5,095.20	2,124.40	29.43
Approved Total (Overridden) (\$\$)		4,000.00		
(\$\$)	7,219.60	4,000.00	3,219.60	44.60
+ GST 7.00/8.00% (\$\$)	505.37	320.00	185.37	36.68
Nett Amount (\$\$)	7,724.97	4,320.00	3,404.97	44.08

INSPECTION

Date of Assignment: 11/11/2022 Present Location: Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)
Date Inspected: 18/11/2022 Inspected At: Sng Ah Tee Motor & Panel Service Pte Ltd (Pioneer)
Blk 3 Pioneer Road North, #01-18
Singapore 628457
Estimated Period of Repair: 4.0 days

Adjuster: BRYAN TANI**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 13 Jun 2023)
Parts:	M1-MPV	TOYOTA ALPHARD 2.4 MR CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SNF4151Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT NUMBER PLATE	Cracked	35.00 FS	*35.00 FS
2	1		*FRT BUMPER (WCP)	Distorted	220.00 F	*220.00 F
3	10		*FRT BUMPER CLIP (WCP)	Necessary	10.00 F	*10.00 F
4	1		*FRT BUMPER LOWER GRILLE (WCP)	Not Necessary	90.00 F	*- F
5	2		*FRT BUMPER RETAINER (WCP)	Serviceable	90.00 F	*- F
6	1		*FRT BUMPER REINFORCEMENT (WCP)	Dented	180.00 F	*180.00 F
7	1		*FRT BUMPER SPONGE (WCP)	Torn	70.00 F	*70.00 F
8	1		*FRT BUMPER CHROME (WCP)	Not Necessary	120.00 F	*- F
9	1		*FRT PARKING SENSOR (RH) (WCP)	Damaged	160.00 F	*160.00 F
10	1		*FRT GRILLE (WCP)	Cracked	240.00 F	*240.00 F
11	1		*FRT GRILLE EMBLEM (WCP)	Cut	70.00 F	*70.00 F
12	1		*FRT BONNET (WCP)	Bent	240.00 F	*240.00 F
13	2		*FRT BONNET HINGE (WCP)	Bent	90.00 F	*90.00 F
14	1		*FRT BONNET CHROME (WCP)	Serviceable	180.00 F	*- F
15	9		*FRT BONNET INSULATOR CLIPS (WCP)	Not Necessary	9.00 F	*- F
16	1		*FRT HEADLAMP(RH) (WCP)	Mtg Broken	580.00 F	*580.00 F
17	1		*FRT FENDER(RH) (WCP)	Repair	320.00 F	*- F
18	1		*FRT FENDER INNERSHIELD(RH) (LH INSTEAD OF RH) (WCP)	Torn	140.00 F	*140.00 F
19	10		*FRT FENDER INNERSHIELD CLIP (N/S) (WCP)	Necessary	10.00 F	*10.00 F
20	1		*FRT SUPPORT PANEL (WCP)	Repair	580.00 F	*- F
21	1		*FRT BRACE PANEL (WCP)	Bent	70.00 F	*70.00 F
22	1		*AIRCON CONDENSER (WCP)	Punctured	550.00 F	*550.00 F
23	1		*RADIATOR (WCP)	Punctured	580.00 F	*580.00 F
24	1		*RADIATOR AIR GUIDE (RH) (WCP)	Broken	150.00 F	*150.00 F
25	1		*RADIATOR TOP BRACKET (WCP)	Not Necessary	15.00 F	*- F
Supplementary #1						
26	1		*FRT PARKING SENSOR RING CAP (WCP)	Bent/Dented	10.00 F	*10.00 F
27	1		*COOLANT	Necessary	40.00 FS	*40.00 FS
28	1		*FRT BUMPER TOW COVER RH (WCP)	Dislodged	12.00 F	*12.00 F

Report was unsubmitted during this print-out.

6/13/23, 3:42 PM

Adjuster Report

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
F=Franchise part. S=SpcNett.						
Sub Total (S\$)					4,861.00	3,457.00
+ Margin on L,N Items 10.00/10.00% (S\$)					478.60	338.20
Total Parts (S\$)					5,339.60	3,795.20
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO KNOCK, WELD,REMOVE & FIX ABOVE PARTS	New	850.00	600.00
2	TO PUTTY & RESPRAY PAINTING ON AFFECTED AREA	New	900.00	600.00
3	TO REFILL AIRCON GAS	New	100.00	80.00
4	TO CHECK WIRING	New	30.00	20.00
Gross Labour Cost (\$\$)			1,880.00	1,300.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >