

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/LPC 22011535/U943

ASSIGNMENT

From:

Date:

Estimated Cost:

OD TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

IDAC Accident Rpt:

GIA / PR Seen:

Est. Repairs:

Lum Sum:

\$ 70k.

Consistent? : Yes or No

Consistent? : Yes or No

days Res.: Yes or No

% 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

PA9085B

Yr Regn:

06/08/09

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Isuzu LT134P

c.c 7790

Colour

white / blue

A/C:

Insured / Std / NI / NA

Sp. Reading

479612

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JALLT134P.87000171

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F: 295 / 80 R22.5

R:

(D/D)

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6/6

mm

L/Bal.

6

mm

L/Bal.

6/6

mm

D.O.A.

18/09/22

D.O.I.

15/11/22

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S Imp.

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

1) 22/4/22

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I. (\$

TP

2800

Days Of Repair:

2

Resurvey No. of Trip:

1

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

) S + RS. SI

) Photos

) Others

TOTAL

22/4/22 6/5 @ 2800 informed AM Unit (Red & 22551.52, 89%)
we ant. 30-06-2028
have video at folder

EURO SUCCESS SERV PTE LTD

No. 1 Kaki Bukit Avenue 6

#02-03 AutoBay

SINGAPORE 417883

TEL.NO: 93365311 / FAX NO. 67411019

Email: eurosucces0202@gmail.com

not followed
 15/11/22
 2/s \$ 2800
 2 days

Estimate Report

To : Claim Department
 Attn :
 Tel :
 Fax :

Vehicles Number : PA 9085B
 Make and Model : ISUZU LT134P 7.8
 Date Of Accident : 18.09.2022

Attn: Motor Claim Department
 Estimated Repairs Costs

Qty	List Items	Unit Price	Amount
1	^ /S side view mirror arm		\$ 1,280.00 X
1	^ /S side view mirror cover		\$ 890.00 X
1	^ /S side view mirror - big		\$ 580.00 X
1	^ /S side view mirror - small		\$ 467.00 X
1	^ /S side view mirror motor		\$ 786.00 X
1	^ /S side view small mirror cover		\$ 468.00 X
1	^ /S side view small mirror		\$ 318.00 X
1	^ /S side view mirror assembly		\$ 4,788.90 X
1	Front Panel L/H		\$ 1,800.00 X
1	Front Camera L/H		\$ 589.00 X
1	Signal cover L/H		\$ 88.90 X
1	Front Headlight L/H		\$ 3,988.50 X
1	Front Headlight R/H		\$ 3,988.50 X
1	Front Bumper		\$ 1,890.00 X
1	Rear Bumper		\$ 1,990.00 X

Complete

3520

one

152
 Less 10%
 \$ 23,912.80
 \$ 2,391.28
 \$ 21,521.52

Total \$ 21,521.52

Labour & Misc Charges

To remove and replaced damaged parts. \$ 950.00 280
 To respray affected panel \$ 1,900.00 200
 To check on electrical wiring for camera, headlight and O/S mirror \$ 980.00 50

p- 3520
 152
 2992
 530

Total	\$	3,830.00
Grand Total	\$	25,351.52

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: