

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CT122011845/SQP3E2**Date:** 19/01/2023REFERENCE

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMB1SNW00009692200	
Claimant Vehicle No :	FBN3587G	Insured Vehicle No :	PC5737U	
Date of Loss:	21/11/2022	Nature of Claim:	TP	Claim No: SNM22D208403/C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	FBN3587G		Engine No:	G3J8E0056876
Make & Model:	YAMAHA AEROX 155A, 155cc		Chassis No:	MH3SG4640JJ045304
Reg. Date:	11/09/2018 (Man. Year: 2018)		Odometer:	42809 km
Colour:	Yellow			
Engine Capacity:	155 cc			
Market Value/New Car Price:	N/A			
Sum Insured (S\$):	Market Value/New Car Price			

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	110/80-14	Rear Tyre Size:	140/70-14
Front Left Side:	Pirelli 5 mm	Rear Left Side:	Pirelli 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment:	24/11/2022		
Date Inspected:	25/11/2022	Inspected At:	GP SERVICE PTE LTD 282 Macpherson Road Singapore 348607
Estimated Period of Repair:	4.0 days		

Adjuster: S Mohamed Irfan Bin Mohamed Iqbal**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,500.00
-\$2,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 19 Jan 2023)	
Parts:	N/A	YAMAHA AEROX 155A 155cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBN3587G)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >