

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/AIS22011983/TVY3E2**Date:** 29/03/2023REFERENCE

Handling Insurer: Allianz Insurance Singapore Pte. Ltd.

Policy No:

**Claimant Vehicle No :** SLX138T**Insured Vehicle No :** SJQ5721L

Date of Loss: 24/11/2022

Nature of Claim: TP

Claim No: 2022 22008485FR

DESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SLX138T**

Make &amp; Model: TOYOTA VELLFIRE, 2.5 Z G CVT (A)

Engine No: 2ARJ063201

Reg. Date: 16/01/2019 (Man. Year: 2018)

Chassis No: AGH300175085

Colour: Black

Odometer: 142429 km

Engine Capacity: 2493 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable):

Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification:

No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 235/50Z R18

Rear Tyre Size: 235/50Z R18

Front Left Side: 'GREENTRAC' 6 mm

Rear Left Side: 'GREENTRAC' 6 mm

Front Right Side: 'GREENTRAC' 6 mm

Rear Right Side: 'GREENTRAC' 6 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	
<b>Global Sum Settlement (S\$)</b>		<b>0.00</b>		

INSPECTION

Date of Assignment: 30/11/2022

Date Inspected: 22/12/2022 Inspected At:

Eco Automobile Claims &amp; Repair Pte Ltd - Bartley Biz Center (HQ)

15 KAKI BUKIT ROAD 4, #01-53 BARTLEY BIZ CENTER  
Singapore 417808

Estimated Period of Repair: 7.0 days

**Adjuster:** MOHD TAUFIKH BIN HAMID**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$7,000.00  
-\$8,000.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 29 Mar 2023)
Parts:	M1-MPV	TOYOTA VELLFIRE 2.5 Z G CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLX138T)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.
---

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >