

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22011997/TQP3M4**Date:** 07/02/2023**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMPCSNW00056962202
Claimant Vehicle No : SJG8992D **Insured Vehicle No :** SLX1935C
 Date of Loss: 29/11/2022 Nature of Claim: TP Claim No: SNM22D208563/C02/LEWLC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SJG8992D**
 Make & Model: HONDA STREAM, 1.8 (A) Engine No: R18A12804803
 Reg. Date: 18/07/2008 (Man. Year: 2008) Chassis No: JHMRN68408S204791
 Colour: Grey Odometer: 463369 km
 Engine Capacity: 1799 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 225/45 R18 Rear Tyre Size: 225/45 R18
 Front Left Side: Rotalla 6 mm Rear Left Side: Rotalla 6 mm
 Front Right Side: Rotalla 6 mm Rear Right Side: Rotalla 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,995.00	7,186.00	7,809.00	52.08
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,500.00	2,630.00	3,870.00	59.54
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	21,495.00	9,816.00	11,679.00	54.33
Approved Total (Overridden) (S\$)		7,850.00		
(S\$)	21,495.00	7,850.00	13,645.00	63.48
+ GST 8.00/8.00% (S\$)	1,719.60	628.00	1,091.60	63.48
Nett Amount (S\$)	23,214.60	8,478.00	14,736.60	63.48

INSPECTION

Date of Assignment: 30/11/2022
 Date Inspected: 30/11/2022 Inspected At: Bifrost Auto Pte Ltd (Kaki Bukit)
 8 Kaki Bukit Ave 4, #01-49, Premier @ Kaki Bukit
 Singapore 415875
 Estimated Period of Repair: 8.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS**Reference**

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 07 Feb 2023)
Parts: M1-MPV	HONDA STREAM 1.8 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SJG8992D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*TAILGATE	Bent	956.00 FL	*956.00 FL
2	1		*TAILGATE WINDSCREEN GLASS RUBBER MOULDING	Necessary	89.00 FL	*89.00 FL
3	1		*TAILGATE STREAM EMBLEM	Necessary	47.00 FL	*47.00 FL
4	1		*TAILGATE CENTRE EMBLEM	Necessary	28.00 FL	*28.00 FL
5	1		*TAILGATE OUTER GARNISH	Cracked	192.00 FL	*192.00 FL
6	1		*TAILGATE INNER HANDLE	Deformed	32.00 FL	*32.00 FL
7	1		*TAILGATE INNER TRIM BOARD	Cracked	479.00 FL	*365.00 FL
8	1		*TAILGATE LOCK	Bent	119.00 FL	*119.00 FL
9	1		*TAILGATE LOCK CATCH	Not Necessary	45.00 FL	*- FL
10	1		*TAILGATE WEATHERSTRIP	Cut	128.00 FL	*128.00 FL
11	1		*TAILGATE WIPER MOTOR	Not Necessary	452.00 FL	*- FL
12	1		*TAILGATE WIPER ARM	Not Necessary	184.00 FL	*- FL
13	1		*TAILGATE WIPER BLADE	Not Necessary	73.00 FL	*- FL
14	1		*REAR BUMPER	Deformed	812.00 FL	*688.00 FL
15	1		*REAR BUMPER TOWING COVER	Missing	24.00 FL	*24.00 FL
16	1		*REAR BUMPER RH LOWER BRACKET	Not Necessary	18.00 FL	*- FL
17	1		*REAR BUMPER LH LOWER BRACKET	Not Necessary	18.00 FL	*- FL
18	1		*REAR BUMPER RH SIDE RETAINER	Deformed	22.00 FL	*22.00 FL
19	1		*REAR BUMPER LH SIDE RETAINER	Deformed	22.00 FL	*22.00 FL
20	1		*RH TAILLAMP ASSY	Cracked	446.00 FL	*446.00 FL
21	1		*RH TAILLAMP PANEL	Not Necessary	164.00 FL	*- FL
22	1		*SET RH TAILLAMP LOCK CLIP	Not Necessary	28.00 FL	*- FL
23	1		*RH TAILLAMP GASKET	Not Necessary	25.00 FL	*- FL
24	1		*LH TAILLAMP ASSY	Cracked	446.00 FL	*446.00 FL
25	1		*LH TAILLAMP PANEL	Not Necessary	164.00 FL	*- FL
26	1		*SET LH TAILLAMP LOCK CLIP	Not Necessary	28.00 FL	*- FL
27	1		*LH TAILLAMP GASKET	Not Necessary	25.00 FL	*- FL
28	1		*END PANEL	Bent	454.00 FL	*454.00 FL
29	1		*END PANEL INNER GARNISH	Deformed	178.00 FL	*178.00 FL
30	1		*RH REAR FENDER SPLASH SHIELD	Not Necessary	82.00 FL	*- FL
31	1		*RH REAR FENDER INNER TRIM BOARD	Cracked	382.00 FL	*382.00 FL
32	1		*LH REAR FENDER SPLASH SHIELD	Not Necessary	82.00 FL	*- FL
33	1		*LH REAR FENDER INNER TRIM BOARD	Cracked	382.00 FL	*382.00 FL
34	1		*REAR COMPARTMENT PANEL TOP RH COVER	Not Necessary	218.00 FL	*- FL
35	1		*REAR COMPARTMENT PANEL TOP LH COVER	Not Necessary	218.00 FL	*- FL
36	1		*REAR COMPARTMENT PANEL TRIM	Not Necessary	197.00 FL	*- FL
37	1		*EXHAUST SILENCER	Repair	637.00 FL	*- FL
38	1		*EXHAUST SILENCER GASKET	Not Necessary	45.00 FL	*- FL
39	1		*BONNET	Repair	684.00 FL	*- FL
40	1		*BONNET LOCK	Not Necessary	58.00 FL	*- FL
41	1		*BONNET RUBBER SEAL	Not Necessary	18.00 FL	*- FL
42	1		*FRONT BUMPER	Deformed	783.00 FL	*635.00 FL
43	1		*FRONT BUMPER RH SIDE RETAINER	Deformed	22.00 FL	*22.00 FL
44	1		*FRONT BUMPER LH SIDE RETAINER	Deformed	22.00 FL	*22.00 FL
45	1		*FRONT BUMPER RH FOG LAMP ASSY	Not Necessary	255.00 FL	*- FL
46	1		*FRONT BUMPER RH FOG LAMP COVER	Not Necessary	110.00 FL	*- FL

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*FRONT BUMPER LH FOG LAMP ASSY	Not Necessary	255.00 FL	*- FL
48	1		*FRONT BUMPER LH FOG LAMP COVER	Not Necessary	110.00 FL	*- FL
49	1		*FRONT BUMPER REINFORCEMENT	Bent	224.00 FL	*224.00 FL
50	1		*FRONT BUMPER LOWER GRILLE	Deformed	87.00 FL	*87.00 FL
51	1		*LH HEADLAMP ASSY	Cracked	735.00 FL	*735.00 FL
52	1		*LH HEADLAMP LOWER BRACKET	Not Necessary	39.00 FL	*- FL
53	1		*RH HEADLAMP ASSY	Cracked	735.00 FL	*735.00 FL
54	1		*RH HEADLAMP LOWER BRACKET	Not Necessary	39.00 FL	*- FL
55	1		*FRONT FENDER RH SPLASH SHIELD	Not Necessary	85.00 FL	*- FL
56	1		*FRONT FENDER LH SPLASH SHIELD	Not Necessary	85.00 FL	*- FL
57	1		*FRONT GRILLE	Cracked	336.00 FL	*336.00 FL
58	1		*FRONT GRILLE EMBLEM	Necessary	28.00 FL	*28.00 FL
59	1		*SUPPORT PANEL	Bent	568.00 FL	*496.00 FL
60	1		*SUPPORT PANEL TOP COVER	Not Necessary	128.00 FL	*- FL
61	1		*AIRCON CONDENSER	Not Necessary	872.00 FL	*- FL
62	1		*RADIATOR ASSY	Not Necessary	1,506.00 FL	*- FL
63	1		*TAILGATE WINDSCREEN GLASS SEALANT	Necessary	80.00 FS	*40.00 FS
64	1		*TAILGATE WINDSCREEN GLASS INNER SEAL	Necessary	60.00 FS	*30.00 FS
65	1		*TAILGATE REVERSE CAMERA	Not Necessary	650.00 FS	*- FS
66	1		*TAILGATE SEALANT	Not Necessary	80.00 FS	*- FS
67	1		*SET TAILGATE INNER TRIM BOARD CLIPS	Necessary	80.00 FS	*30.00 FS
68	1		*SET REAR BUMPER CLIPS	Necessary	80.00 FS	*30.00 FS
69	1		*SET REAR BUMPER REVERSE SENSOR	Not Working	350.00 FS	*200.00 FS
70	1		*END PANEL JOINT SEALANT	Necessary	80.00 FS	*40.00 FS
71	1		*SET END PANEL INNER GARNISH CLIPS	Necessary	60.00 FS	*20.00 FS
72	1		*LH TAILLAMP PANEL JOINT SEALANT	Not Necessary	50.00 FS	*- FS
73	1		*RH TAILLAMP PANEL JOINT SEALANT	Not Necessary	50.00 FS	*- FS
74	1		*REAR NUMBER PLATE	Bent	80.00 FS	*45.00 FS
75	1		*SET RH REAR FENDER SPLASH SHIELD CLIPS	Not Necessary	40.00 FS	*- FS
76	1		*SET RH REAR FENDER INNER TRIM BOARD CLIPS	Not Necessary	70.00 FS	*- FS
77	1		*SET LH REAR FENDER SPLASH SHIELD CLIPS	Not Necessary	40.00 FS	*- FS
78	1		*SET LH REAR FENDER INNER TRIM BOARD CLIPS	Not Necessary	70.00 FS	*- FS
79	1		*SET FRONT BUMPER CLIPS	Necessary	80.00 FS	*30.00 FS
80	1		*SET SUPPORT PANEL TOP COVER CLIPS	Not Necessary	60.00 FS	*- FS
81	1		*RADIATOR COOLANT	Not Necessary	80.00 FS	*- FS
82	1		*SET FRONT FENDER RH SPLASH SHIELD CLIPS	Not Necessary	70.00 FS	*- FS
83	1		*SET FRONT FENDER LH SPLASH SHIELD CLIPS	Not Necessary	70.00 FS	*- FS
84	1		*SET FRONT GRILLE CLIPS	Necessary	55.00 FS	*20.00 FS
85	1		*FRONT NUMBER PLATE	Bent	80.00 FS	*45.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	18,140.00	8,850.00
- List Item Discount on L Items 20.00/20.00% (\$)	3,145.00	1,664.00
Total Parts (\$)	14,995.00	7,186.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR CHARGES TO REMOVE, CHECK, REPLACE AND REINSTALL DAMAGES BODYPARTS. TO PANEL BEATING, CUT/WELD AND REALIGN ALL AFFECTED PANELS AND AREAS (REAR PORTION)	New	1,400.00	700.00
2	SPRAY PAINTING ON AFFECTED AREAS AND PANELS (REAR PORTION)	New	1,200.00	700.00
3	CHECK WIRING AND LIGHTING SYSTEM ON AFFECTED AREAS (REAR PORTION)	New	80.00	30.00
4	APPLY RUST COATING CHEMICAL ON AFFECTED AREAS AND PANELS (REAR PORTION)	New	80.00	40.00
5	REMOVE AND REINSTALL TAILGATE WINDSCREEN GLASS TO ASSIST REPAIR (REAR PORTION)	New	240.00	120.00
6	REMOVE AND REPLACE TAILGATE REVERSE CAMERA TO ASSIST REPAIR (REAR PORTION)	New	100.00	30.00
7	REMOVE AND REPLACE TAILGATE INNER MECHANISM TO NEW TAILGATE (REAR PORTION)	New	120.00	60.00
8	REMOVE AND REPLACE REAR BUMPER REVERSE SENSORS TO ASSIST REPAIR (REAR PORTION)	New	100.00	30.00
9	REMOVE AND REPLACE REAR INNER TRIMS, GARNISH AND BOARDS TO ASSIST REPAIR (REAR PORTION)	New	320.00	60.00
10	REMOVE AND REPLACE EXHAUST SILENCER AND GASKET TO ASSIST REPAIR (REAR PORTION)	New	180.00	0.00
11	LABOUR CHARGES TO REMOVE, CHECK, REPLACE AND REINSTALL DAMAGES BODYPARTS. TO PANEL BEATING, CUT/WELD AND REALIGN ALL AFFECTED PANELS AND AREAS (FRONT PORTION)	New	1,000.00	300.00
12	SPRAY PAINTING ON AFFECTED AREAS AND PANELS (FRONT PORTION)	New	1,000.00	400.00
13	CHECK WIRING AND LIGHTING SYSTEM ON AFFECTED AREAS (FRONT PORTION)	New	80.00	30.00
14	APPLY RUST COATING CHEMICAL ON AFFECTED AREAS AND PANELS (FRONT PORTION)	New	80.00	0.00
15	REMOVE AND REPLACE AIRCON CONDENSER, PIPES AND HOSES TO ASSIST REPAIRS (FRONT PORTION)	New	220.00	100.00
16	REMOVE AND REPLACE RADIATOR ASSY, HOSES AND FAN ASSY TO ASSIST REPAIRS (FRONT PORTION)	New	220.00	0.00
17	REFOCUS AND ADJUST HEADLAMPS ASSY (FRONT PORTION)	New	80.00	30.00
Gross Labour Cost (S\$)			6,500.00	2,630.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >