

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22012023/TWP3E2**Date:** 15/03/2023REFERENCEHandling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMCVSNW00126162204

**Claimant Vehicle
No :** SG6214Z**Insured Vehicle
No :** YN6436S

Date of Loss: 28/11/2022

Nature of Claim: TP

Claim
No: SNM22D208583/C02/LEEPGDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SG6214Z**

Make & Model: MAN A95, 10.5 D (A)

Engine No: 50354648125466

Reg. Date: 22/09/2021 (Man. Year: 2019)

Chassis No: WMAA95ZZ6LF011971

Colour: Green

Odometer: 83274 km

Engine Capacity: 10518 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 275/70 R22.5

Rear Tyre Size: 275/70 R22.5 (D)

Front Left Side: Bridgestone 8 mm

Rear Left Side: Bridgestone 8/8 mm

Front Right Side: Bridgestone 8 mm

Rear Right Side: Bridgestone 8/8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	3,576.00	3,576.00	0.00	0.00
Miscellaneous Items	0.00	0.00	0.00	
Labour	4,688.00	4,688.00	0.00	0.00
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	8,264.00	8,264.00	0.00	0.00
+ GST 8.00/8.00% (S\$)	661.12	661.12	0.00	0.00
Nett Amount (S\$)	8,925.12	8,925.12	0.00	0.00

INSPECTION

Date of Assignment: 30/11/2022

Date Inspected: 01/12/2022

Inspected At:

Sbs Transit Ltd (Bedok) (HQ)
1470 BEDOK NORTH AVE 4
Singapore 489946

Estimated Period of Repair: 7.0 days

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** XinYu*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

(REPAIR COST NOT CONCLUDE)

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 15 Mar 2023)	
Parts:	N/A	MAN A95 10.5 D (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SG6214Z)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*CABLE ROLLER.74X34.COOLANT PMP	Bent	84.00 F	*84.00 F
2	1		*GAS SPRING 500N	Bent	56.00 F	*56.00 F
3	1		*GAS SPRING 500N.27 .ENG DR	Bent	190.00 F	*190.00 F
4	1		*REFLECTOR.RED.A95.E6	Cracked	12.00 F	*12.00 F
5	1		*STKR SBS TRANSIT REAR.SG BUS	Necessary	7.00 F	*7.00 F
6	1		*BACK UP LIGHT ASSY.RR.A95.E6	Cracked	78.00 F	*78.00 F
7	1		*STOP LAMP LIGHT.LED.RR.A95.E6	Cracked	257.00 F	*257.00 F
8	1		*LAMP FLASHER ASSY.RR.LED.R95.E6	Cracked	246.00 F	*246.00 F
9	1		*FOG LAMP ASSY.RR.R95.E6	Cracked	84.00 F	*84.00 F
10	1		*BUMPER.REAR.E6.A95	Cracked	750.00 F	*750.00 F
11	1		*COVER.REAR LAMP.N/S.A95.E6	Cracked	390.00 F	*390.00 F
12	1		*STICKER REFLECTOR.RIGHT.A95.E6	Cut	55.00 F	*55.00 F
13	1		*STICKER REFLECTOR.LEFT.A95.E6	Cut	55.00 F	*55.00 F
14	1		*V-BELT.WATER PUMP	Cut	40.00 F	*40.00 F
15	1		*COOLANT PUMP.MANA22 A24	Bent	543.00 F	*543.00 F
16	1		*SEAL.COOLANT PUMP	Necessary	11.00 F	*11.00 F
17	1		*FRAME BOTTOM SUPPORT.RR BUMPER.E6	Bent	250.00 F	*250.00 F
18	1		*PULLEY.V-BELT.COOLANT PMP.E5&6	Bent	268.00 F	*268.00 F
19	1		*REVERSE SENSOR.BYD	Not Working	200.00 F	*200.00 F
Total Parts (\$\$)					3,576.00	3,576.00

F=Franchise part.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	CONTRACTOR LABOUR	New	4,500.00	4,500.00
2	WORKSHOP LABOUR	New	188.00	188.00
3	ADVERTISEMENT (NPA)	New	0.00	0.00
Gross Labour Cost (\$)			4,688.00	4,688.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >