

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORTAllianz Insurance Singapore Pte. Ltd.
79 Robinson Road #09-01
Singapore 068897**Our File No:** CS6/AIS22012051/TVY3E2**Date:** 16/03/2023**REFERENCE**

Insured/Claimant:	CHEN DESHENG	Policy No:	SP2002011877-01	
Date of Loss:	21/11/2022	Nature of Claim:	OD	Claim No: 202222008335/SL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKT8618E		
Make & Model:	MERCEDES-BENZ CLA180, 1.6 (R18 BI) (A)	Engine No:	27091030665978
Reg. Date:	25/06/2015 (Man. Year: 2015)	Chassis No:	WDD1173422N216610
Colour:	Blue	Odometer:	112914 km
Engine Capacity:	1595 cc		
Market Value/New Car Price:	S\$75,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	225/40 R18	Rear Tyre Size:	225/40 R18
Front Left Side:	Goodyear 6 mm	Rear Left Side:	Goodyear 6 mm
Front Right Side:	Goodyear 6 mm	Rear Right Side:	Goodyear 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	10,845.90	9,542.40	1,303.50	12.02
Miscellaneous Items	0.00	0.00	0.00	
Labour	2,180.00	1,280.00	900.00	41.28
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	13,025.90	10,822.40	2,203.50	16.92
Approved Total (Overridden) (S\$)		8,650.00		
(S\$)	13,025.90	8,650.00	4,375.90	33.59
+ GST 0.00/8.00% (S\$)	0.00	692.00	-692.00	
Nett Amount (S\$)	13,025.90	9,342.00	3,683.90	28.28

INSPECTION

Date of Assignment:	01/12/2022 Present Location:	Chew Goon Motor (AMK) Chew Goon Motor (AMK)
Date Inspected:	02/12/2022 Inspected At:	Blk 10 Ang Mo Kio Industrial Park 2A, #01-15/16 & 17, AMK Autopoint Singapore 568047
Estimated Period of Repair:	4.0 days	

Adjuster: MOHD TAUFIKH BIN HAMID**Manager:** VERON CHEN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 16 Mar 2023)
Parts:	143	MERCEDES-BENZ CLA180 1.6 (R18 BI) (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKT8618E)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*Grille (WCP)	Cracked	350.00 F	*350.00 F
2	1		*Grille Emblem (WCP)	Missing	75.00 F	*75.00 F
3	1		*Grille Emblem Base Bracket (WCP)	Cracked	38.00 F	*38.00 F
4	1		*Front Bumper (WCP)	Deformed	650.00 F	*650.00 F
5	10		*Front Bumper Clips (WCP)	Necessary	40.00 F	*40.00 F
6	2		*Front Bumper Brackets (WCP)	Bent	250.00 F	*250.00 F
7	1		*Front Bumper Sponge (WCP)	Deformed	100.00 F	*100.00 F
8	1		*Front Bumper Reinforcement (WCP)	Bent	225.00 F	*225.00 F
9	1		*Front Bumper Center Air Grille (WCP)	Deformed	76.00 F	*76.00 F
10	1		*Front Bumper Sensor (WCP)	Not Working	135.00 F	*135.00 F
11	4		*Front Bumper Sensor Holders (WCP)	Necessary	100.00 F	*100.00 F
12	1		*Front Bumper Top Core (WCP)	Broken	150.00 F	*150.00 F
13	1		*Front Bumper Top Beam (WCP)	Not Necessary	220.00 F	*- F
14	1		*Front Bumper Inner Side Cores (2PCS)(WCP)	Broken (1Pc Only)	90.00 F	*45.00 F
15	2		*Front Bumper Top Retainers (WCP)	Distorted	50.00 F	*50.00 F
16	1		*Front Bumper Inner Collision Preventive Sensor (WCP)	Not Working	135.00 F	*135.00 F
17	1		*Front Bumper Inner Collision Preventive Sensor Module (WCP)	Cracked	1,320.00 F	*1,320.00 F
18	1		*Front Bumper Emblem (WCP)	Necessary	30.00 F	*30.00 F
19	1		*Front Bumper Top Rubber Seal (WCP)	Deformed	30.00 F	*30.00 F
20	1		*Front Bumper Number Plate Holder (WCP)	Deformed	80.00 F	*80.00 F
21	2		*Headlamps (WCP)	Cracked	2,900.00 F	*2,900.00 F
22	1		*Support Panel (WCP)	Bent	275.00 F	*275.00 F
23	1		*Air Con Condenser (WCP)	Bent	540.00 F	*540.00 F
24	1		*Air Con Condenser Side Air Guide (WCP)	Not Necessary	120.00 F	*- F
25	1		*Turbo Inter-Cooler (WCP)	Bent	450.00 F	*450.00 F

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
26	1		*Radiator (WCP)	Bent	590.00 F	*590.00 F
27	1		*Bonnet (WCP)	Repair	800.00 F	*- F
28	1		*Front Number Plate	Cracked	45.00 FS	*45.00 FS

F=Franchise part. S=SpcNett.

Sub Total (S\$)	9,864.00	8,679.00
+ Margin on L,N Items 10.00/10.00% (S\$)	981.90	863.40
Total Parts (S\$)	10,845.90	9,542.40

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	To Conduct Electrical Check, Focus Headlamp	New	30.00	30.00
2	To Remove / Refit Air Con Condenser & Refill Air Con Gas	New	100.00	100.00
3	To Remove / Refit, Radiator System, Bleed, Refill Coolant	New	50.00	50.00
4	Labour Charge - Panel Beating, Repairing of Front Chassis, Inner Panel, Front Fender & Part Replacement	New	600.00	500.00
5	To Respray Affected Areas	New	1,400.00	600.00
Gross Labour Cost (S\$)			2,180.00	1,280.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >