

ASS. REC. BY:

REF: AIG/22012075/kp

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s Auto work

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rport: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 05 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: 01/27 Person Contacted: _____ Vehicle: IN / OUT

Veh No: SGQ 3375B Yr Regn: 01, 17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or MPV

Make: Honda Steer c.c. 1799

Colour: Black A/C: Insured / Std / NI / NA

Sp. Reading: 514251 T/Radio: Insured / Std / NI / NA

Eng/No: _____ C/No: RNG 1018207

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / STD A/Rim or

Tyre Size: F: 195T65R15
R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or CST

Front R/Bal. 8 mm Rear R/Bal. 8 mm

L/Bal. 8 mm L/Bal. 8 mm

D.O.A. 30/11/22 D.O.I. 5/12/2022

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or cls Rear

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

26/12 11Ry @ 2300L Confer

Date/Time, File Pass to?

: Prel. Report
 : Final Report

Days Of Repair: _____

Resurvey No. of Trlp: _____

Survey Fee:

Transportation

\$ - RS. \$

Fuel

Others

TOTAL

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech Invs (\$)
 : Weekend (\$)

Date/Time, File Return to?

1)

Date/Time, File Return to?

2)

Report Format :

Lump Sum / I.B.I: (\$)

AUTOWORX HOUSE

176 SIN MING DRIVE #02-01 SINGAPORE 575721
 TEL : 6452 8211 FAX : 6451 7420

*Not Authorized
 L1 Pay @ 2300hr
 Return After Paym
 5 days*

ESTIMATE

SAFE N SWIFT
 c/o 46 Lenton Plain
 Singapore 786548

Date: 2/12/2022

QUANTITY	PARTICULARS	AMOUNT (\$)
RE: HONDA STREAM / SGQ 3375 B		
1 pc	rear bumper <i>688</i>	<i>B</i> 974.70 ✓
1 pc	rear bumper side retainer	<i>CM</i> 73.40 ✓
1 pc	rear tail lamp assy <i>446</i>	<i>CM</i> 782.60 ✓
1 pc	rear fender <i>928.70</i>	<i>B</i> 1,067.56 ✓
1 pc	rear fender quarter glass moulding <i>82-40</i>	<i>M</i> 574.20 ✓
	Sub-total	3,472.46
	Less 20%	694.49
	Sub-total	2,777.97
1 tube	windscreen glass sealant s.nett	<i>M</i> <i>40hr</i> 60.00
	To remove & replace parts, realign & panel beat the affected areas.	<i>600</i> 1,400.00
	To spray painting on affected areas.	<i>400</i> 600.00
	To apply rust proofing.	100.00 <i>30</i>
	To remove and refit quarter windscreen glass.	<i>60</i> 140.00
	To apply water proof sealant on jointed panels.	<i>20</i> 100.00
	Total	5,177.97

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:
 Date: