

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/CT122012328/GQP3E2**Date:** 15/03/2023REFERENCEHandling Insurer: China Taiping Insurance  
(Singapore) Pte. Ltd.

Policy No: DMHCSNW00001612200

**Claimant Vehicle  
No :** SKT8656U**Insured Vehicle  
No :** SMR7208Z

Date of Loss: 07/12/2022

Nature of Claim: TP

Claim  
No: SNM22D208824/C02/LEWLCDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **SKT8656U**

Make &amp; Model: BMW 316I, 1.6 (A)

Engine No: A121J859N13B16A

Reg. Date: 25/06/2015 (Man. Year: 2014)

Chassis No: WBA3A16040NS38893

Colour: Black

Odometer: 102028 km

Engine Capacity: 1598 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/60 R16	Rear Tyre Size:	205/60 R16
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

INSPECTION

Date of Assignment: 09/12/2022

Date Inspected: 09/12/2022

Inspected At:

Precise Auto Service (HQ)  
No 1 Kaki Bukit Ave 6, #02-34/36  
Singapore 417883

Estimated Period of Repair: 5.0 days

**Adjuster:** XING GUO QIANG**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$6,000.00  
-\$7,000.00

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 15 Mar 2023)
Parts:	143	BMW 316I 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKT8656U)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

## Recommended Miscellaneous Items

There are no new miscellaneous items selected.

## Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

**< END OF ESTIMATES >**