

LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLH 8184R

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	REAR BUMPER (CONSISTENT)	BENT	620.00	495.40
1	REAR BUMPER REINFORCEMENT (CONSISTENT)	BENT	450.00	329.60
1	REAR BUMPER SPONGE (CONSISTENT)	CRACKED	125.00	125.00
1	REAR BUMPER RH PROTECTOR (CONSISTENT)	SERVICEABLE	32.00	-
1	REAR BUMPER LOWER DIFFUSER GARNISH (CONSISTENT)	BENT	320.00	320.00
2	REAR BUMPER SIDE RETAINER LH & RH (CONSISTENT)	DISTORTED	130.00	130.00
2	REAR BUMPER REFLECTOR LH & RH (CONSISTENT)	O/S CRACKED	160.00	80.00
1	BOOTLID (CONSISTENT)	BENT	1,180.00	1,180.00
2	BOOTLID LAMP ASSY LH & RH (CONSISTENT)	MTG CRACKED	880.00	880.00
2	BOOTLID HINGE LH & RH (CONSISTENT)	TO REPAIR SEE LABOUR	320.00	-
1	BOOTLID INNER TRIM BOARD (CONSISTENT)	SERVICEABLE	330.00	-
1	BOOTLID ELANTRA EMBLEM (CONSISTENT)	NECESSARY	75.00	75.00
1	BOOTLID S LOGO EMBLEM (CONSISTENT)	NECESSARY	65.00	65.00
1	BOOTLID HYUNDAI LOGO EMBLEM (CONSISTENT)	NECESSARY	85.00	85.00
1	BOOTLID INNER LOCK (CONSISTENT)	DENTED	285.00	166.70
2	TAIL LAMP LH & RH (CONSISTENT)	CUT	1,100.00	1,100.00
1	REAR END PANEL (CONSISTENT)	BENT	450.00	450.00
1	END PANEL TOP GARNISH (CONSISTENT)	MTG DISTORTED	155.00	155.00
1	END PANEL TOP GARNISH CLIPS (CONSISTENT)	NECESSARY	38.00	38.00
2	REAR FENDER INNER TRIM BOARD LH & RH (CONSISTENT)	SERVICEABLE	550.00	-
2	SET REAR FENDER INNER TRIM BOARD FASTERNERS LH & RH (CONSISTENT)	NOT NECESSARY	58.00	-
2	REAR CAR PLATE LAMP LH & RH (CONSISTENT)	SERVICEABLE	125.00	-
1	SPARE TYRE PANEL (CONSISTENT)	TO REPAIR SEE LABOUR	780.00	-
1	SPARE TYRE PANEL BOARD ASSY (CONSISTENT)	SERVICEABLE	310.00	-
1	REAR EXHAUST MUFFLER (CONSISTENT)	TO REPAIR SEE LABOUR	580.00	-
	LESS 20% DISCOUNT		-1,840.60	-1,134.94
			7,362.40	4,539.76

Report Ref No. CS/ASM22012593/Kwp3m4



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$))	Our Adjusted (\$)
1	BOOTLID WEATHERSTRIP (\$265.40) (50%) (SN) (CONSISTENT)	DISTORTED/ DENTED	325.00	132.70
	LESS 20% DISCOUNT		-65.00	-
			260.00	132.70
	SPECIAL NETT ITEMS			
1	REVERSE SENSOR (SN) (CONSISTENT)	SHORTED	200.00	200.00
1	END PANEL SEALANT (SN) (CONSISTENT)	NECESSARY	60.00	30.00
1	SPARE TYRE PANEL SEALANT (SN) (CONSISTENT)	NOT NECESSARY	60.00	-
1	REAR INSULATOR PAD (SN) (CONSISTENT)	NOT NECESSARY	120.00	-
1	REAR CAR PLATE WITH HOUSING (SN) (CONSISTENT)	SERVICEABLE	50.00	-
1	REVERSE CAMERA (SN) (CONSISTENT)	SERVICEABLE	250.00	-
			740.00	230.00
	<u>LABOUR</u>			
	TO PANEL BEAT AND RENEWAL OF ALL NECESSARY DAMAGED BODY PARTS. INCLUSIVE OF THE REPAIR OF BOOTLID HINGE LH & RH, SPARE TYRE PANEL AND REAR EXHAUST MUFFLER.		800.00	600.00
	TO CHECK WIRING AND REWIRE.		60.00	20.00
	TO REMOVE & REFIX REVERSE SENSOR.		80.00	50.00
	TO REMOVE & REFIX EXHAUST MUFFLER.	NOT NECESSARY	80.00	-
	TO ANTI-RUST.		100.00	60.00
	TO REINSTALL REVERSE CAMERA.		80.00	40.00
	TO REMOVE AND REINSTALL BOOTLID COMPONENTS.		80.00	50.00
	TO REMOVE AND REINSTALL BOOTLID UPHOLSTERY.		80.00	60.00
	TO REALIGN REAR CHASSIS MEMBER.	NOT NECESSARY	250.00	-
	TO PUTTY AND SPRAY-PAINT OF AFFECTED AREAS.		1,000.00	600.00
			2,610.00	1,480.00
	GRAND TOTAL		10,972.40	6,382.46



Page No.:3 of 3

RECOMMENDED COST OF LUMP SUM REPAIRS		4,950.00
(TO ITS PRE-ACCIDENT CONDITION)		

Report Ref No. CS/ASM22012593/Kwp3m4

KONG SENG CHEONG

Licensed Appraiser