

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22012756/GVY3M4**Date:** 03/02/2023**REFERENCE**

Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd.	Policy No:	DMHCSNA00017352200
Claimant Vehicle No :	SKC6050U	Insured Vehicle No :	SLF1032C
Date of Loss:	13/12/2022	Nature of Claim:	TP
		Claim No:	SNM22D209050/C02/LEWLC

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKC6050U		
Make & Model:	TOYOTA COROLLA ALTIS, 1.6 (A)	Engine No:	1ZRX120320
Reg. Date:	14/09/2011 (Man. Year: 2011)	Chassis No:	MR053REE104121975
Colour:	White	Odometer:	162050 km
Engine Capacity:	1598 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	205/65 R15	Rear Tyre Size:	205/65 R15
Front Left Side:	Yokohama 5 mm	Rear Left Side:	Yokohama 5 mm
Front Right Side:	Yokohama 5 mm	Rear Right Side:	Yokohama 5 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,490.23	5,962.25	5,527.98	48.11
Miscellaneous Items	0.00	0.00	0.00	
Labour	6,250.00	2,190.00	4,060.00	64.96
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	17,740.23	8,152.25	9,587.98	54.05
Approved Total (Overridden) (S\$)		6,500.00		
(S\$)	17,740.23	6,500.00	11,240.23	63.36
+ GST 7.00/7.00% (S\$)	1,241.82	455.00	786.82	63.36
Nett Amount (S\$)	18,982.05	6,955.00	12,027.05	63.36

INSPECTION

Date of Assignment:	28/12/2022	
Date Inspected:	22/12/2022 Inspected At:	Yew Tee Automobile Tech Pte Ltd 39 Woodlands Close, MEGA@Woodlands #01-12 Singapore 737856
Estimated Period of Repair:	7.0 days	

Adjuster: XING GUO QIANG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 03 Feb 2023)
Parts:	143	TOYOTA COROLLA ALTIS 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKC6050U)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Deformed	756.47 FL	*624.00 FL
2	1		*FRONT BUMPER SIDE RETAINER LH	Not Necessary	58.00 FL	*- FL
3	1		*FRONT BUMPER SIDE RETAINER RH	Not Necessary	58.00 FL	*- FL
4	1		*FRONT BUMPER BRACKET LH	Broken	62.00 FL	*62.00 FL
5	1		*FRONT BUMPER BRACKET RH	Not Necessary	62.00 FL	*- FL
6	1		*FRONT GRILLE	Broken	486.70 FL	*381.00 FL
7	1		*FRONT GRILLE LOGO	Necessary	85.00 FL	*85.00 FL
8	1		*FRONT GRILLE CHROME MOULDING	Not Necessary	294.80 FL	*- FL
9	1		*BONNET	Bent	1,100.00 FL	*796.00 FL
10	1		*BONNET HINGES LH	Bent	160.00 FL	*160.00 FL
11	1		*BONNET HINGES RH	Bent	160.00 FL	*160.00 FL
12	1		*FRONT SUPPORT PANEL	Repair	535.00 FL	*- FL
13	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	480.00 FL	*- FL
14	1		*FRONT FENDER LH	Not Necessary	330.00 FL	*- FL
15	1		*FRONT HEADLAMP LH	Broken	650.00 FL	*650.00 FL
16	1		*FRONT HEADLAMP RH	Broken	650.00 FL	*650.00 FL
17	1		*REAR BUMPER	Deformed	710.00 FL	*482.00 FL
18	1		*REAR BUMPER SIDE RETAINER LH	Not Necessary	65.00 FL	*- FL
19	1		*REAR BUMPER SIDE RETAINER RH	Not Necessary	65.00 FL	*- FL
20	1		*REAR BUMPER BRACKET LH	Broken	75.00 FL	*75.00 FL
21	1		*REAR BUMPER BRACKET RH	Broken	75.00 FL	*75.00 FL
22	1		*REAR BUMPER REINFORCEMENT	Bent	380.00 FL	*380.00 FL
23	1		*REAR BUMPER REFLECTOR LH	Not Necessary	110.00 FL	*- FL
24	1		*REAR BUMPER REFLECTOR RH	Not Necessary	110.00 FL	*- FL
25	1		*REAR BOOT LID	Bent	780.00 FL	*780.00 FL
26	1		*REAR BOOT LID HINGES LH	Not Necessary	170.00 FL	*- FL
27	1		*REAR BOOT LID HINGES RH	Not Necessary	170.00 FL	*- FL
28	1		*REAR BOOT LID LOGO	Necessary	68.00 FL	*68.00 FL
29	1		*REAR BOOT LID COROLLA EMBLEM	Necessary	55.00 FL	*55.00 FL
30	1		*REAR BOOT LID ALTIS EMBLEM	Necessary	58.00 FL	*58.00 FL
31	1		*REAR BOOT LID VVTI EMBLEM	Necessary	55.00 FL	*55.00 FL
32	1		*REAR BOOT LID DUAL EMBLEM	Necessary	60.00 FL	*60.00 FL
33	1		*REAR BOOT LID 1.6 EMBLEM	Necessary	58.00 FL	*58.00 FL
34	1		*REAR BOOT LID REFLECTOR LH	Not Necessary	170.00 FL	*- FL
35	1		*REAR BOOT LID REFLECTOR RH	Cut	170.00 FL	*170.00 FL
36	1		*REAR BOOT LID OUTER CHROME MOULDING	Not Necessary	310.00 FL	*- FL
37	1		*REAR BOOT LID LOCK	Cut	430.00 FL	*430.00 FL
38	1		*REAR BOOT LID LOCK CATCH	Not Necessary	120.00 FL	*- FL
39	1		*REAR TAILLAMP RH	Cut	455.00 FL	*455.00 FL
40	1		*REAR TAILLAMP PANEL RH	Repair	480.00 FL	*- FL
41	1		*REAR END PANEL	Dented	980.00 FL	*590.00 FL
42	1		*REAR END PANEL TOP GARNISH	Deformed	270.00 FL	*184.00 FL
43	1		*REAR FENDER RH	Repair	1,250.00 FL	*- FL
44	1		*REAR SPARE TYRE PANEL	Not Necessary	870.00 FL	*- FL
45	1		*REAR SPARE TYRE BOARD	Not Necessary	250.00 FL	*- FL
46	1		*FRONT NUMBER PLATE	Bent	45.00 FS	*45.00 FS

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*SET FRONT BUMPER CLIPS	Necessary	40.00 FS	*30.00 FS
48	1		*REAR NUMBER PLATE	Not Necessary	45.00 FS	*- FS
49	1		*SET REAR BUMPER SENSORS	Shorted	260.00 FS	*200.00 FS
50	1		*SET REAR BUMPER CLIPS	Necessary	40.00 FS	*30.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$)	15,176.97	7,848.00
- List Item Discount on L Items 25.00/25.00% (\$)	3,686.74	1,885.75
Total Parts (\$)	11,490.23	5,962.25

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISCONNECT AND RECONNECT, CHECK ELECTRICAL WIRING HARNESS WIRE, SOCKETS, REPLACE DAMAGED PARTS	New	60.00	30.00
2	TO REMOVE AND REFIT REAR BUMPER SENSOR	New	80.00	40.00
3	TO REMOVE AND REFIT CARPET AND TRIMS ON THE REAR SECTION TO GIVE WAY TO THE REPAIR ON THE REAR SECTION	New	100.00	60.00
4	TO REMOVE AND REPLACE THE ABOVE DAMAGED PARTS, STRAIGHTEN, KNOCK OUT, REALIGN AND REPAIR INCLUDING CUT AND WELD BODY PANELS. TO RE-ADJUST TO THE ORIGINAL POSITION USING POWER TOOLS	New	3,800.00	800.00
5	TO SUPPLY SPRAY TEROSTAT SEALANT ON THE CUTTING AREAS	New	70.00	30.00
6	TO APPLY UNDERCOATING ON THE REPAIRED AND REPLACED PANELS FOR RUST PROTECTION	New	60.00	30.00
7	TO CARRY-OUT BODY CAVITY PRESERVATION	New	80.00	0.00
8	TO SPRAY PAINTING ON THE REPLACED AND REPAIR PARTS, PREPARE SPRAY SUCH AS MASKING TAPE THE UNAFFECTED AREAS WITH PAPER, CLEANING AND SANDING OF SURFACES, FINAL POLISHING AND WAXING ARE ALSO AVAILABLE	New	2,000.00	1,200.00
Gross Labour Cost (S\$)			6,250.00	2,190.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >