



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMN 9578M

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT BUMPER (CONSISTENT)	CUT / TORN	686.00	686.00
2	FRONT BUMPER SIDE RETAINER RH/LH @\$38.00 (CONSISTENT)	NOT NECESSARY	76.00	-
1	FRONT FENDER RH (CONSISTENT)	DENTED / BENT	486.00	486.00
1	FRONT FENDER INNER SHIELD RH (CONSISTENT)	NOT NECESSARY	132.00	-
1	FRONT SHOCK ABSORBER RH (CONSISTENT)	NOT NECESSARY	426.00	-
1	FRONT SHOCK ABSORBER TOP MOUNT (CONSISTENT)	NOT NECESSARY	189.00	-
1	FRONT LOWER ARM (CONSISTENT)	BENT	396.00	396.00
1	FRONT KNUCKLE ARM (CONSISTENT)	BENT	415.00	415.00
1	FRONT WHEEL HUB BEARING (CONSISTENT)	DAMAGED	432.00	432.00
1	FRONT ANTO ROLL BAR (CONSISTENT)	NOT NECESSARY	226.00	-
1	FRONT ANTO ROLL BAR LINK (CONSISTENT)	NOT NECESSARY	89.00	-
1	FRONT HEADLAMP RH (CONSISTENT)	NOT NECESSARY	1,895.00	-
	LESS 10% DISCOUNT		-544.80	-241.50
			4,903.20	2,173.50
<b><u>SPECIAL NETT ITEMS</u></b>				
1	FRONT BUMPER LOWER SPOILER (SN) (CONSISTENT)	CUT / DEFORMED	850.00	850.00
1	SET FRONT BUMPER CLIP (SN) (CONSISTENT)	NECESSARY	45.00	45.00
1	FRONT WHEEL (SN) (CONSISTENT)	CUT	550.00	400.00
1	FRONT TYRE (SN) (CONSISTENT)	SERVICEABLE	250.00	-
			1,695.00	1,295.00
<b><u>LABOUR</u></b>				
	TO CHECK ELECTRICAL WIRING.		40.00	20.00
	TO REMOVE AND REPLACE FRONT UNDERCARRIAGE PARTS.		300.00	120.00
	TO PERFORM 4 WHEEL ALIGNMENT.		120.00	100.00
	TO TUFF KOTE.		50.00	30.00
	TO PUTTY, SPRAY PAINT & POLISH AFFECTED PARTS .		800.00	300.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO PANEL BEAT ,CUT ,WELD ,REMOVE & REPLACE DAMAGED PARTS.		800.00	600.00
			2,110.00	1,170.00
<b>GRAND TOTAL</b>			<b>8,708.20</b>	<b>4,638.50</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>3,700.00</b>

Report Ref No. CC4/ASM22012766/Upa3q2

**CHUA KANG SENG**

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.