

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI22012790/UNY3Q2**Date:** 05/01/2023**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMCVSNW00145302203

Claimant Vehicle No : SJJ2286H **Insured Vehicle No :** YN480C

Date of Loss: 20/12/2022 Nature of Claim: TP Claim No: SNM22D209195/C02/TAYHP

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SJJ2286H**

Make & Model: MERCEDES-BENZ GLA200 SPORT, 1.3 (A) Engine No: 28291480440773

Reg. Date: 08/06/2021 (Man. Year: 2020) Chassis No: W1N2477872J171144

Colour: White Odometer: 14568 km

Engine Capacity: 1332 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 235/55 R18 Rear Tyre Size: 235/55 R18

Front Left Side: Continental 7 mm Rear Left Side: Continental 7 mm

Front Right Side: Continental 7 mm Rear Right Side: Continental 7 mm

The above values represent the remaining tyre tread depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	13,057.45	6,782.93	6,274.52	48.05
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,460.00	1,390.00	2,070.00	59.83
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	16,517.45	8,172.93	8,344.52	50.52
Approved Total (Overridden) (S\$)		6,500.00		
Nett Amount (S\$)	16,517.45	6,500.00	10,017.45	60.65

INSPECTION

Date of Assignment: 04/01/2023

Date Inspected: 22/12/2022 Inspected At: 2ND Auto Pte Ltd (HQ)
15 Kaki Bukit Road 4, #01-05/53 Bartley Biz Centre
Singapore 417808

Estimated Period of Repair: 4.0 days

Adjuster: MARCUS CHUA**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 05 Jan 2023)
Parts:	M1-SUV	MERCEDES-BENZ GLA200 SPORT 1.3 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SJJ2286H)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAILGATE	Dented	2,370.50 FL	*2,370.50 FL
2	1		*REAR TAILGATE TOP SPOILER (NPA)	Not Necessary	0.00 FL	*- FL
3	1		*REAR TAILGATE CENTRE PANEL	No such part	782.00 FL	*- FL
4	1		*REAR TAILGATE CENTRE BADGE	Necessary	72.00 FL	*72.00 FL
5	1		*REAR TAILGATE GLA 200 EMBLEM	Necessary	112.00 FL	*105.00 FL
6	1		*REAR TAILGATE INNER LOCK	Not Necessary	328.00 FL	*- FL
7	1		*REAR TAILGATE INNER LOCK CATCH	Not Necessary	79.20 FL	*- FL
8	1		*REAR TAILGATE AUTO POWER ASSY (NPA)	Not Necessary	0.00 FL	*- FL
9	1		*REAR TAILGATE INNER TRIM (NPA)	Not Necessary	0.00 FL	*- FL
10	1		*REAR TAILGATE REFLECTORS	N/S Cracked	1,156.40 FL	*578.20 FL
11	1		*REAR TAILGATE DAMPERS (NPA)	Not Necessary	0.00 FL	*- FL
12	1		*REAR TAILGATE WINDSCREEN (NPA)	Not Necessary	0.00 FL	*- FL
13	1		*REAR TAILGATE WIPER MOTOR /BLADE (NPA)	Not Necessary	0.00 FL	*- FL
14	1		*REAR TAILGATE NO PLATE LAMPS (NPA)	Not Necessary	0.00 FL	*- FL
15	1		*REAR WINDSCREEN MOULDING	Necessary	185.00 FL	*185.00 FL
16	1		*REAR BUMPER	Deformed / Torn	2,535.00 FL	*1,545.00 FL
17	1		*REAR LOWER BUMPER	Cut / Torn	585.00 FL	*585.00 FL
18	1		*REAR LOWER BUMPER CHROME LINING	Cracked	592.00 FL	*425.00 FL
19	1		*REAR BUMPER TOP CHROME	Cracked	250.00 FL	*250.00 FL
20	2		*REAR LOWER BUMPER BRACKET SUPPORT	Not Necessary	142.00 FL	*- FL
21	1		*REAR BUMPER REFLECTOR (N/S)	Cracked	96.00 FL	*68.00 FL
22	1		*REAR BUMPER SIDE FRAME	N/S Twisted	300.00 FL	*150.00 FL
23	2		*REAR BUMPER BRACKET	Not Necessary	150.00 FL	*- FL
24	1		*REAR BUMPER INNER FRAME	Cracked	292.00 FL	*292.00 FL
25	1		*REAR BUMPER REINFORCEMENT	Bent	572.00 FL	*572.00 FL
26	1		*REAR END PANEL	Repair	625.00 FL	*- FL
27	1		*REAR END PANEL TOP GARNISH	Not Necessary	278.00 FL	*- FL
28	1		*SET REAR END PANEL TOP GARNISH CLIPS	Not Necessary	60.00 FL	*- FL
29	1		*REAR END PANEL OUTER COVER	Not Necessary	142.00 FL	*- FL
30	2		*RHS & LHS TAILLAMP	Not Necessary	1,956.40 FL	*- FL
31	1		*REAR NUMBER PLATE	Not Necessary	75.00 FS	*- FS
32	1		*REAR WINDSCREEN SEALANT	Necessary	100.00 FS	*40.00 FS
33	1		*REAR WINDSCREEN INNER SEAL	Necessary	80.00 FS	*40.00 FS
34	1		*REAR END PANEL SEALANT	Not Necessary	100.00 FS	*- FS
35	1		*REAR WINDSCREEN VIDEO CAM (NPA)	Not Necessary	0.00 FS	*- FS
36	1		*REAR PDC SENSOR	Shorted	380.00 FS	*225.00 FS
37	1		*REAR BUMPER TOW COVER	Not Necessary	28.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	14,423.50	7,502.70
- List Item Discount on L Items 10.00/10.00% (\$\$)	1,366.05	719.77
Total Parts (\$\$)	13,057.45	6,782.93

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS ,REPLACE DAMAGED PARTS AND COMPONENTS	New	1,400.00	500.00
2	TO SUPPLY PAINT MATERIALS ,EXPANDABLE ITEMS & PUTTY ,RESPRAY PAINT ON PARTS REPLACED	New	1,000.00	600.00
3	TO REMOVE ,REFIX WIRING SYSTEM AT ACCIDENT DAMAGED AREAS AND CHECK FOR PROPER FUNCTION	New	150.00	20.00
4	TO REMOVE/REFIX INNER TRIMS ,FITTINGS ,GARNISH ETC AT REAR COMPARTMENT SO AS TO FACILITATE REPAIRS AT REAR	New	120.00	60.00
5	TO REMOVE AND REFIX REAR WINDSCREEN	New	120.00	120.00
6	TO CLEAR FAULT CODE WITH DIAGNOSTIC COMPUTER AND RESET TO SPECIFICATION	New	250.00	0.00
7	TO REMOVE AND REFIX PDC & REPLACE REVERSE SENSORS AND CHECK FOR PROPER FUNCTION	New	180.00	50.00
8	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	New	240.00	40.00
Gross Labour Cost (\$\$)			3,460.00	1,390.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >