

J&M CONSULTANCY PTE LTD

11 Changi South Lane #02-08
ONN WAH BUILDING Singapore 486154
Company Reg No: 202125502E
Tel: 6214-0474 Fax: 6384-5205

VEHICLE INSPECTION REPORT

To: Fresh Cars Pte Ltd

Date : 5 August 2022

C/o: A-Tec Automotive Pte Ltd
8 Kaki Bukit Avenue 4
#04-20 Premier @ Kaki Bukit, Singapore 415875

Our ref : ATEC/08/0013/JM

Accident Date : 16 April 2022

Type of Survey : Third party

Inspection Date : 26 April 2022

Repairer Name : A-Tec Automotive Pte Ltd

8 Kaki Bukit Avenue 4

#04-20 Premier @ Kaki Bukit, Singapore 415875

PARTICULARS OF VEHICLE

Registration No : SND 7154 G

Make / Model : Honda/ Shuttle hybrid

Chassis No : GK82202075

Engine No : L15B6052557

Year / Capacity : 2021 / 1496 cc

Colour : Black

Mileage : 4,649 km

CONDITION OF TYRES

	Make	Size	Thread Balance
Front Nearside	: Bridgestone	185/60/ R15	80%
Front Offside	: Bridgestone	185/60/ R15	80%
Rear Nearside	: Bridgestone	185/60/ R15	80%
Rear Offside	: Bridgestone	185/60/ R15	80%

GENERAL DESCRIPTION OF DAMAGE VEHICLE

The impact damages sustained on the vehicle at the time of inspection is on the rear bumper portion.

(Details refer to the photographs attached)

Enclosed number of photographs: **37** copies

REMARKS

This inspection was conducted entirely on a **"WITHOUT PREJUDICE"** basis and we have not given authorization and instruction to the repairer to proceed with the repair.

Vehicle Registration No: SND 7154 G

Our Ref No: ATEC/08/0013/JM

RECOMMENDATIONS

We have thoroughly inspected each and every item on the estimate against the physical damage found on the vehicle and we have listed the breakdown of our finding and our recommendation.

Under normal circumstances, the repair period would be about **14 (Fourteen)** working days.

Qty	Description	Condition	Repairer's Estimate	Revised Amount
-----	-------------	-----------	---------------------	----------------

SPARE PARTS - LIST ITEMS

1	Rear bumper assy	Warped	\$ 1,650.00	\$ 1,650.00
1	Rear bumper bracket (1 set)	Warped/Necessary	\$ 480.00	\$ 480.00
1	Rear bumper retainer (1 set)	Warped/Necessary	\$ 470.00	\$ 470.00
1	Rear bumper absorber foam (1 set)	Cracked	\$ 850.00	\$ 850.00
1	Rear bumper reflector (1 set)	Cracked	\$ 490.00	\$ 490.00
1	Rear tailgate assy	Warped	\$ 1,800.00	\$ 1,800.00
1	Rear tailgate inner garnish	Reuse	\$ 685.00	\$ -
1	Rear tailgate outer garnish	Warped	\$ 585.00	\$ 585.00
1	Rear tailgate dampers (1 set)	Bent	\$ 590.00	\$ 590.00
1	Rear tailgate weatherstrip	Warped/Necessary	\$ 485.00	\$ 485.00
1	Rear tailgate lock with actuator	Bent	\$ 625.00	\$ 625.00
1	Rear taillamp inner LH	Cracked	\$ 1,800.00	\$ 1,800.00
1	Rear taillamp inner RH	Cracked	\$ 1,800.00	\$ 1,800.00
1	Rear taillamp outer LH	Cracked	\$ 2,150.00	\$ 2,150.00
1	Rear taillamp outer RH	Cracked	\$ 2,150.00	\$ 2,150.00
1	Rear exhaust muffler pipe	Reuse	\$ 880.00	\$ -
1	Rear end panel	Warped	\$ 980.00	\$ 980.00
1	Rear end panel inner	Warped	\$ 950.00	\$ 950.00
			\$ 19,420.00	\$ 17,855.00
			Less 20%	\$ 3,884.00
			\$ 15,536.00	\$ 14,284.00

SPECIAL NETT ITEMS

1	Rear bumper clip (1 set)	Necessary	\$ 100.00	\$ 100.00
1	Rear end panel sealant	Necessary	\$ 120.00	\$ 120.00
1	Rear reverse sensor (1 set)	Malfunction	\$ 650.00	\$ 650.00
1	Rear reverse camera (1 set)	Malfunction	\$ 850.00	\$ 850.00
			\$ 1,720.00	\$ 1,720.00
Total parts			\$ 17,256.00	\$ 16,004.00

Vehicle Registration No: SND 7154 G

Our Ref No: ATEC/08/0013/JM

S/No	Description	Repairer's Estimate	Revised Amount
------	-------------	---------------------	----------------

Total cost of parts c/f	\$ 17,256.00	\$ 15,984.00
-------------------------	--------------	--------------

LABOUR

1	To cut, weld, straighten affected areas and replace damaged parts.	\$ 2,800.00	\$ 2,600.00
2	To putty and spray painting the affected areas. Job Allowance.	\$ 2,800.00	\$ 2,600.00
3	To check rear lighting and wiring.	\$ 200.00	\$ 120.00
4	To remove and install rear garnish and trim to facilitate the repair.	\$ 280.00	\$ 260.00
5	To apply anti rust proofing to the affected areas.	\$ 300.00	\$ 280.00
6	To remove and install rear bumper assy.	\$ 280.00	\$ 260.00
7	To remove and install rear taillamps.	\$ 280.00	\$ 260.00
8	To remove and install tailgate assy.	\$ 280.00	\$ 260.00
9	To remove and install rear windscreen to facilitate the repair.	\$ 280.00	\$ 260.00
10	To remove and install rear reverse sensor.	\$ 280.00	\$ 260.00
11	To remove and install rear reverse camera.	\$ 280.00	\$ 260.00
12	To remove and install exhaust pipe.	\$ 280.00	\$ 260.00
13	To conduct chassis alignment	\$ 350.00	\$ 320.00

Grand Total:	\$ 25,946.00	\$ 24,004.00
---------------------	---------------------	---------------------

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a **Lump Sum Repair Contract of : \$ 19,200**

Vehicle Registration No: SND 7154 G

Our Ref No: ATEC/08/0013/JM

By accepting to carry out the repairs on a contract lump sum basis, the repairer has the discretion to replace the damaged parts with used, reconditioned or new parts, or to repair it to a roadworthy condition.

Note: The revised estimate was made from visual inspection. Should there be any discrepancy or unseen damage / item in this survey, kindly notified the company within (7) from the date hereof. Otherwise, the revised amount shall be deemed to be valid.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicles and/or other accidents in other legal proceedings.

J&M Consultancy Pte Ltd




Joel Liew Jian Xiang
Automotive Appraiser






STV
DEN NO.:
202125502E



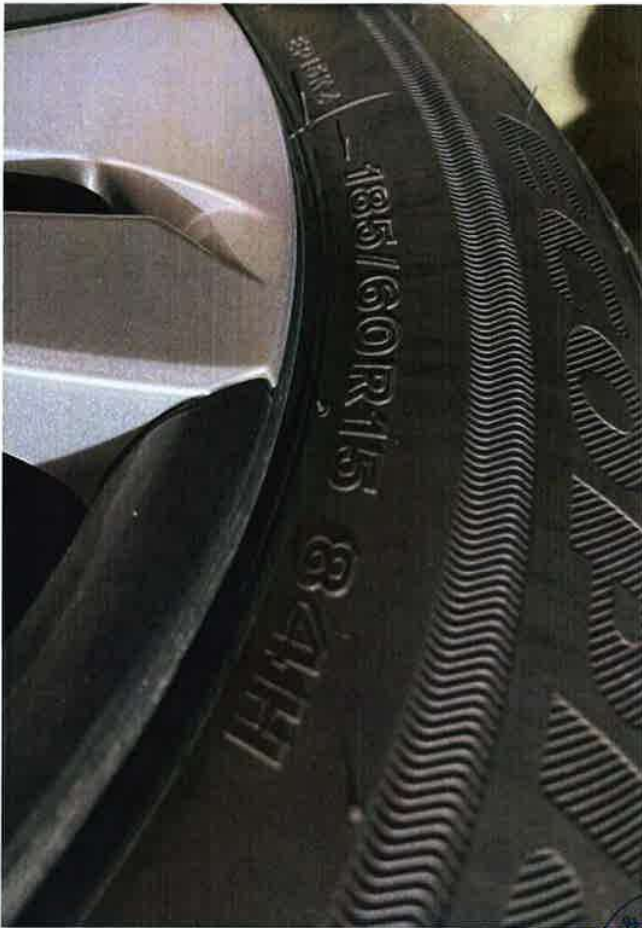






LIANCY PTE. LTD.
UEN NO. 202125502E

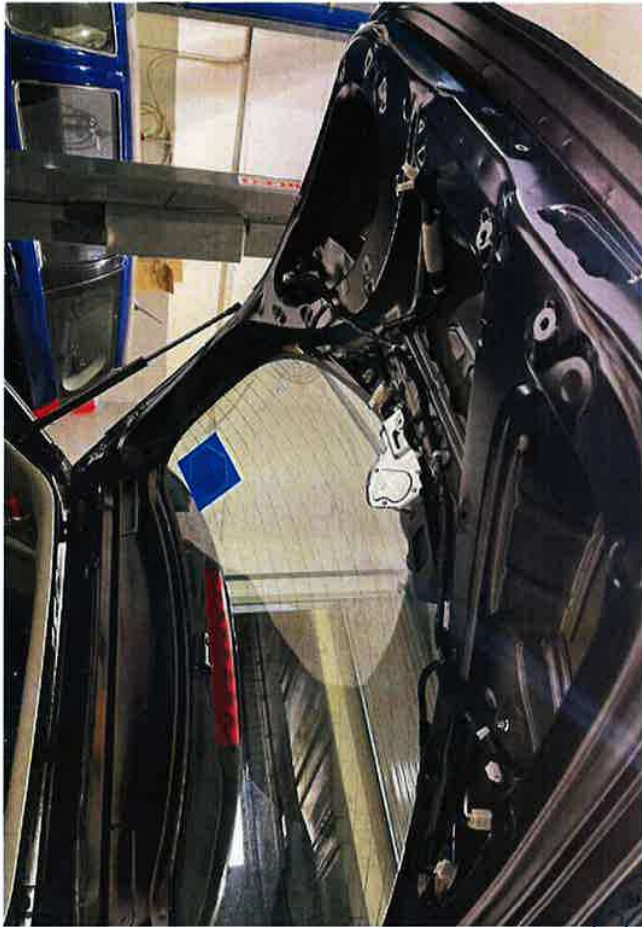

W
202125502E/

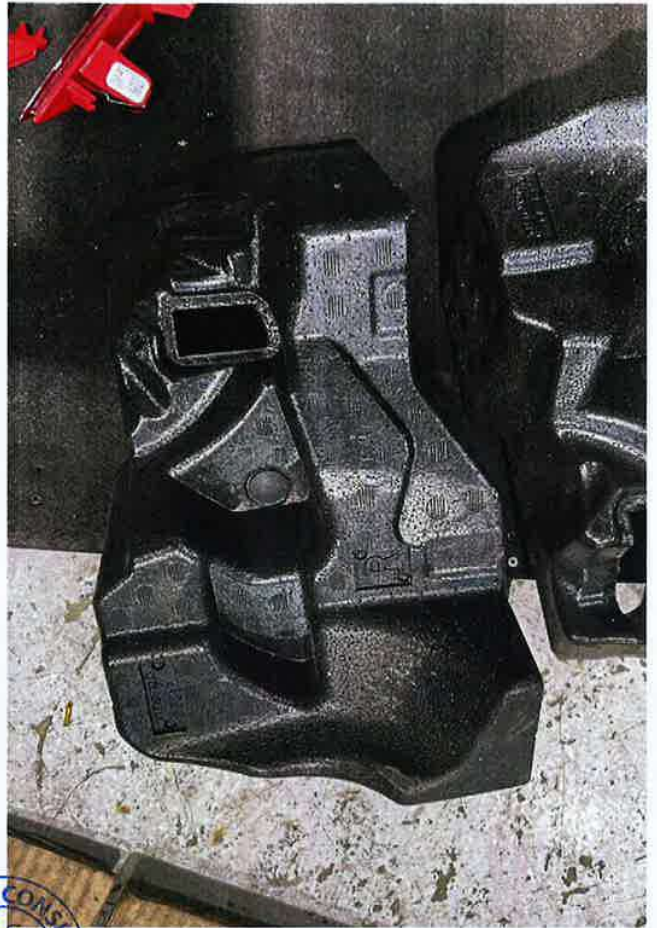

202125502E
JEN
SITE
PROJ
CONSULT

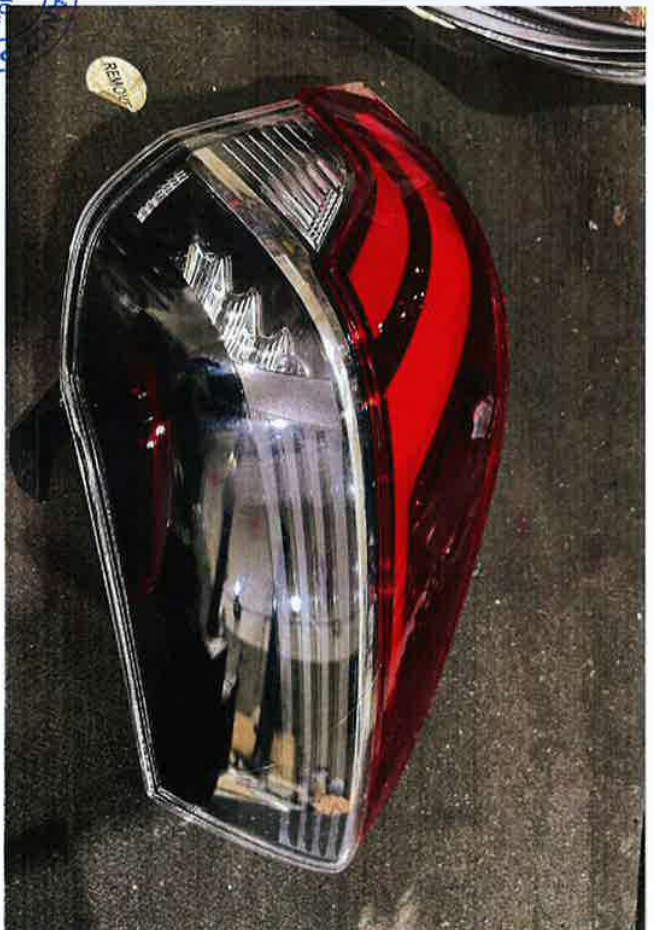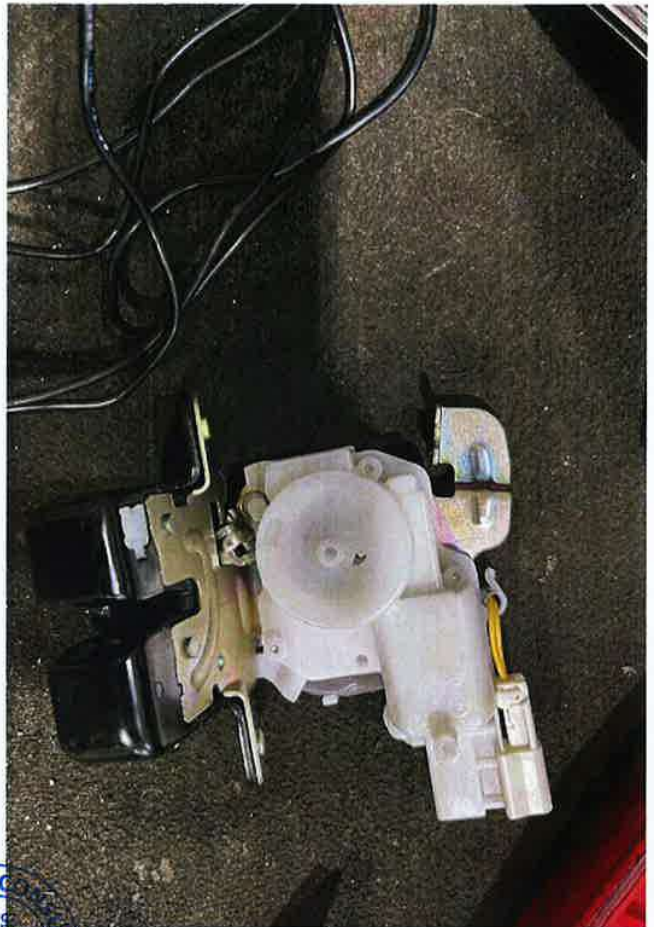

LABORATORY
FBI
20212502E
ITEM NO. 25





CONSULT
JEN N
202125502E/m