

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

ERGO Insurance Pte. Ltd.
8 Temasek Boulevard, #04-01 Suntec Tower Three
Singapore 038988

Our File No: CS/EGI22012923/AVY3M4**Date:** 18/04/2023**REFERENCE**

Insured/Claimant:	LEE WEI XIN	Policy No:	DMPG22009954	
Date of Loss:	24/12/2022	Nature of Claim:	OD	Claim No: CDMPG22002796

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SKG1080U		
Make & Model:	MAZDA CX-9, 2.5 (A)	Engine No:	PY30982559
Reg. Date:	14/08/2020 (Man. Year: 2019)	Chassis No:	JM6TC2WLAK0319839
Colour:	White	Odometer:	54417 km
Engine Capacity:	2488 cc		
Market Value/New Car Price:	S\$178,000.00		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	255/50 R20	Rear Tyre Size:	255/50 R20
Front Left Side:	Dunlop 6 mm	Rear Left Side:	Dunlop 6 mm
Front Right Side:	Dunlop 6 mm	Rear Right Side:	Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	14,820.30	14,555.20	265.10	1.79
Miscellaneous Items	40.00	40.00	0.00	0.00
Labour	1,730.00	1,530.00	200.00	11.56
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	16,590.30	16,125.20	465.10	2.80
- Excess (\$\$)	0.00	500.00	-500.00	
(\$\$)	16,590.30	15,625.20	965.10	5.82
+ GST 7.00/8.00% (\$\$)	1,161.33	1,250.02	-88.69	-7.64
Nett Amount (\$\$)	17,751.63	16,875.22	876.41	4.94

INSPECTION

Date of Assignment:	28/12/2022	Present Location:	SME Motor Pte Ltd (Kaki Bukit)
Date Inspected:	29/12/2022	Inspected At:	SME MOTOR PTE LTD 1 KAKI BUKIT AVE 6 #02-15 (AUTOBAY @KAKI BUKIT) SINGAPORE 417883
Estimated Period of Repair:	6.0 days		

Adjuster: ADRIAN LING**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 18 Apr 2023)
Parts:	M1-SUV	MAZDA CX-9 2.5 (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SKG1080U)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRT BONNET (WCP)	Dented	650.00 F	*650.00 F
2	2		*FRT BONNET HINGE (WCP)	Bent	76.00 F	*76.00 F
3	1		*FRT BONNET LOCK (WCP)	Not Necessary	110.00 F	*- F
4	1		*FRT GRILLE ASSY (WCP)	Cracked	1,850.00 F	*1,850.00 F
5	1		*FRT GRILLE CENTER LOGO (WCP)	Necessary	75.00 F	*75.00 F
6	1		*FRT GRILLE LOGO BASE (WCP)	Not Necessary	75.00 F	*- F
7	1		*FRT GRILLE TOP GARNISH (WCP)	Deformed	260.00 F	*260.00 F
8	6		*FRT GRILLE TOP GARNISH CLIP (WCP)	Necessary	18.00 F	*18.00 F
9	1		*FRT BUMPER AGENT (WCP)	Deformed	980.00 F	*980.00 F
10	2		*FRT BUMPER RETAINER (WCP)	Not Necessary	56.00 F	*- F
11	10		*FRT BUMPER CLIP (WCP)	Necessary	25.00 F	*25.00 F
12	1		*FRT BUMPER INNER SPONGE AGENT (WCP)	Cracked	130.00 F	*130.00 F
13	1		*FRT BUMPER REINFORCEMENT (WCP)	Dented	380.00 F	*380.00 F
14	1		*FRT BUMPER REINFORCEMENT OUTER GARNISH AGENT (WCP)	Cracked	195.00 F	*195.00 F
15	1		*NUMBER PLATE GARNISH (WCP)	Deformed	75.00 F	*75.00 F
16	2		*HEADLAMP (WCP)	Cracked	6,900.00 F	*6,900.00 F
17	1		*HEADLAMP SUPPORT PANEL (WCP)	Cracked	350.00 F	*350.00 F
18	1		*FRT BUMPER TOP BEAM (WCP)	Bent	120.00 F	*120.00 F
Supplementary #1						
19	6		*GRILLE TOP GARNISH CLIPS (WCP)	Necessary	33.00 F	*33.00 F
20	1		*AIRCON CONDENSER (WCP)	Warped	450.00 F	*450.00 F
21	1		*SUPPORT TOP GARNISH (WCP)	Cracked	350.00 F	*350.00 F
22	1		*SUPPORT FRT AIR GUIDE (WCP)	Deformed	125.00 F	*125.00 F
23	1		*BRACE PANEL (WCP)	Bent	95.00 F	*95.00 F
24	1		*AIR DUCT (WCP)	Deformed	95.00 F	*95.00 F
F=Franchise part.						
Sub Total (S\$)					13,473.00	13,232.00
+ Margin on L,N Items 10.00/10.00% (S\$)					1,347.30	1,323.20
Total Parts (S\$)					14,820.30	14,555.20
Report was unsubmitted during this print-out.						

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	NUMBER PLATE (Bent)	40.00	40.00
Sub Total (\$\$)			40.00	40.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	WIRE CHECKING	New	30.00	30.00
2	REMOVE & REFIX AIRCON AND GAS	New	100.00	100.00
3	LABOUR CHARGE	New	700.00	600.00
4	SPRAY PAINTING (PEARL)	New	900.00	800.00
Gross Labour Cost (\$\$)			1,730.00	1,530.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >