

ASS. REC. BY:

REF:

C72 / 22012981/KC

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TPRES/ODRES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s Thian 1414of 87214

Insured: _____

Policy No. _____


Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

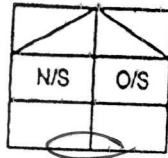Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 2 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SK147130 Yr Regn: 04, 16

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CA WagonMake: BMW 116D c.c. 1496Colour: M. Black A/C: Insured / Std / Nil / NASp. Reading: 166740 T/Radio: Insured / Std / Nil / NA

Eng/No: _____

C/No: WBA1V72030V724308Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 225/45ZR17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Otan

Front

R/Bal. 7 mmL/Bal. 7 mmD.O.A. 26/12/22

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

1	/	GIA & Est not ready
2	24/12	61km & 1600 Car (Red. 6257.65, 79.2)
3		
4		
5		
6		
7		
8		
9		
10		

Date/Time, File Pass to?

☐: Prell. Report☒: Final Report

Date/Time, File Return to?

Days Of Repair: 2

Resurvey No. of Trip: _____

Survey Fee:

Transportation

S - RS. SI

Fees

Others

TOTAL

Add Fee: ☐: Site Insp (\$)☐: Interview (\$)☐: Tech Invs (\$)☐: Weekend (\$)Report Format: TP

Lump Sum / I.B.I. (\$)

1600

Thiam Heng Huat Pte Ltd

176 Sin Ming Drive #05-14 Sin Ming Autocare Singapore 575721

Mobile: 82636295 Email: thiamhenghuat@gmail.com

Not Authorised
21/12/22 8:16 AM
Penny Heng Peing
2 days

Make/Model: BMW 116D

Engine/Chassis No.: WBA1V72030V724308


Date of accident: 26.12.22

Damaged area: Rear

Date: 29/12/2022

Claim Type: TP

VRN: SKH713D

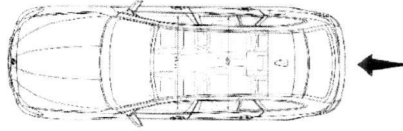

List items				
S/N	Parts description	QTY	UNIT PRICE	AMOUNT
1	Tailgate	1	\$ 1,563.00	\$ 1,563.00
2	Tailgate weatherstrip	1	\$ 289.00	\$ 289.00
3	Rear bumper reflector	2	\$ 231.00	\$ 462.00
4	Rear bumper	1	\$ 1,295.00	\$ 1,295.00
5	Rear bumper tow hook cover	1	\$ 59.00	\$ 59.00
6	Rear bumper side retainer	2	\$ 185.00	\$ 370.00
7	Rear bumper reinforcement	1	\$ 615.00	\$ 615.00
8	Rear bumper reinforcement bracket	2	\$ 146.00	\$ 292.00
9	Rear bumper center carrier	1	\$ 282.00	\$ 282.00
Subtotal				\$ 5,227.00
List discount				5.00%
Total				\$ 4,965.65

Special nett items				
No.	Parts description	QTY	UNIT PRICE	AMOUNT
1	Reverse sensor holder	4	\$ 14.00	\$ 56.00
2	Reverse sensor (Factory Original)	4	\$ 180.00	\$ 720.00
3	Rear bumper clips	12	\$ 5.50	\$ 66.00
4	Sundries	1	\$ 50.00	\$ 50.00
Total				\$ 892.00

Labour			
No.	Description	Work unit	Amount
1	To dismantle / renew accident damaged portion. To panel beat, reshape, straighten, orientate and align repair / replacement parts.	5	\$ 1,000.00
2	To disconnect rear wire harness of electrical components to facilitate repairs, reconnect and check functions including taillamp lightings.	0.5	\$ 100.00
3	Supply spray paint material and necessary items to respray affected area / panel.	4	\$ 800.00
4	To rust proof all affected portions after repair.	0.5	\$ 100.00
Total labour			\$ 2,000.00
Estimate Grand Total			\$ 7,857.65

LKK Auto Consultancy
the Repaired of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date: