

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com;cs-a@lkkauto.com;admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/GRB23000036/UPA3Q2
Date: 15/06/2023**REFERENCE**

Handling Insurer:	India International Insurance Pte Ltd	Policy No:	D21MFL0000447_01
Claimant Vehicle No :	SMU9308P	Insured Vehicle No :	SLR4743B
Date of Loss:	30/12/2022	Nature of Claim:	TP
		Claim No:	MFL2023D0000238

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SMU9308P	Engine No:	L15B6020365
Make & Model:	HONDA SHUTTLE, 1.5 G CVT SENSING (A)	Chassis No:	GK82100278
Reg. Date:	04/09/2020 (Man. Year: 2019)	Odometer:	181532 km
Colour:	Grey		
Engine Capacity:	1496 cc		
Market Value/New Car Price:	N/A		
Sum Insured (\$\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195/50 R16	Rear Tyre Size:	195/50 R16
Front Left Side:	Michelin 6 mm	Rear Left Side:	Michelin 6 mm
Front Right Side:	Michelin 6 mm	Rear Right Side:	Michelin 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	15,541.70	6,507.44	9,034.26	58.13
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,720.00	2,410.00	1,310.00	35.22
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	19,261.70	8,917.44	10,344.26	53.70
Approved Total (Overridden) (\$\$)		7,100.00		
Nett Amount (\$\$)	19,261.70	7,100.00	12,161.70	63.14
+ Loss of Use (6.0 x S\$60.00/day) (\$\$)		360.00		
Nett Liability (\$\$)		7,460.00		

INSPECTION

Date of Assignment:	03/01/2023	
Date Inspected:	03/01/2023	Inspected At: Choo Motor Spray Painter (HQ) 1 Kaki Bukit Avenue 6, #01-39 AutoBay @ Kaki Bukit Singapore 417883
Estimated Period of Repair:	5.0 days	

Adjuster: MARCUS CHUA**Manager:** CHEW HSIAO TONG*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 30 Mar 2023)	
Parts:	N/A	HONDA SHUTTLE 1.5 G CVT SENSING (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMU9308P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR WINDSCREEN MOULDING	Necessary	166.20 F	*121.50 FL
2	1		*TAILGATE	Badly Dented	1,655.20 F	*1,193.40 FL
3	1		*TAILGATE REAR LOGO	Necessary	48.00 F	*48.00 FL
4	2		*TAILGATE REFLECTORS	Cracked	1,283.20 F	*902.40 FL
5	1		*TAILGATE SHUTTLE EMBLEM	Necessary	75.00 F	*75.00 FL
6	1		*TAILGATE OUTER GARNISH	Not Necessary	495.00 F	*- FL
7	1		*TAILGATE INNER LOCK	Twisted / Damaged	288.20 F	*265.20 FL
8	1		*TAILGATE INNER TRIM BOARD	Deformed / Cracked	455.10 F	*428.10 FL
9	1		*TAILGATE WEATHERSTRIP	Twisted	232.80 F	*185.40 FL
10	2		*TAILLAMPS	Not Necessary	1,300.00 F	*- FL
11	1		*REAR BUMPER	Distorted	1,215.10 F	*936.00 FL
12	2		*REAR BUMPER SIDE RETAINERS	Bent	90.00 F	*90.00 FL
13	2		*REAR BUMPER REFLECTORS	Not Necessary	150.00 F	*- FL
14	2		*REAR BUMPER SIDE COVERS	Not fitted	222.00 F	*- FL
15	1		*REAR BUMPER TOP CHROME	Bent	283.00 F	*283.00 FL
16	1		*REAR END PANEL	Badly Dented	755.20 F	*660.00 FL
17	1		*REAR END PANEL TOP GARNISH	Twisted	248.70 F	*248.70 FL
18	1		*REAR END PANEL ANTENNA SENSOR	Not Necessary	108.90 F	*- FL
19	2		*REAR END PANEL SIDE EXTENSION PANELS	Badly Dented	570.00 F	*570.00 FL
20	1		*REAR EXHAUST	Not Necessary	688.20 F	*- FL
21	1		*REAR FLOOR PANEL TOP BOARD	Dented / Deformed	544.10 F	*544.10 FL
22	1		*REAR FLOOR PANEL	Repair	1,140.20 F	*- FL
23	1		*REAR FLOOR PANEL TOOLS TRAY	Cracked	652.30 F	*652.30 FL
24	1		*REAR FENDER INNER TRIM O/S	Cracked	545.10 F	*481.20 FL
25	1		*REAR FENDER O/S	Repair	1,190.20 F	*- FL
26	1		*REAR WINDSCREEN SEALANT	Necessary	50.00 FS	*40.00 FS
27	1		*REAR WINDSCREEN INNER SEAL	Necessary	50.00 FS	*40.00 FS
28	1		*SET REAR BUMPER REVERSE SENSOR	Shorted	280.00 FS	*200.00 FS
29	1		*SET TAILGATE INNER TRIM BOARD CLIPS	Necessary	50.00 FS	*30.00 FS
30	1		*SET TAILGATE REAR REVERSE CAMERA	Not Necessary	460.00 FS	*- FS
31	1		*REAR END PANEL SEALANT	Necessary	50.00 FS	*50.00 FS
32	1		*SET REAR FLOOR PANEL INSULATOR	Not Necessary	200.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	15,541.70	8,044.30
- List Item Discount on L Items 0.00/20.00% (\$\$)	0.00	1,536.86
Total Parts (\$\$)	15,541.70	6,507.44

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	50.00	20.00
2	TO DISMANTLE & REPLACED REVERSE SENSOR	New	80.00	50.00
3	TO DISMANTLE & REFIX REAR WINDSCREEN	New	150.00	120.00
4	TO DISMANTLE & REFIX CUSHION UPHOLSTERY	New	120.00	80.00
5	TO TRANSFER TAILGATE MECHANISM	New	100.00	60.00
6	TO SPRAY RUST PROOFING	New	100.00	80.00
7	TO RESET & REPROGRAMME SYSTEM	New	120.00	0.00
8	LABOUR FOR PANEL BEATING & REPLACED PARTS	New	1,500.00	900.00
9	TO PUTTY & SPRAY PAINTING	New	1,500.00	1,100.00
Gross Labour Cost (\$)			3,720.00	2,410.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >