



Claim Reference : -
 Insured Vehicle No. : -
 Thirty Party Veh No. : -
 Officer-In-Charge : -

Our Reference : KAAS/TA/6482/2756/TP/10.22
 Invoice No. : 6482
 Date : 17 December 2022

To: Seng Guan Container Service
 c/o 10 Buroh Street #04-26/28/29,
 West Connect Building,
 Singapore 627564

INVOICE	
PARTICULARS	AMOUNT
Vehicle No. : XD 2756J Make/Model : Mitsubishi FP51JDR4RDEA ☒ Inspection of Vehicle ☒ Appraisal Report ☒ 62 Colored Photographs ☒ Transport charges ☒ Re-inspection ☐ Others (Specify)	 SGD 1,257.00
Total	SGD 1,257.00

Dollars: **One Thousand Two Hundred and Fifty-Seven Only**

(Cheque should be crossed and make payable to " **Kelvin Automotive Appraising Services** ")



Kelvin Automotive Appraising Services



Claim Reference : -
Insured Vehicle No. : -
Thirty Party Veh No. : -
Officer-In-Charge : -

Our Reference : KAAS/TA/6482/2756/TP/10.22
Date : 17 December 2022

To: Seng Guan Container Service
c/o 10 Buroh Street #04-26/28/29,
West Connect Building,
Singapore 627564

VEHICLE APPRAISAL REPORT

Name of Workshop : Redants Engineering Pte Ltd
Place of inspection : 10 Buroh Street #04-26/28/29, West Connect Building, Singapore 627564
Date of Assignment : 26 October 2022
Date of Accident : 25 October 2022
Date of Inspection : 26 October 2022

PARTICULARS OF INSPECTED VEHICLE

Registration No.	: XD 2756J	Chassis Frame No.	: FP51JDA00616
Make / Model	: Mitsubishi FP51JDR4RDEA	Engine No. (Logcard)	: 6M70413455
Year of Manufacture/Reg	: 2008	Odometer Reading	: 230,721 KM
Colour	: Blue		
Class / Type	: Truck		

CONDITION OF VEHICLE DURING SURVEY (Visual & Static Check Only)

General Condition : Good
Paintwork : Good
Market Value : -
Scrap Value : -

CONDITION OF TYRES ON VEHICLE

	<u>Make/Size</u>	<u>Thread Balance</u>
Front L	KPATOS 295 / 80 R22.5	18 mm
Front R	KPATOS 295 / 80 R22.5	18 mm
Rear L	CENTARA 295 / 80 R22.5	18 mm
Rear R	CENTARA 295 / 80 R22.5	18 mm

*The above is an estimate of the remaining life of the tyre thread in millimeters

The information contained in these documents may be privileged and confidential, and is intended for the exclusive use of the addressee designation. If you are not the addressee, any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this survey report in error, please contact us immediately by phone so that we can arrange for its return.

APPRAISEMENT SCHEDULE


S/N	Qty	Descriptions	Conditions	Repairer's Estimate	Revised Amount	
		LIST ITEMS:-				
1	1	bumper assy front	deformed	\$ 1,933.00	\$ 1,933.00	✓
2	1	cover front bumper l/h	deformed	\$ 295.00	\$ 295.00	✓
3	1	cover front bumper r/h	deformed	\$ 295.00	\$ 295.00	✓
4	8	clip front bumper @\$3.50	necessary	\$ 28.00	\$ 28.00	✓
5	1	grille radiator upper	broken	\$ 621.00	\$ 621.00	✓
6	1	grille radiator lower	missing	\$ 829.00	\$ 829.00	✓
7	22	clip radiator grille @\$6.30	necessary	\$ 138.60	\$ 138.60	✓
8	1	lid assy front	buckled	\$ 5,435.00	\$ 5,435.00	4852 ✓
9	1	bezel head lamp l/h	deformed	\$ 203.00	\$ 203.00	× NN
10	1	bezel fog lamp front l/h	deformed	\$ 484.17	\$ 484.17	× NN
11	1	bezel head lamp r/h	deformed	\$ 203.00	\$ 203.00	✓
12	1	bezel fog lamp front r/h	deformed	\$ 484.17	\$ 484.17	✓
13	1	headlamp assy r/h	broken	\$ 1,286.00	\$ 1,286.00	✓
14	1	lamp assy fog front r/h	broken	\$ 293.00	\$ 293.00	✓
15	1	panel corner l/h	deformed	\$ 1,164.00	\$ 1,164.00	× NN
16	1	panel corner r/h	broken	\$ 1,164.00	\$ 1,164.00	988 ✓
17	1	lamp signal front r/h	broken	\$ 211.00	\$ 211.00	✓
18	1	fender front lower r/h	broken	\$ 596.00	\$ 596.00	× NN
19	1	wall front step upper r/h	damaged	\$ 310.00	\$ 310.00	✓
20	1	stay headlamp r/h	buckled	\$ 915.00	\$ 915.00	✓
21	1	wiper arm @\$286.00	bent	\$ 858.00	\$ 858.00	286 ✓
22	1	wiper link assy	damaged	\$ 826.00	\$ 826.00	698 ✓
23	1	wiper motor	not working	\$ 927.48	\$ 927.48	× NN
24	1	windscreen front	broken	\$ 2,680.00	\$ 2,680.00	✓
25	1	weather strip front	necessary	\$ 704.00	\$ 704.00	✓
26	1	l/h front door	damaged	\$ 6,735.00	repair	× repair
27	1	rear cross member	buckled	\$ 2,761.00	\$ 2,761.00	✓
28	1	rear no. plate display panel	buckled	\$ 357.00	\$ 357.00	× NN
29	1	r/h rear wheelhouse panel	buckled	\$ 1,642.00	\$ 1,642.00	× NN
30	1	r/h rear wheelhouse shield	deformed	\$ 972.00	\$ 972.00	× NN
		Less 25%		\$ 35,350.42	\$ 28,615.42	20,810.77
					\$ 7,153.86	-25%
		SPECIAL NETT ITEMS:-		\$ 35,350.42	\$ 21,461.57	15,608.08
31	1	front no. plate	buckled	\$ 60.00	\$ 50.00	40 ✓
32	1	rear no. plate	buckled	\$ 60.00	\$ 50.00	× NN
				\$ 120.00	\$ 100.00	
Sub - Total				\$ 35,470.42	\$ 21,561.57	40

ASSESSMENT SUMMARY

Damages sustained were consistent with the subject vehicle being involved in a collision with another vehicle and the impact was delivered

Squarely to the Rear

portion of the vehicle.

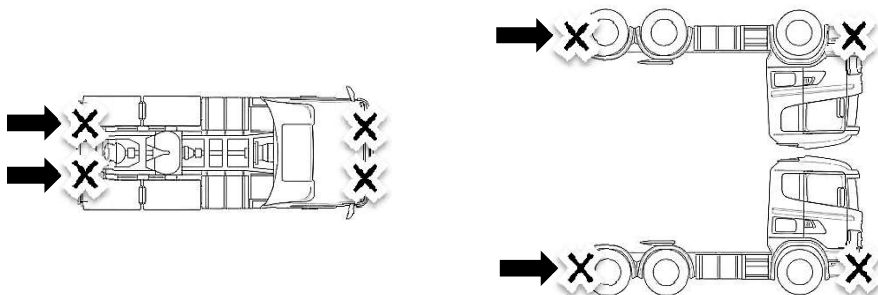

The general area of damages is at the
(Please refer to the parts list and photographs as attached for more information)

Front and Rear portion

ASSESSOR'S RECOMMENDATIONS

The estimated repair costs submitted by Messrs **Redants Engineering Pte Ltd** is \$ 37,890.42 .

We have adjusted the cost to \$ 23,461.57 and the repairer has agreed to undertake the repairs at a

Contract Lump Sum of \$ 18,750.00 to a acceptable quality and standards.

However, we have not given authorization and instruction to the repairer to proceed with the repairs.

The repairs should be completed within a reasonable period of **11** working days.

62 photographs were taken at the time of static inspection.

This report is strictly done in a **Without Prejudice Basis**.

We are reverting the matter to you a decision.

We enclose herewith our Invoice No. **6482** for our services rendered and
we thank you for engaging our services.

KELVIN AUTOMOTIVE APPRAISING SERVICES



KELVIN TEO

Licensed Automotive Appraiser

Nitec in Automotive Technology

Cert. Crash Investigation & Reconstruction

Dip MS

MSAAA, AM SAE-A

NOTE : This revised estimate was from a visual inspection. Should there be any discrepancy or unseen items not listed in this survey, kindly notify the company within Seven (7) days from the date hereof. Otherwise this revised amount shall be treated as valid.





