

**LKK Auto Consultants Pte Ltd** (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

**VEHICLE DAMAGE INSPECTION REPORT****Our File No:** CS3/CTI23000089/SVP3M4**Date:** 12/01/2023**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMHCSNW00001212200

**Claimant Vehicle No :** FY9239S **Insured Vehicle No :** SMW8736H

Date of Loss: 04/12/2022 Nature of Claim: TP Claim No: SNM22D208778/C02/LEEPG

**DESCRIPTION & IDENTIFICATION OF VEHICLE**

Reg No: **FY9239S**

Make & Model: HONDA CB400SF, 399cc Engine No: NC23E2064594

Reg. Date: 17/02/2005 (Man. Year: 2004) Chassis No: JH2NC39944M020063

Colour: Blue Odometer: 0 km

Engine Capacity: 399 cc

Market Value/New Car Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**

**CONDITION OF VEHICLE AT THE TIME OF SURVEY**

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

**CONDITION OF TYRES**

Front Tyre Size: 120/60 R17 Rear Tyre Size: 160/60 R17

Front Left Side: Bridgestone 5 mm Rear Left Side: Bridgestone 5 mm

Front Right Side: Bridgestone 0 mm Rear Right Side: Bridgestone 0 mm

*The above values represent the remaining tyre treads depth*

<b>COST OF CLAIMS</b>	<b>Repairer's</b>	<b>Adjuster's</b>	<b>Difference</b>	<b>Diff %</b>
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
<b>Nett Amount (S\$)</b>	<b>0.00</b>	<b>0.00</b>	<b>0.00</b>	

**INSPECTION**

Date of Assignment: 04/01/2023

Date Inspected: 04/01/2023 Inspected At: EQBH PTE LTD  
25 KAKI BUKIT ROAD 4  
#03-46 SYNERGY @ KB  
SINGAPORE 417800

Estimated Period of Repair: 5.0 days

**Adjuster:** S Mohamed Irfan Bin Mohamed Iqbal**Manager:** VERON CHEN

*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
- B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.  
THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
- C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,500.00  
-\$2,500.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 12 Jan 2023)	
Parts:	N/A	HONDA CB400SF 399cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FY9239S)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.
---

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >