

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CTI23000154/KVP3Q2**Date:** 13/07/2023**REFERENCE**

Insured/Claimant:	KIM TRANSPORT SOLUTION PTE LTD	Policy No:	DMB1SNW00014232200
Date of Loss:	27/12/2022	Nature of Claim:	OD
		Claim No:	SNM22D209364/C01/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	PC3099R	Engine No:	1KD2478545
Make & Model:	TOYOTA HIACE, 3.0 D DX (A)	Chassis No:	KDH2010157956
Reg. Date:	03/03/2015 (Man. Year: 2014)	Odometer:	0 km
Colour:	White		
Engine Capacity:	2982 cc		
Market Value/New Car Price:	S\$30,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	195 R15X8	Rear Tyre Size:	195 R15X8
Front Left Side:	Bridgestone 9 mm	Rear Left Side:	Bridgestone 7 mm
Front Right Side:	Bridgestone 9 mm	Rear Right Side:	Bridgestone 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	29,214.30	15,696.30	13,518.00	46.27
Miscellaneous Items	0.00	0.00	0.00	
Labour	10,280.00	3,760.00	6,520.00	63.42
Paintwork Labour	0.00	0.00	0.00	
Towing	150.00	0.00	150.00	100.00
Calculated Gross Total (S\$)	39,644.30	19,456.30	20,188.00	50.92
Approved Total (Overridden) (S\$)		18,800.00		
- Excess (S\$)	0.00	2,000.00	-2,000.00	
(S\$)	39,644.30	16,800.00	22,844.30	57.62
+ GST 8.00/8.00% (S\$)	3,171.54	1,344.00	1,827.54	57.62
Nett Amount (S\$)	42,815.84	18,144.00	24,671.84	57.62

INSPECTION

Date of Assignment:	05/01/2023	Present Location:	SC Auto Industries (S) Pte Ltd (HQ)
Date Inspected:	06/01/2023	Inspected At:	SC Auto Industries (S) Pte Ltd (HQ)
			51 Senoko Road, #03-01
			Singapore 758133
Estimated Period of Repair:	7.0 days		

Adjuster: KENNETH KONG**Manager:** VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 13 Jul 2023)	
Parts:	N/A	TOYOTA HIACE 3.0 D DX (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for PC3099R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BUMPER	Bent	785.60 F	*650.00 F
2	2		*FRONT HEADLIGHT LH & RH	Mtg Broken	2,880.40 F	*1,560.00 F
3	1		*BONNET LOCK	Repair	268.20 F	*- F
4	1		*FRONT TOP GRILLE	Cracked	385.40 F	*300.00 F
5	1		*FRONT GRILLE LOWER	Distorted	885.40 F	*360.00 F
6	1		*FRONT GRILLE BASE	Cracked	823.10 F	*795.00 F
7	1		*FRONT WINDSCREEN	Cracked	1,240.10 F	*650.00 F
8	1		*FRONT WINDSCREEN MOULDING	Necessary	201.60 F	*125.00 F
9	1		*FRONT WINDSCREEN SEALANT	Necessary	147.00 F	*40.00 FS
10	1		*A/C CONDENSER	Bent	1,580.50 F	*790.00 F
11	1		*RADIATOR	Punctured	2,250.00 F	*980.00 F
12	1		*SUPPORT PANEL ASSY	Bent	986.60 F	*650.00 F
13	2		*RETAINER LH & RH	Distorted	328.50 F	*180.00 F
14	2		*HEADLAMP BRACKET LH & RH	Bent	189.00 F	*90.00 F
15	2		*FRONT BUMPER TOW COVER	Missing	147.20 F	*70.00 F
16	1		*ENGINE LOWER COVER	Broken	680.40 F	*560.00 F
17	1		*COOLING FAN COVER	Broken	1,085.60 F	*685.00 F
18	2		*RADIATOR FLIP COVER LH & RH	Not Necessary	571.20 F	*- F
19	1		*A/C PIPE	Serviceable	620.10 F	*- F
20	2		*COOLING FAN	Serviceable	1,102.80 F	*- F
21	1		*COOLING FAN MOTOR	Jammed	1,797.60 F	*1,000.00 F
22	1		*FRONT BUMPER REINFORCEMENT	Bent	956.60 F	*480.00 F
23	1		*HORN	Dented	98.50 F	*50.00 F
24	1		*AIR FILTER ASSEMBLY	Serviceable	1,550.90 F	*- F
25	1		*STABILIZER BAR	Serviceable	2,180.20 F	*- F
26	2		*STABILIZER LINK LH & RH	Serviceable	971.20 F	*- F
27	4		*COOLANT	Necessary	112.00 F	*75.00 F
28	1		*SIDE STEP COVER RH	Not Necessary	205.60 F	*- F
Supplementary #1						
29	1		*FAN BLADE	Distorted	150.00 F	*150.00 F
30	1		*AIR CLENER ASSY	Cracked	960.00 F	*960.00 F
31	1		*MEMBER. FRONT CROSS	Bent	210.00 F	*210.00 F
32	2		*GUSSET, FRONT CROSSMEMBER SIDE LH & RH	Bent	350.00 F	*350.00 F
33	1		*FRONT STEP GARNISH	Missing	195.00 F	*195.00 F
34	1		*FAN BLADE 5B	Distorted	150.00 F	*150.00 F
35	2		*REIN,FRT CROSSMEMBER	Bent	330.00 F	*330.00 F
36	2		*RAD GUIDE NO2 LH/RH	Cracked	190.00 F	*190.00 F
37	1		*A/C PIPE NO 1	Dented	398.00 F	*398.00 F
38	1		*A/C PIPE NO 2	Dented	420.00 F	*420.00 F
39	1		*A/C COOLER SUCTION HOSE	Bent	465.00 F	*465.00 F
40	1		*A/C PIPE COOLER DISCHARGE	Bent	365.00 F	*365.00 F

F=Franchise part. S=SpcNett.

Sub Total (\$\$)	29,214.30	14,273.00
+ Margin on L,N Items 0.00/10.00% (\$\$)	0.00	1,423.30
Total Parts (\$\$)	29,214.30	15,696.30

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	LABOUR TO REMOVE,REINSTALL AND CHECK STRUCTURE WIRE HARNESS.	New	650.00	200.00
2	LABOUR TO REMOVE AND REINSTALL FRONT WINDSCREEN	New	600.00	400.00
3	LABOUR TO REFILL A/C GAS	New	180.00	100.00
4	LABOUR TO REPLACE UNDERCARRIAGE COMPARTMENT. CHECK ACCORDING TO DAMAGE.	New	1,800.00	400.00
5	LABOUR TO CARRY OUT WHEEL ALIGNMENT	New	250.00	60.00
6	LABOUR TO CARRY OUT DIAGNOSTIC CHECK	New	300.00	0.00
7	LABOUR TO RESPRAY SUPPORT PANEL ASSY, FRONT SIDE MEMBER LH & RH,CHASSIS FRAME, A-PILLAR LH & RH.	New	2,000.00	1,200.00
8	LABOUR TO REMOVE,REPAIR, AND REINSTALL FRONT BUMPER, SUPPORT PANEL ASSY, FRONT SIDE MEMBER LH & RH,CHASSIS FRAME AND A-PILLAR LH & RH. CHECK ACCORDING TO DAMAGE	New	4,500.00	1,400.00
Gross Labour Cost (\$\$)			10,280.00	3,760.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >