



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLK 6656T

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT FENDER N/S	TO REPAIR SEE LABOUR	702.00	-
1	FRONT FENDER COWLING N/S	SERVICEABLE	185.00	-
1	FRONT FENDER SPLASH GUARD N/S	SERVICEABLE	76.00	-
1	FRONT BUMPER	MTG CRACKED	976.00	976.00
2	FRONT BUMPER RETAINER @\$85.00	N/S DISTORTED	170.00	85.00
1	FRONT LOWER ARM N/S	DISTORTED	421.00	421.00
1	FRONT SHOCK ABSORBER N/S	BENT	355.00	355.00
1	FRONT SHOCK ABSORBER TOP MOUNT N/S	SERVICEABLE	53.00	-
1	FRONT WHEEL KNUCKLE N/S	BENT	365.00	365.00
1	FRONT WHEEL KNUCKLE BEARING N/S	NECESSARY	266.00	184.00
1	FRONT STABILIZER END LINK N/S	SERVICEABLE	115.00	-
1	FRONT FENDER ARCH GARNISH N/S	DENTED / DISTORTED	296.00	198.70
1	HEADLAMP N/S	CUT	2,256.00	1,859.00
	LESS 20% DISCOUNT		-1,247.20	-888.74
			4,988.80	3,554.96
<b><u>SPECIAL NETT ITEMS</u></b>				
1	FRONT ALLOY WHEEL N/S (SN)	DENTED	550.00	400.00
1	FRONT TYRE N/S (SN)	SERVICEABLE	280.00	-
12	FRONT BUMPER CLIPS @\$5.50 (SN)	NECESSARY	66.00	66.00
8	FRONT FENDER COWLING CLIPS N/S @\$5.50 (SN)	NOT NECESSARY	44.00	-
8	FRONT FENDER ARCH GARNISH CLIPS N/S @\$5.50 (SN)	NECESSARY	44.00	44.00
1	SUNDRIES (SN)	NOT NECESSARY	50.00	-
			1,034.00	510.00
<b><u>LABOUR</u></b>				
	TO DISMANTLE / RENEW THE ACCIDENT DAMAGED PORTION. TO PANEL BEAT, RESHAPE, STRAIGHTEN, ORIENTATE AND ALIGN REPAIR / REPLACEMENT PARTS. INCLUSIVE OF THE REPAIR OF FRONT FENDER N/S.		1,000.00	400.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DISCONNECT WIRE HARNESS AND ELECTRICAL COMPONENT TO FACILITATE REPAIRS, RECONNECT AND CHECK FUNCTIONS.	NOT NECESSARY	50.00	20.00
	TO UNDERCOAT ALL AFFECTED PORTIONS AFTER REPAIR.		200.00	-
	TO REMOVE AND REFIT N/S FRONT TYRE & RIM FOR REPLACEMENT. TO PERFORM TYRE BALANCING.		50.00	20.00
	TO REMOVE AND REFIT N/S FRONT UNDERCARRIAGE FOR REPLACEMENT OF PARTS.		200.00	180.00
	TO CONDUCT COMPUTERIZED 4 WHEEL ALIGNMENT.		100.00	60.00
	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA / PANEL.		800.00	550.00
			2,400.00	1,230.00
<b>GRAND TOTAL</b>			<b>8,422.80</b>	<b>5,294.96</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>4,000.00</b>

Report Ref No. CS/AGI23000167/Kny3e2

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.