



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

### ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLR 9705D

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
<b><u>REPLACEMENT OF PARTS</u></b>				
1	FRONT N/S FENDER (CONSISTENT)	TO REPAIR SEE LABOUR	855.60	-
1	FRONT N/S FENDER EMBLEM (CONSISTENT)	NECESSARY	65.10	65.10
1	FRONT N/S FENDER INNERSHIELD (CONSISTENT)	SERVICEABLE	165.20	-
1	FRONT N/S FENDER ARCH GARNISH (CONSISTENT)	DENTED	195.70	195.70
1	FRONT BUMPER (CONSISTENT)	MTG CRACKED	855.20	781.10
1	FRONT LOWER BUMPER (CONSISTENT)	CUT	499.80	499.80
1	FRONT N/S HEADLAMP ASSY (CONSISTENT)	SERVICEABLE	1,855.60	-
1	FRONT N/S DOOR ASSY (CONSISTENT)	TO REPAIR SEE LABOUR	1,359.20	-
1	REAR N/S DOOR ASSY (CONSISTENT)	BENT	1,242.70	1,242.70
1	REAR N/S FENDER ARCH GARNISH (CONSISTENT)	DENTED	195.70	195.70
1	REAR N/S HUB (CONSISTENT)	BENT	425.70	425.70
1	REAR N/S KNUCKLE ARM (CONSISTENT)	SERVICEABLE	550.20	-
1	REAR N/S KNUCKLE BEARING (CONSISTENT)	NECESSARY	197.50	197.50
	LESS 25% DISCOUNT		-2,115.80	-900.82
			6,347.40	2,702.48
<b><u>SPECIAL NETT ITEMS</u></b>				
1	REAR N/S TYRE RIM (SN) (CONSISTENT)	DENTED	450.00	350.00
15	BUMPER CLIP @\$2.00 (SN) (CONSISTENT)	NECESSARY	30.00	30.00
			480.00	380.00
<b><u>LABOUR</u></b>				
	REMOVE/RENEW THE ABOVE PARTS INCLUDING KNOCKING, WELDING & CUTTING. INCLUSIVE OF THE REPAIR OF FRONT N/S FENDER AND FRONT N/S DOOR ASSY.		1,000.00	500.00
	TO PUTTY & SPRAY PAINT ON ACCIDENT AFFECTED PORTION.		1,200.00	800.00
	CHECK AND RECONNECT WIRING.		40.00	20.00
	TO RE-SPRAY ANTI RUST PROOFING.		120.00	60.00
	REMOVE/RENEW FRONT N/S UNDERCARRIAGE.		300.00	60.00



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	CHECK AND REALIGN WHEEL ALIGNMENT.	NOT NECESSARY	80.00	-
			2,740.00	1,440.00
GRAND TOTAL			9,567.40	4,522.48
RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)				3,500.00

Report Ref No. CS/ASM23000200/Kqp3m4

KONG SENG CHEONG

Licensed Appraiser

**DISCLAIMER OF LIABILITY TO THIRD PARTIES:-** This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.