

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS3/CT123000208/SQP3E2**Date:** 16/02/2023REFERENCEHandling Insurer: China Taiping Insurance
(Singapore) Pte. Ltd.

Policy No: DMPCSNW00035742200

**Claimant Vehicle
No :** FBT15D**Insured Vehicle
No :** SLB1263Z

Date of Loss: 01/01/2023

Nature of Claim: TP

Claim
No: SNM23D200011/C02/LEEPGDESCRIPTION & IDENTIFICATION OF VEHICLEReg No: **FBT15D**

Make & Model: YAMAHA T155, 155cc

Engine No: G3R9E001393

Reg. Date: 27/01/2022 (Man. Year: 2021)

Chassis No: RLCUG1610MY001396

Colour: Black

Odometer: 21459 km

Engine Capacity: 155 cc

Market Value/New Car

Price: N/A

Sum Insured (S\$): **Market Value/New Car Price**CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	90/80-17	Rear Tyre Size:	120/60-17
Front Left Side:	Pirelli 5 mm	Rear Left Side:	Pirelli 5 mm
Front Right Side:	0 mm	Rear Right Side:	0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	0.00	0.00	0.00	
Miscellaneous Items	0.00	0.00	0.00	
Labour	0.00	0.00	0.00	
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Nett Amount (S\$)	0.00	0.00	0.00	

INSPECTION

Date of Assignment: 06/01/2023

Date Inspected: 09/01/2023 Inspected At:

Advance Republic Motor Pte Ltd (HQ)
68 Kaki Bukit Avenue 6, #04-06 Ark@KB
Singapore 417896

Estimated Period of Repair: 3.0 days

Adjuster: S Mohamed Irfan Bin Mohamed Iqbal**Manager:** SHIAU CHAN*NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.*

A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.

B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.

THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.

C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.

THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$1,500.00
-\$2,000.00

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 16 Feb 2023)	
Parts:	N/A	YAMAHA T155 155cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBT15D)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

There are no new parts selected.

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

There are no labour items selected.

Report was unsubmitted during this print-out.

< END OF ESTIMATES >