

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CS/CTI23000330/KNP3Q2**Date:** 19/03/2023**REFERENCE**

Handling Insurer: China Taiping Insurance (Singapore) Pte. Ltd. Policy No: DMB1SNW00008632200

Claimant Vehicle No : SMY8601C **Insured Vehicle No :** PC9992Y

Date of Loss: 09/01/2023 Nature of Claim: TP Claim No: SNM23D200193/C02/TANKL

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SMY8601C**

Make & Model: TOYOTA YARIS CROSS, 1.5 XB CVT (A) Engine No: M15AY073999

Reg. Date: 29/03/2021 (Man. Year: 2020) Chassis No: MXPB103000610

Colour: Blue Odometer: 93927 km

Engine Capacity: 1490 cc

Market Value/New Car Price: N/A

Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes

Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/50 R16 Rear Tyre Size: 225/50 R16

Front Left Side: LAWFENN 7 mm Rear Left Side: LAUFENN 7 mm

Front Right Side: LAWFENN 7 mm Rear Right Side: LAUFENN 7 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	15,689.25	8,380.75	7,308.50	46.58
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,100.00	1,650.00	1,450.00	46.77
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	18,789.25	10,030.75	8,758.50	46.61
Approved Total (Overridden) (\$\$)		8,000.00		
(\$\$)	18,789.25	8,000.00	10,789.25	57.42
+ GST 8.00/8.00% (\$\$)	1,503.14	640.00	863.14	57.42
Nett Amount (\$\$)	20,292.39	8,640.00	11,652.39	57.42

INSPECTION

Date of Assignment: 10/01/2023

Date Inspected: 10/01/2023 Inspected At: Thiam Heng Huat Pte Ltd (SIN MING)
176 SIN MING DRIVE, #05-14
Singapore 575721

Estimated Period of Repair: 6.0 days

Adjuster: KENNETH KONG**Manager:** HUEY YON

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	MRM-SG	Version: 1.0 (Last Synchronised: 17 Mar 2023)
Parts:	M1-SUV	TOYOTA YARIS CROSS 1.5 XB CVT (A) (Catalogue:Merimen Singapore 1.0)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SMY8601C)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT FENDER N/S	Bent	1,129.00 FL	*580.30 FL
2	1		*FRONT FENDER INNER SHIELD N/S	Cracked	285.00 FL	*190.20 FL
3	1		*HEADLAMP N/S	Mtg Cracked	2,365.00 FL	*1,855.30 FL
4	1		*HEADLAMP LOWER BRACKET N/S	Cracked	109.00 FL	*109.00 FL
5	1		*FRONT BUMPER	Bent / Cracked	1,069.00 FL	*980.20 FL
6	1		*FRONT BUMPER LOWER MOULDING	Cut	396.00 FL	*396.00 FL
7	2		*FRONT BUMPER SIDE RETAINER	Distorted	228.00 FL	*228.00 FL
8	1		*FRONT BUMPER SIDE LAMP N/S	Cut	487.00 FL	*487.00 FL
9	1		*FRONT BUMPER FOGLAMP INNER BRACKET N/S	Serviceable	166.00 FL	*- FL
10	1		*FRONT BUMPER LOWER GRILLE	Serviceable	565.00 FL	*- FL
11	1		*RADIATOR GRILLE BRACKET	Repair	147.00 FL	*- FL
12	1		*FRONT SHOCK ABSORBER N/S	Bent	689.00 FL	*606.00 FL
13	1		*FRONT SHOCK ABSORBER MOUNTING N/S	Serviceable	195.00 FL	*- FL
14	1		*FRONT LOWER ARM N/S	Bent	487.00 FL	*487.00 FL
15	1		*FRONT WHEEL KNUCKLE N/S }	Bent	598.00 FL	*458.00 FL
16	1		*FRONT WHEEL BEARING N/S }	Necessary	290.00 FL	*- FL
17	1		*FRONT END LINK N/S	Distorted	214.00 FL	*214.00 FL
18	1		*HEADLAMP TOP SUPPORT N/S	Repair	215.00 FL	*- FL
19	1		*FRONT BUMPER REINFORCEMENT	Repair	677.00 FL	*- FL
20	1		*FRONT BUMPER IMPACT ABSORBER	Cracked	189.00 FL	*189.00 FL
21	1		*FRONT FENDER INNER TOP BRACKET N/S	Repair	159.00 FL	*- FL
22	1		*FRONT DOOR N/S	Repair	1,453.00 FL	*- FL
23	2		*FRONT DOOR HINGE N/S	Repair	196.00 FL	*- FL
24	1		*FRONT DOOR CHECKER N/S	Serviceable	75.00 FL	*- FL
25	1		*WING MIRROR ASSY N/S	Dented / Cracked	913.00 FL	*812.00 FL
26	1		*BONNET	Repair	1,219.00 FL	*- FL
27	2		*BONNET HINGE	Repair	264.00 FL	*- FL
28	1		*WIPER WASHER TANK	Serviceable	267.00 FL	*- FL
29	1		*WIPER WASHER TANK MOTOR	Serviceable	313.00 FL	*- FL
30	1		*FRONT FENDER ARCH GARNISH N/S	Missing	215.00 FL	*215.00 FL
31	1		*FRONT BUMPER LOWER DEFLECTOR	Serviceable	169.00 FL	*- FL
32	1		*FRONT BUMPER LOWER GRILLE SIDE COVER N/S	Serviceable	89.00 FL	*- FL
33	1		*FRONT DOOR LOWER MOULDING N/S	Serviceable	195.00 FL	*- FL
34	1		*FRONT FENDER INNER PANEL N/S	Repair	553.00 FL	*- FL
35	1		*FRONT FENDER INNER SUPPORT BRACKET N/S	Repair	129.00 FL	*- FL
36	1		*FRONT WHEEL ABS SENSOR N/S	Torn	148.00 FL	*148.00 FL
37	1		*ROCKER PANEL OUTER MOULDING N/S	Cracked	337.00 FL	*337.00 FL
38	1		*FRONT CROSS MEMBER	Bent	1,853.00 FL	*1,853.00 FL
39	1		*FRONT BUMPER INNER SPONGE	Repeated	184.00 FL	*- FL
40	12		*FRONT BUMPER CLIPS	Necessary	66.00 FS	*66.00 FS
41	8		*FRONT FENDER INNER SHIELD CLIPS N/S	Necessary	44.00 FS	*44.00 FS
42	12		*FRONT DOOR INNER TRIM BOARD CLIPS N/S	Not Necessary	66.00 FS	*- FS
43	12		*BONNET INSULATOR CLIPS	Not Necessary	66.00 FS	*- FS
44	1		*FRONT TYRE N/S (\$280.00) (60%)	Punctured	380.00 FS	*168.00 FS
45	1		*FRONT ALLOY RIM N/S	Dented	550.00 FS	*450.00 FS
46	8		*FRONT FENDER ARCH GARNISH CLIPS N/S	Necessary	44.00 FS	*44.00 FS

Report was unsubmitted during this print-out.

3/19/23, 11:49 PM

Adjuster Report

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
47	1		*SUNDRIES	Not Necessary	50.00 FS	*- FS
F=Franchise part. S=SpcNett. L=ListItemDisc.						
Sub Total (\$)					20,497.00	10,917.00
- List Item Discount on L Items 25.00/25.00% (\$)					4,807.75	2,536.25
Total Parts (\$)					15,689.25	8,380.75
Report was unsubmitted during this print-out.						

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO DISMANTLE /RENEW ACCIDENT DAMAGED PORTION .TO PANEL BEAT ,RESHAPE ,STRAIGHTEN ,ORIENTATE AND ALIGN REPAIR /REPLACEMENT PARTS	New	1,400.00	600.00
2	TO DISCONNECT FRONT WIRE HARNESS OF ELECTRICAL COMPONENTS TO FACILITATE REPAIRS,RECONNECT AND CHECK FUNCTIONS INCLUDING FOCUSING HEADLAMPS	New	50.00	20.00
3	TO REMOVE AND REFIT N/S FRONT TYRE & RIMS .TO PERFORM TYRE BALANCING	New	50.00	20.00
4	TO REMOVE AND REFIT N/S FRONT UNDERCARRIAGE FOR REPLACEMENT OF PARTS	New	200.00	200.00
5	TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	New	100.00	60.00
6	SUPPLY SPRAY PAINT MATERIAL AND NECESSARY ITEMS TO RESPRAY AFFECTED AREA /PANEL	New	1,200.00	720.00
7	TO RUST PROOF ALL AFFECTED PORTIONS AFTER REPAIR	New	100.00	30.00
Gross Labour Cost (S\$)			3,100.00	1,650.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >