

PRUDENT ADJUSTORS SERVICES
BLOCK 607 ELIAS ROAD #05-192
SINGAPORE (510607)
BUSINESS REGN. No. 53193457L
Email: willybjt@gmail.com / Mobile: 96699986

INVOICE

Mr. Tan Hock Leng, Ronnie
c/o Goh JP & Wong LLC
133 New Bridge Road # 16-09
Chinatown Point
Singapore BU 659 R 059413

Invoice No : PA/2210/0005/G
Our Ref : PA/GBT6677/0822/tpw
Date : 04 October 2022

Claim Type	Third Party	Date of Accident	23 August 2022
Vehicle No.	FBT 6677 D	Date of Inspection	31 August 2022
No	Description	Amount (S\$)	
1	Survey fees inclusive of Transportation and Photographs (58) copies	\$633.00	
	Total	\$633.00	
Singapore Dollar: Six Hundred and Thirty-Three Only			
Terms of Payment - Within 30 (Thirty) days after receiving our Final Report & Invoice Payment payable as follows and kindly indicate Invoice No. <ul style="list-style-type: none">• Cheque - Payable to Prudent Adjustors Services• Bank Transfer - DBS 025-902513-4• Paynow - UEN No 53193457LBJT			


Prudent Adjustors Services
Bok Jee Tan

PRUDENT ADJUSTORS SERVICES

BLOCK 607 ELIAS ROAD #05-192

SINGAPORE 510607

BUSINESS REGN. No. 53193457L

Email: willybjt@gmail.com / Mobile: 96699986

VEHICLE DAMAGE INSPECTION REPORT

Mr. Tan Hock Leng, Ronnie
c/o Goh JP & Wong LLC
133 New Bridge Road # 16-09
Chinatown Point
Singapore 059413

Our Ref : PA/FBT6677/0822/tpw

Date : 04 October 2022

REFERENCES

Claim Type	: Third Party	Date of Accident	: 23 August 2022
Vehicle No	: FBT 6677 D	Date of Assignment	: 31 August 2022
Make	: CFMOTO	Date of Inspection	: 31 August 2022
Model	: 400GT	Date of Re-inspection	: 23 September 2022
Registration Date	: 28 April 2022	COE Expiry	: 27 April 2032
Color	: Blue	Chassis No	: LCEPESL53N6000159
Odometer	: 3,615km	Engine No	: Blocked

TYRE CONDITION

	<u>Make</u>	<u>Size</u>	<u>Thread Balance</u>
Front	Pirelli	120/70-17	8mm
Rear	Pirelli	160/60-17	8mm

GENERAL DESCRIPTION OF DAMAGE (PHOTOGRAPHS ATTACHED)

The vehicle sustained damage at front and both sides.
Please refer to photographs and assessment of repairs for details
Enclosed (58) photographs depicting damages and after repaired

INSPECTION AND ADJUSTMENT

Original Quotation : \$13,950.91 Revised Assessment \$11,700.00 Lump sum

Survey conducted at M1 Motoring (Changi)

In accordance to your instruction, we have not authorized repairs.

In normal circumstances, repairs to the vehicle would take approximately
Eight (8) days to complete.

This survey was conducted on a "WITHOUT PREJUDICE" basis.

Note:

The workshop has agreed to undertake the repair on a lump sum basis, and or the use of ex-stock
reconditioned parts whichever is possible

PRUDENT ADJUSTORS SERVICESVehicle No: **FBT 6677 D**

Our Ref: PA/FBT6677/0822/tpw

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

S/N	Description Material	Qty	Condition	Original Quotation	Revised Quotation	
1	Front windshield	1 pc	Scratches	259.70	259.70	✓
2	Front windshield cover plate @ \$26.70/- LH/RH	2 pcs	Cut LH	53.40	26.70	✓
3	Handlebar	1 pc	Bent	224.40	224.40	✓
4	Handlebar balancer	1 set	Cut/bent	160.00	160.00	✓
5	Rear view mirror assy @ \$205.80/-	2 pcs	Cut/grazed	411.60	411.60	✓
6	Clutch lever	1 pc	Bent	126.20	126.20	✓
7	Brake lever	1 pc	Serviceable	122.50	~	✗ nn
8	Front headlamp panel	1 pc	Cut/cracked	248.90	248.90	✓
9	Headlamp assy (LED)	1 pc	Cracked/grazed	1,987.50	1,987.50	✓
10	Front panel LH (mat black)	1 pc	Cut	190.90	190.90	✓
11	Front panel cover @ \$171.30/- LH/RH	2 pcs	Cut/cracked	342.60	342.60	✓
12	Front indicator turns light (LED) @ \$128.50/-	2 pcs	Cut/grazed	257.00	257.00	✓
13	Front fork assy @ \$1282.30/-	2 pcs	Bent/twisted	2,564.60	2,564.60	✗ nn
14	Lower triple clamp	1 pc	Distorted	454.70	454.70	✗ nn
15	Front fender	1 pc	Serviceable	304.60	~	✗ nn
16	Front footrest assy RH (matte black)	1 pc	Bent	145.40	145.40	✓
17	Front footrest bracket RH (matte black)	1 pc	Bent	331.90	331.90	✗ nn
				8,185.90	7,732.10	
List price less 10% discount				818.59	773.21	
				7,367.31	6,958.89	
<u>Add special nett item</u>						
18	Front number plate	1 pc	Necessary	20.00	18.00	✓
19	Handler guard (Cfmoto)	1 set	Cracked	350.00	350.00	✓
20	Steering cone & bearing	1 set	Necessary	220.00	220.00	✓
21	Waterproof snail horn	1 pc	Cracked	165.20	165.20	✓
22	Body crashguard	1 set	Cut/dent	680.00	680.00	✓
23	Sliders guard's engine crash bungs	1 set	Cut/bent	480.00	480.00	✓
24	Exhaust muffler slider	1 pc	Cut	250.00	180.00	✓
25	Rear aluminium top box (55L)	1 pc	Cut	780.00	680.00	✓
26	Rear shad side case	1 set	Cut	1,300.00	1,300.00	✓
27	Dirtrack motorcycle pannier rack	1 set	Distorted	518.40	518.40	✗ nn
				4,763.60	4,591.60	

PRUDENT ADJUSTORS SERVICES

Vehicle No: FBT 6677 D

Our Ref: PA/FBT6677/0822/tpw

ADJUSTMENT ON REPAIR COST AND REPLACEMENT OF PARTS

Labour Charges

Towing (2 trips)	150.00	120.00	100
Front wheel rim balance	120.00	80.00	50
Align body frame	550.00	450.00	200
Remove & replace accident damaged parts	1,000.00	800.00	300
	<u>1,820.00</u>	<u>1,450.00</u>	650

3 days

Total parts & labour concluded	<u>13,950.91</u>	<u>13,000.49</u>
--------------------------------	------------------	------------------

8666.01

Lump sum repair adjustment (less 10% due to no used parts)

L/S - 6832.80

11,700.00

6850 6900

The information contained in this document is privileged and confidential and is intended for the exclusive use of the addressee designation. If you are not the addressee; any enclosure, reproduction, distribution or other dissemination or use of this communication is strictly prohibited. If you have received this document not meant for you, please contact us immediately to arrange for it to return.


Prudent Adjustors Services
Bok Jee Tan













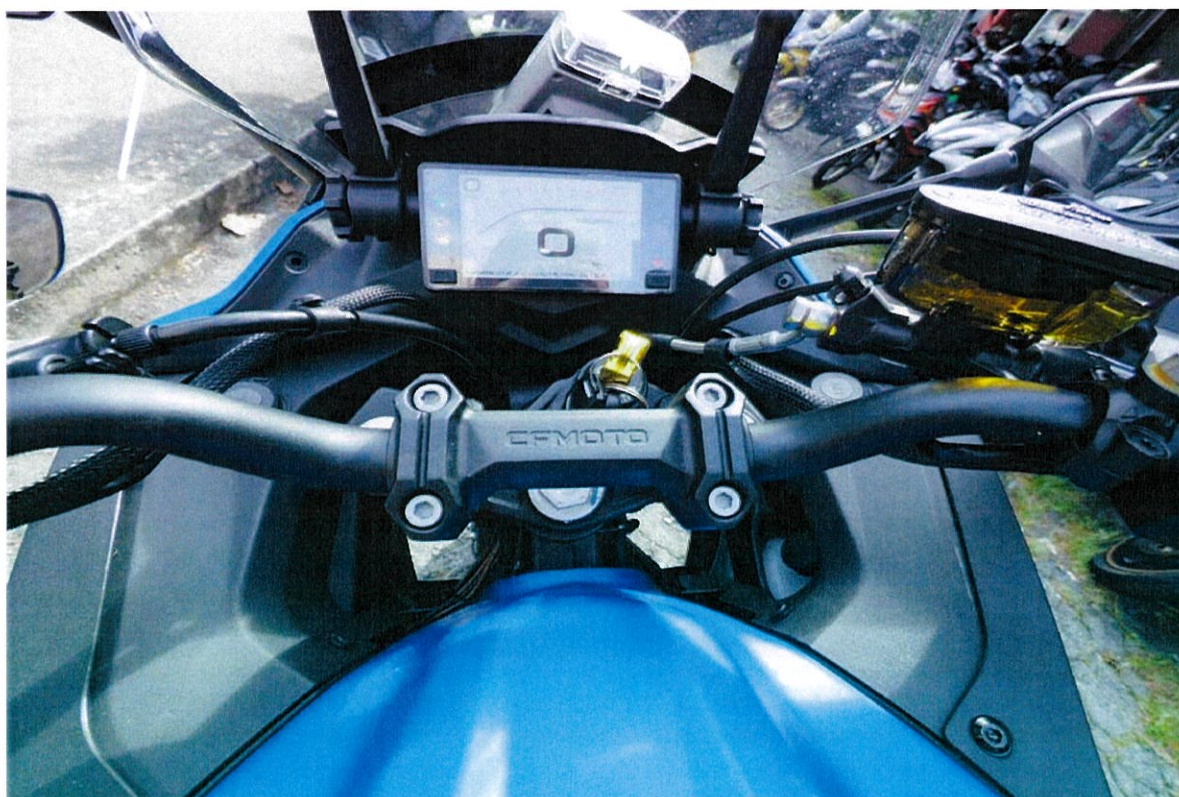








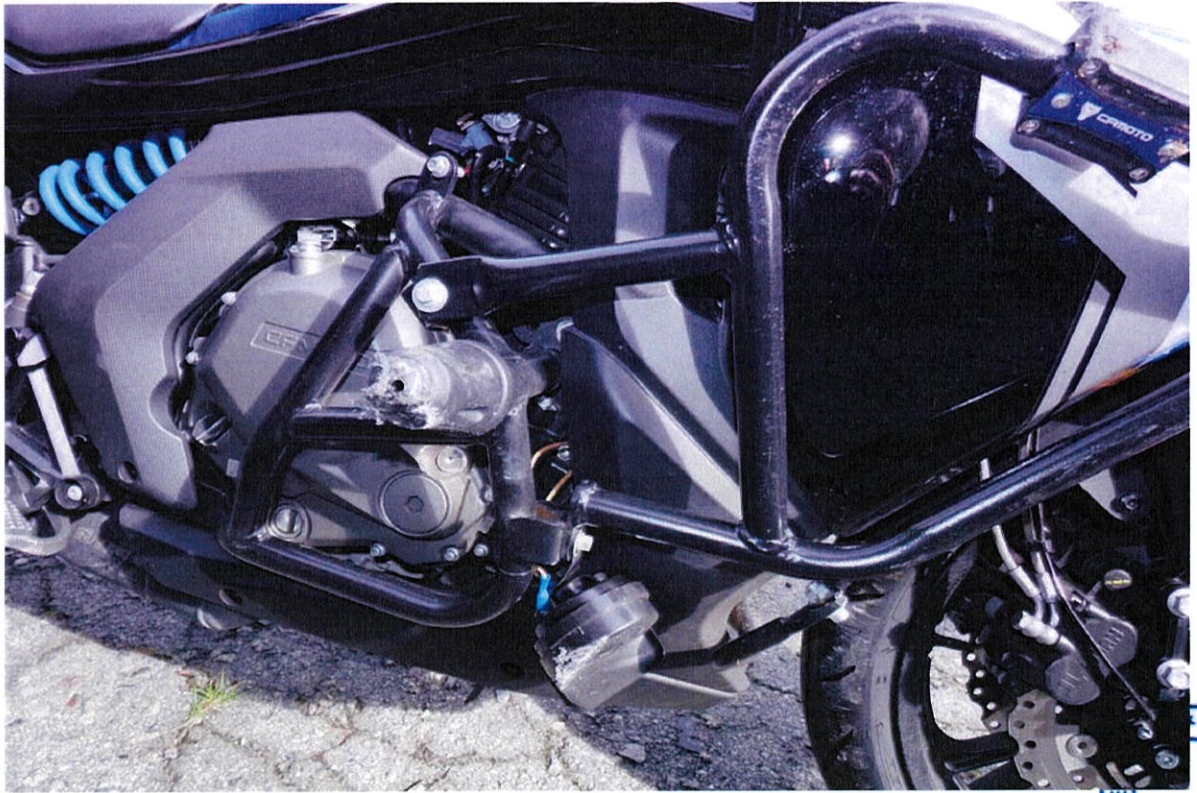





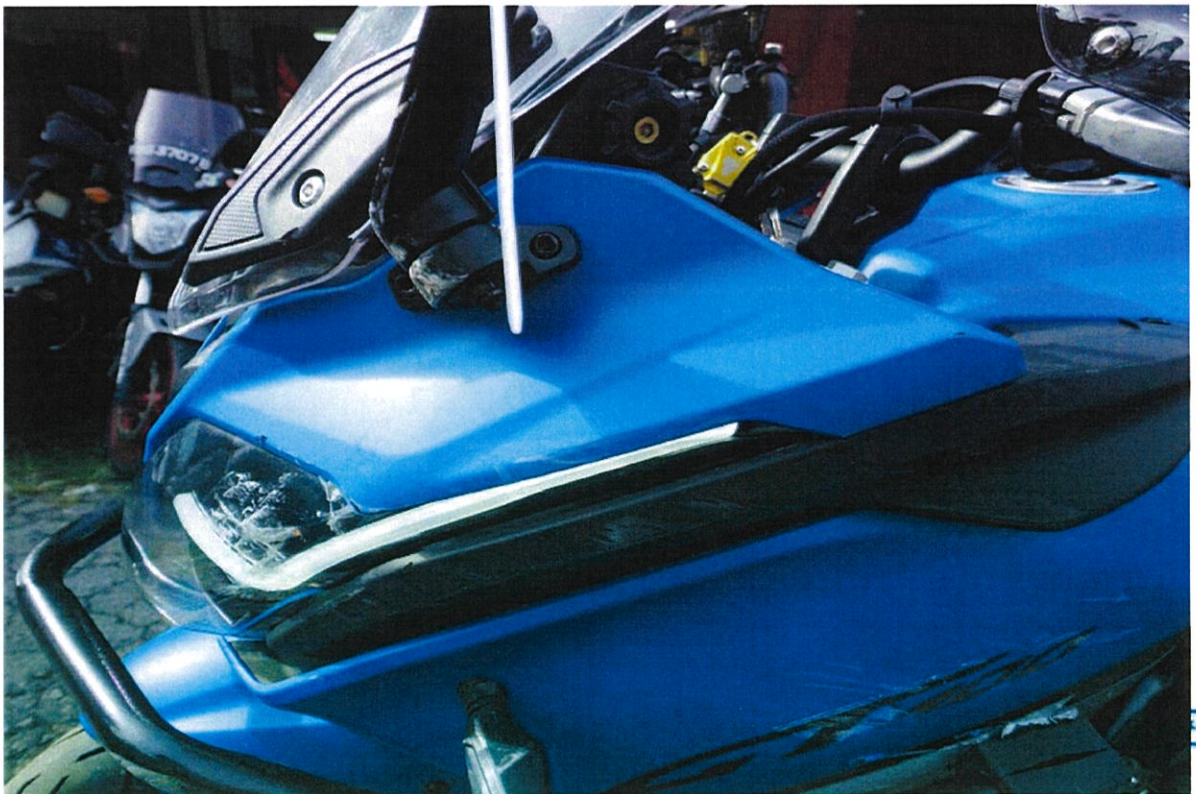

























Re-Survey
After Repair





Re-Survey
After Repair





Re-Survey
After Repair





Re-Survey After Repair





Re-Survey
After Repair



