



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

PRE-REPAIR INSPECTION REPORT

SOMPO INSURANCE SINGAPORE PL
50 RAFFLES PLACE #03-03
SINGAPORE LAND TOWERSINGAPORE 048623

Ref: CS3/SMO23000696/Kqy3m4

Date: 09/02/2023

Code: SMO

1. Policy Particulars :- (THIRD PARTY CLAIM)

| | | | |
|---------------------|-----------------|-----------------------|------------|
| Insured Veh. | SKV 4219P | Veh. Inspected | SNA 6645D |
| Policy No. | D22MTPV01011306 | Coverage (\$) | 0.00 |
| Claim No. | CMTD2300191/RUC | Excess (\$) | 0.00 |
| Assign From | MELVIN YE | Assign Date | 20/01/2023 |

2. Vehicle Particulars & Condition

 
| | | | |
|-------------------------|-------------------|---------------------|--------------------|
| Make & Model | BMW 216I (A) | c.c | 1499 |
| Engine No. | HIDDEN | Year of Reg. | 2021 |
| Chassis No. | WBA6V120205S77666 | Colour | METALLIC BEIGE |
| Odometer | 19958 KM | Steering | IN ORDER |
| Brakes | IN ORDER | Modification | STANDARD ALLOY RIM |
| General | GOOD | | |

3. Conditions of Tyres

| | Size | Make | Balance |
|-----------------------|------------|----------|---------|
| R/H Front Tyre | 205/55 R17 | MICHELIN | 7 mm |
| L/H Front Tyre | 205/55 R17 | MICHELIN | 7 mm |
| R/H Rear Tyre | 205/55 R17 | MICHELIN | 7 mm |
| L/H Rear Tyre | 205/55 R17 | MICHELIN | 7 mm |

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT O/S PORTION.



5. General Information

| | | | |
|-----------------------|---|----------------------------|-------------------------|
| Accident Date | 12/01/2023 | Inspect Date / Time | 30/01/2023 (01:37 PM) |
| Survey held at | BLK 5035 ANG MO KIO INDUSTRIAL PARK 2 #01-349 | | |
| Repairer | ZOLAR AUTO SERVICES | | |

5a. Remarks

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION. THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.
C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.
D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$5,000-\$6,000

5b. Estimate Days of Repair

| | |
|--|-----------------------|
| ESTIMATED NORMAL PERIOD FOR REPAIR: | 4 Working Days |
|--|-----------------------|

Report Ref No. CS3/SMO23000696/Kqy3m4

Inspected By

KONG SENG CHEONG

Licensed Appraiser

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or replying on this Report, in whole or in part, does so at his or her own risk.