



 
LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

| PRE-REPAIR INSPECTION REPORT  |                |   |   |         |                    |                         |
|---|----------------|---|---|---------|--------------------|-------------------------|
| HSBC LIFE (SINGAPORE) PTE LTD<br>10 MARINA BOULEVARD<br>#48-01 MARINA BAY FINANCIAL CENTRE TOWER<br>2SINGAPORE 018983<br>ATTN: KITTY TEO  |                |   | Ref: CS3/ASM23000811/Wqp3e2<br>Date: 15/02/2023<br>Code: HSB                          |         |                    |                         |
| 1. Policy Particulars :- (THIRD PARTY CLAIM)  |                |   |   |         |                    |                         |
| Insured Veh.  |                | SHC 7593Z   | Veh. Inspected  |         | SML 9852G          |                         |
| Policy No.  |                |   | Coverage (\$)   |         | 0.00               |                         |
| Claim No.   |                | S3M04ICX  | Excess (\$)   |         | 0.00               |                         |
| Assign From   |                | KITTY TEO   | Assign Date   |         | 27/01/2023         |                         |
| 2. Vehicle Particulars & Condition  |                |   |   |         |                    |                         |
| Make & Model  |                | PEUGEOT 5008 ALLURE   | c.c   |         | 1598               |                         |
| Engine No.  |                | HIDDEN  | Year of Reg.  |         | 2019               |                         |
| Chassis No.   |                | VF3M45GZWJL024136   | Colour  |         | WHITE              |                         |
| Odometer  |                | 53316 KM  | Steering  |         | IN ORDER           |                         |
| Brakes  |                | IN ORDER  | Modification  |         | STANDARD ALLOY RIM |                         |
| General   |                | GOOD  |   |         |                    |                         |
| 3. Conditions of Tyres  |                |   |   |         |                    |                         |
|   |                | Size  | Make  | Balance |                    |                         |
|   | R/H Front Tyre | 235/55 R18  | PIRELLI   | 6 mm    |                    |                         |
|   | L/H Front Tyre | 235/55 R18  | PIRELLI   | 6 mm    |                    |                         |
|   | R/H Rear Tyre  | 235/55 R18  | PIRELLI   | 6 mm    |                    |                         |
|   | L/H Rear Tyre  | 235/55 R18  | PIRELLI   | 6 mm    |                    |                         |
| 4. Description of Damages   |                |   |   |         |                    |                         |
| THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION AND N/S BODY.  |                |   |  |         |                    |                         |
| 5. General Information  |                |   |   |         |                    |                         |
| Accident Date   |                | 25/01/2023  | Inspect Date / Time   |         |                    | 08/02/2023 ( 12:19 PM ) |
| Survey held at  |                | HOCK MOTORS WORKSHOP<br>NO.1 KAKI BUKIT AVE 6 #02-38 AUTOBAY @KAKI BUKIT SINGAPORE 417883 |   |         |                    |                         |
| 5a. Remarks   |                |   |   |         |                    |                         |
| A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.<br>B) THE REPAIR ESTIMATE WAS NOT PRESENTED AT THE TIME OF INSPECTION.<br>THE REPAIRER WAS TOLD TO PREPARE THE ESTIMATE.<br>C) ENCLOSED PLEASE FIND DAMAGED VEHICLE PHOTOGRAPHS.<br>D) THE ESTIMATED REPAIR COST OF THE DAMAGED VEHICLE IS IN THE REGION OF \$6,700-\$7,700 |                |   |   |         |                    |                         |
| 5b. Estimate Days of Repair   |                |   |   |         |                    |                         |
| ESTIMATED NORMAL PERIOD FOR REPAIR:   |                |   | 5 Working Days  |         |                    |                         |

Report Ref No. CS3/ASM23000811/Wqp3e2

Inspected By

MUHAMMAD AKID BIN MOHAMED KAMAL

Asst. Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons),B.Bus,MBA,PEng,PE, MInstAEA,MASME,MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.  
No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or  
relying on this Report, in whole or in part, does so at his or her own risk.