

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com; cs-a@lkkauto.com; admin-a@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT**Our File No:** CC6/AIG23000844/UPA3Q2**Date:** 07/07/2023**REFERENCE**

Handling Insurer:	AIG Asia Pacific Insurance Pte. Ltd.	Policy No:	0999993602
Claimant Vehicle No :	SJP226M	Insured Vehicle No :	GBF635M
Date of Loss:	20/01/2023	Nature of Claim:	TP
		Claim No:	9383088042SG

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SJP226M	Engine No:	K24W71011580
Make & Model:	HONDA ODYSSEY, 2.4 EX-S CVT (A)	Chassis No:	JHMRC1880FC203190
Reg. Date:	16/09/2015 (Man. Year: 2015)	Odometer:	126923 km
Colour:	Blue		
Engine Capacity:	2356 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	215/55 R17	Rear Tyre Size:	215/55 R17
Front Left Side:	Yokohama 6 mm	Rear Left Side:	Yokohama 6 mm
Front Right Side:	Yokohama 6 mm	Rear Right Side:	Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	11,672.48	6,096.96	5,575.52	47.77
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,210.00	2,290.00	920.00	28.66
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	14,882.48	8,386.96	6,495.52	43.65
Approved Total (Overridden) (S\$)		6,700.00		
(S\$)	14,882.48	6,700.00	8,182.48	54.98
+ GST 8.00/8.00% (S\$)	1,190.60	536.00	654.60	54.98
Nett Amount (S\$)	16,073.08	7,236.00	8,837.08	54.98
+ Car Rental (9.0 x S\$100.00/day + 8.00% GST) (S\$)		972.00		
Nett Liability (S\$)		8,208.00		

INSPECTION

Date of Assignment:	27/01/2023		
Date Inspected:	27/01/2023	Inspected At:	TLM Automobile Pte Ltd (HQ) 1 Defu Lane 6 Singapore 539365
Estimated Period of Repair:	7.0 days		

Adjuster: MARCUS CHUA**Manager:** CHEW HSIAO TONG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*REAR TAILGATE	Badly Dented	1,850.00 FL	*1,146.20 FL
2	1		*REAR TAILGATE WINDSCREEN MOULING	Necessary	195.00 FL	*80.60 FL
3	1		*REAR TAILGATE OUTER REFLECTOR CENTRE	Scratched	280.00 FL	*246.70 FL
4	1		*REAR TAILGATE OUTER GARNISH LOGO	Missing	75.00 FL	*48.00 FL
5	1		*REAR TAILGATE EMBLEM ODYSSEY	Not Necessary	85.00 FL	*- FL
6	2		*REAR TAILGATE REFLECTOR LAMP	Broken	900.00 FL	*826.80 FL
7	2		*REAR TAILGATE NO PLATE LAMP	Not Necessary	90.00 FL	*- FL
8	1		*REAR TAILGATE WIPER MOTOR	Not Necessary	490.00 FL	*- FL
9	1		*REAR TAILGATE LOCK	Dented / Damaged	220.00 FL	*200.40 FL
10	1		*REAR TAILGATE TRIMBOARD	Deformed / Torn	295.00 FL	*295.00 FL
11	1		*REAR TAILGATE INNER HANDLE	Cut	110.00 FL	*60.00 FL
12	2		*REAR TAILGATE STOPPER	Necessary	50.00 FL	*50.00 FL
13	1		*REAR TAILGATE WEATHERSTRIP	Twisted	185.00 FL	*185.00 FL
14	1		*REAR TAILGATE LOWER CHROME	Cracked	187.00 FL	*187.00 FL
15	1		*REAR TAIL LAMP	N/S Cut	1,670.00 FL	*835.00 FL
16	1		*REAR BUMPER	Dented	680.00 FL	*592.70 FL
17	2		*REAR BUMPER SIDE COVER RETAINER	Not Necessary	130.00 FL	*- FL
18	2		*REAR BUMPER SIDE COVER	Not Necessary	190.00 FL	*- FL
19	2		*REAR BUMPER SIDE RETAINER	Not Necessary	150.00 FL	*- FL
20	2		*REAR BUMPER REFLECTOR	Not Necessary	190.00 FL	*- FL
21	1		*END PANEL	Badly Dented	690.00 FL	*493.20 FL
22	1		*END PANEL TOP GARNISH	Twisted	150.00 FL	*150.00 FL
23	1		*SPARE TYRE PANEL	Buckled	1,050.00 FL	*905.00 FL
24	1		*SPARE TYRE TOP BOARDS	Not Necessary	495.00 FL	*- FL
25	1		*REAR FENDER INNER TRIMBOARD	N/S Deformed	1,960.00 FL	*735.40 FL
26	1		*KEYLESS SENSOR	Cracked	105.00 FL	*80.60 FL
27	1		*REVERSE CAMERA	Not Necessary	450.00 FL	*- FL
28	1		*REVERSE SENSOR WIRE HARNESS	Not Necessary	640.00 FL	*- FL
29	1		*REAR BUZZER SENSOR	Cracked	128.60 FL	*128.60 FL
30	1		*SET REAR BUMPER REVERSE SENSOR	Shorted	450.00 FS	*200.00 FS
31	1		*SET REAR BUMPER CLIPS	Necessary	50.00 FS	*30.00 FS
32	1		*REAR NUMBER PLATE	Serviceable	60.00 FS	*- FS
33	1		*SET TAILGATE TRIMBOARD CLIPS	Necessary	60.00 FS	*30.00 FS
34	1		*TAILGATE WINDSCREEN SEALANT	Necessary	100.00 FS	*40.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	14,410.60	7,546.20
- List Item Discount on L Items 20.00/20.00% (\$\$)	2,738.12	1,449.24
Total Parts (\$\$)	11,672.48	6,096.96

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	PANEL BEATING ,KNOCKING AND STRAIGHTEN THE NECESSARY PORTION ,REMOVE AND RENEWAL OF PARTS ,ADJUST AND REALIGN THE SAME	New	1,200.00	900.00
2	PUTTY AND SPRAY PAINTING OF THE AFFECTED PORTION	New	1,200.00	1,000.00
3	TO RUST-PROOFING OF THE AFFECTED AREAS	New	200.00	60.00
4	TO TRANSFER OF TAILGATE FITTINGS ,FIXTURE AND PERFORM WATER SEEPAGE TEST	New	100.00	60.00
5	TO REPLACE REAR PARKING SENSOR	New	80.00	50.00
6	TO REMOVE AND REFIX REAR UPHOLSTERY ASSY ,INNER TRIM BOARDS AND REAR SEATS ASSY	New	200.00	80.00
7	TO CHECK ELECTRICAL LIGHTING CONCERNED	New	80.00	20.00
8	TO REMOVE AND REFIX REAR WINDSCREEN GLASS	New	150.00	120.00
Gross Labour Cost (S\$)			3,210.00	2,290.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >